


# Three phase induction motors used in explosive atmospheres (low and high voltage)

M line – Slip ring rotor - Horizontal

Installation, Operation and Maintenance Manual

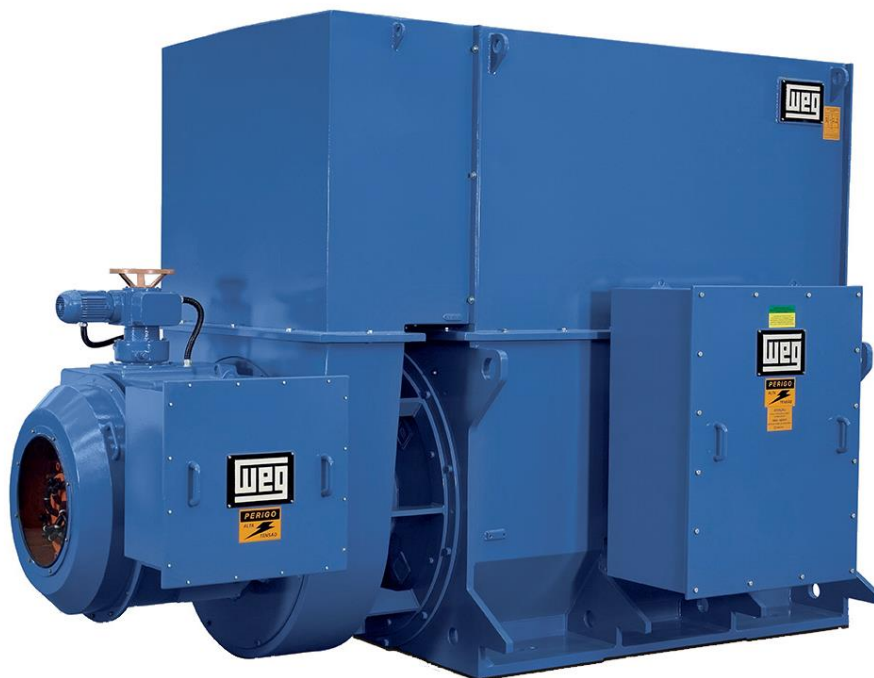





# **Installation, Operation and Maintenance Manual**

**Models: MAD, MAT, MAF, MAR, MAI, MAW and MAL**

Document Number: 13596972

Language: English

Revision: 07

January 2025



Dear Customer,

Thank you for purchasing a WEG motor. Our products are developed with the highest standards of quality and efficiency which ensures outstanding performance.

Since electric motors play a major role in the comfort and well-being of mankind, it must be identified and treated as a driving machine with characteristics that involve specific care, such as proper storage, installation and maintenance

All efforts have been made to ensure that the information contained in this manual is faithful to the configurations and applications of the motor.

Therefore, we recommend that you read this manual carefully before proceeding with the installation, operation or maintenance of the motor in order to ensure safe and reliable operation of your equipment and facility. If you need any further information, please contact WEG.

Always keep this manual close to the motor, so that it can be consulted whenever necessary.



#### ATTENTION

1. It is imperative to follow the procedures contained in this manual for the warranty to be valid;
2. The motor installation, operation and maintenance procedures must be performed only by qualified personnel.



#### NOTES

1. The total or partial reproduction of information supplied in this manual is authorized, provided that reference is made to its source.
2. If this manual is lost, an electronic PDF file is available at [www.weg.net](http://www.weg.net) or another printed copy may be requested.
3. All machines are equipped with a unique QR code located next to the machine's nameplate. This QR code provides quick and easy access to various services, including:
  - Technical support
  - Spare parts
  - Commissioning
  - General and maintenance services in the field and at the factory

To use this feature, simply scan the QR code with your mobile device. Be sure to keep this manual on hand for future reference and to ensure the correct and safe use of the electric motor.

**WEG EQUIPAMENTOS ELÉTRICOS S.A.**



# TABLE OF CONTENTS

<b>1</b>	<b>INTRODUCTION .....</b>	<b>11</b>
1.1	SAFETY WARNINGS IN THE MANUAL.....	11
<b>2</b>	<b>GENERAL INSTRUCTIONS .....</b>	<b>12</b>
2.1	QUALIFIED PERSONNEL .....	12
2.1.1	Explosive atmospheres .....	12
2.2	SAFETY INSTRUCTIONS .....	12
2.3	MOTORS APPLIED IN EXPLOSIVE ATMOSPHERES.....	12
2.3.1	General Precautions .....	13
2.3.2	Additional Precautions .....	13
2.4	STANDARDS .....	13
2.5	ENVIRONMENTAL CONDITIONS.....	13
2.5.1	Application in explosive atmosphere.....	13
2.6	OPERATING CONDITIONS.....	14
2.6.1	Special application conditions.....	14
2.7	VOLTAGE AND FREQUENCY .....	14
<b>3</b>	<b>RECEIVING, HANDLING AND STORAGE.....</b>	<b>15</b>
3.1	RECEIVING.....	15
3.1.1	Additional Precautions .....	15
3.2	HANDLING .....	15
3.3	STORAGE .....	15
3.3.1	Outdoor storage .....	15
3.3.2	Extended storage.....	16
3.3.2.1	Storage location .....	16
3.3.2.1.1	Indoor storage .....	16
3.3.2.1.2	Outdoor storage.....	16
3.3.2.2	Separate parts.....	17
3.3.3	Preservation during the storage .....	17
3.3.3.1	Cooling system.....	17
3.3.3.2	Space heater.....	17
3.3.3.2.1	Drain .....	17
3.3.3.3	Insulation resistance .....	17
3.3.3.4	Exposed machined surfaces .....	17
3.3.3.5	Sealing.....	17
3.3.3.6	Bearings.....	17
3.3.3.6.1	Grease-lubricated rolling bearing .....	17
3.3.3.6.2	Oil-lubricated rolling bearing.....	17
3.3.3.6.3	Sleeve bearing.....	18
3.3.3.7	Brushes.....	18
3.3.3.8	Terminal boxes.....	18
3.3.3.9	Air-water heat exchanger .....	18
3.3.3.10	Pressurization system .....	19
3.3.3.11	Cleanliness and conservation of the motor during storage.....	19
3.3.3.12	Inspections and records during storage .....	19
3.3.3.13	Predictive / preventive maintenance.....	19
3.3.3.14	Maintenance plan during storage .....	20
3.3.4	Preparation for commissioning .....	21
3.3.4.1	Cleaning.....	21
3.3.4.2	Bearing inspection.....	21
3.3.4.3	Bearing lubrication.....	21
3.3.4.4	Brushes, brush holders and slip rings .....	21
3.3.4.5	Insulation resistance verification .....	21
3.3.4.6	Air-water heat exchanger .....	21
3.3.4.7	Others .....	21
<b>4</b>	<b>INSTALLATION .....</b>	<b>22</b>
4.1	INSTALLATION SITE .....	22
4.2	SHAFT LOCK.....	22
4.3	ROTATION DIRECTION .....	22
4.4	INSULATION RESISTANCE.....	22
4.4.1	Safety Instructions .....	22
4.4.2	General considerations.....	22
4.4.3	Measurement on the stator windings.....	22
4.4.4	Measurement on the rotor winding .....	23

4.4.5	Additional Information .....	23
4.4.6	Polarization Index .....	23
4.4.7	Conversion of the measured values .....	23
4.4.8	Recommended Minimum Values .....	23
4.5	PROTECTIONS .....	24
4.5.1	Protections – explosive atmospheres .....	24
4.5.2	Thermal protections .....	24
4.5.2.1	Temperature sensors for explosive atmospheres .....	24
4.5.2.2	Temperature limits for the windings .....	24
4.5.2.3	Alarm and trip temperatures .....	24
4.5.2.4	Temperature and ohmic resistance of the PT100 thermoresistance .....	25
4.5.2.5	Space heater .....	25
4.5.3	Water leak sensor .....	25
4.6	COOLING .....	25
4.6.1	Enclosed motors .....	26
4.6.2	Open motors .....	26
4.6.3	Air-water heat exchange cooling .....	27
4.6.3.1	Radiators for application with seawater .....	27
4.6.4	Independent ventilation cooling .....	27
4.6.5	Air/Air heat exchanger cleaning .....	27
4.7	ELECTRICAL ASPECTS .....	27
4.7.1	Electrical connections .....	27
4.7.1.1	Main electrical connections .....	27
4.7.1.2	Additional information .....	28
4.7.1.3	Grounding .....	28
4.7.2	Connection diagrams .....	29
4.7.2.1	Connection diagrams according to IEC60034-8 .....	29
4.7.2.1.1	Stator connection diagrams .....	29
4.7.2.1.2	Rotor connection diagrams .....	29
4.7.2.2	Connection diagrams according to NEMA MG1 .....	30
4.7.2.2.1	Stator connection diagrams .....	30
4.7.2.2.2	Rotor connection diagrams .....	30
4.7.2.3	Rotation direction .....	30
4.7.2.4	Accessory connection diagrams .....	30
4.7.2.5	Motorized brush holder connection diagram .....	31
4.7.2.5.1	Condition for starting with lowered brushes and non-short-circuited slip rings .....	31
4.7.2.5.2	Condition for operation with lifted brushes and short-circuited slip rings .....	32
4.7.2.5.3	Motorized brush holder operation logic .....	33
4.7.2.5.4	Manual operation .....	33
4.8	MECHANICAL ASPECTS .....	33
4.8.1	Base .....	33
4.8.2	Base loads .....	34
4.8.3	Base types .....	34
4.8.3.1	Concrete base .....	34
4.8.3.2	Sliding base .....	34
4.8.3.3	Metal base .....	34
4.8.3.4	Anchor bolts .....	34
4.8.4	Anchor plate set .....	35
4.8.5	Natural frequency of the base .....	35
4.8.6	Leveling .....	35
4.8.7	Alignment .....	35
4.8.8	Doweling .....	36
4.8.9	Couplings .....	36
4.8.9.1	Direct coupling .....	37
4.8.9.2	Gear coupling .....	37
4.8.9.3	Belt drive .....	37
4.8.9.3.1	Electrostatic charge .....	37
4.8.9.4	Coupling of motors equipped with sleeve bearings .....	37
4.9	HYDRAULIC UNIT .....	38
4.10	PURGE AND PRESSURIZATION SYSTEM .....	38
4.11	ADDITIONAL COMPONENTS .....	38

## 5 STARTING..... 39

5.1	STARTING WITH RHEOSTAT .....	39
5.2	STARTING OF MOTORS WITH MOTORIZED BRUSH HOLDER .....	39
5.2.1	Conditions for motor starting .....	39
5.2.2	After starting .....	39
5.2.3	Manual operation .....	40



<b>6</b>	<b>COMMISSIONING.....</b>	<b>41</b>
6.1	PRELIMINARY INSPECTION.....	41
6.2	FIRST STARTING.....	41
6.2.1	Ex “p” Motors.....	41
6.2.2	Starting procedure.....	41
6.3	OPERATION.....	42
6.3.1	General.....	42
6.3.2	Load Condition.....	42
6.3.3	Temperatures.....	42
6.3.4	Bearings.....	42
6.3.4.1	High-pressure oil injection system.....	42
6.3.5	Radiators.....	42
6.3.6	Vibration.....	43
6.3.7	Shaft vibration limits.....	43
6.3.8	Shutdown.....	43
<b>7</b>	<b>MAINTENANCE.....</b>	<b>44</b>
7.1	GENERAL.....	44
7.1.1	Brushes and slip rings.....	44
7.2	GENERAL CLEANING.....	45
7.2.1	Electrostatic charge.....	45
7.3	BRUSHES COMPARTMENT CLEANING.....	45
7.4	WINDING MAINTENANCE.....	45
7.4.1	Winding inspection.....	45
7.4.2	Winding cleaning.....	45
7.4.3	Inspections.....	45
7.4.4	Reimpregnation.....	45
7.4.5	Insulation Resistance.....	46
7.5	ELECTRICAL CONNECTION INSPECTION.....	46
7.6	MECHANICAL INSTALLATION INSPECTION.....	46
7.7	COOLING SYSTEM MAINTENANCE.....	46
7.8	RADIATOR MAINTENANCE.....	46
7.9	VIBRATION.....	46
7.10	SLIP RINGS.....	46
7.11	BRUSH HOLDER AND BRUSHES.....	47
7.11.1	Adjustment of the brushes to the load conditions.....	47
7.12	PURGE AND PRESSURIZATION SYSTEM.....	47
7.13	BEARING MAINTENANCE.....	48
7.13.1	Grease-lubricated rolling bearings.....	48
7.13.1.1	Instructions for lubrication.....	48
7.13.1.2	Procedures for rolling bearing relubrication.....	48
7.13.1.3	Rolling bearing relubrication with drawer device for grease removal.....	48
7.13.1.4	Type and amount of grease.....	48
7.13.1.5	Alternative greases.....	48
7.13.1.6	Procedure for changing the grease.....	49
7.13.1.7	Low temperature greases.....	49
7.13.1.8	Grease compatibility.....	49
7.13.1.9	Bearing disassembly.....	50
7.13.1.10	Bearing assembly.....	50
7.13.2	Oil-lubricated rolling bearing.....	50
7.13.2.1	Lubrication instructions.....	50
7.13.2.2	Oil type.....	51
7.13.2.3	Oil change.....	51
7.13.2.4	Bearing operation.....	51
7.13.2.5	Bearing disassembly.....	51
7.13.2.6	Bearing assembly.....	52
7.13.3	Rolling bearing replacement.....	52
7.13.4	Sleeve bearings.....	52
7.13.4.1	Bearing data.....	52
7.13.4.2	Bearing installation and operation.....	52
7.13.4.3	Cooling by water circulation.....	52
7.13.4.4	Oil change.....	52
7.13.4.5	Sealing.....	53
7.13.4.6	Sleeve bearing operation.....	53
7.13.4.7	Sleeve bearing maintenance.....	53
7.13.4.8	Bearing disassembly and assembly.....	54
7.13.5	Bearing protection.....	55
7.13.5.1	Protection settings.....	55
7.13.5.2	Disassembly/assembly of the sleeve bearing temperature sensors.....	55

7.14	MAINTENANCE OF THE BRUSH LIFTING SYSTEM .....	56
7.14.1	Parts list .....	57
7.14.2	Preventive maintenance procedures .....	57
7.14.3	Adjustment of the electromechanical actuator .....	57
7.14.3.1	Mechanical adjustment .....	58
7.14.3.2	Electrical adjustment .....	58
7.14.3.3	Slip rings short-circuit contacts .....	58
<b>8</b>	<b>MOTOR DISASSEMBLY AND ASSEMBLY .....</b>	<b>59</b>
8.1	QUALIFIED PROFESSIONAL .....	59
8.2	DISASSEMBLY .....	59
8.3	ASSEMBLY .....	59
8.4	AIR-GAP MEASUREMENT .....	59
8.5	TIGHTENING TORQUE .....	60
8.6	SPARE PARTS .....	61
8.7	ADDITIONAL INFORMATION .....	62
<b>9</b>	<b>MAINTENANCE PLAN .....</b>	<b>63</b>
<b>10</b>	<b>ABNORMALITIES, CAUSES AND SOLUTIONS .....</b>	<b>67</b>
<b>11</b>	<b>DECLARATION OF CONFORMITY EX .....</b>	<b>69</b>
<b>12</b>	<b>ENVIRONMENTAL INFORMATION .....</b>	<b>71</b>
12.1	PACKAGE .....	71
12.2	PRODUCT .....	71
12.3	HAZARDOUS WASTE .....	71
<b>13</b>	<b>SERVICE NETWORK .....</b>	<b>71</b>
<b>14</b>	<b>WARRANTY TERM .....</b>	<b>72</b>

# 1 INTRODUCTION

This manual contains information regarding low and high-voltage, three-phase induction motors.

Motors with special features can be supplied with specific documents (drawings, connection diagram, characteristic curves etc.). Those documents, together with this manual, must be thoroughly evaluated before proceeding with the installation, operation or maintenance of the motor.

In order to use a frequency inverter, it is mandatory to follow the instructions contained in the specific technical documentation of the motor and in the manual of the frequency inverter.

If any additional explanation about motors with major special features is necessary, consult WEG. All procedures and standards contained in this manual must be observed in order to ensure proper operation of the motor and the safety of the personnel involved in its operation. Following these procedures is also important to ensure the validity of the motor warranty. Thus, we recommend the careful reading of this manual before the installation and operation of the motor. If any further information is still necessary, consult WEG.

## 1.1 SAFETY WARNINGS IN THE MANUAL

In this manual, the following safety warnings are used:



### DANGER

Failure to observe the procedures recommend in this warning may result in death, serious injuries and extensive equipment damage.



### ATTENTION

Failure to observe the procedures recommend in this warning may result in equipment damage.



### NOTE

This provides important information for correct understanding and proper operation of the product.



### EX

Additional information about motors for explosive atmospheres.

## 2 GENERAL INSTRUCTIONS

All the personnel involved with the assembly, operation or maintenance of electrical installations must be permanently informed and updated on the standards and safety instructions that guide the job and are advised to strictly comply with them. Before beginning any job, the person in charge must make sure that all points have been duly observed and warn the respective personnel about the danger inherent to the task to be performed.

Improper application, inadequate handling or maintenance of the motor, may cause serious injuries and/or material damages.

Therefore, it is highly recommended that these services be always performed by qualified personnel.

### 2.1 QUALIFIED PERSONNEL

The term qualified personnel means those who, because of their training, experience, education level, and knowledge of the applicable standards, specifications, accident prevention, safety standards and operating conditions, have been authorized by the persons in charge to execute the necessary tasks, and who are able to recognize and avoid any possible danger. Such qualified personnel must also know and be able to provide first aid procedures if necessary.

The entire start-up, maintenance and repair tasks must only be performed by qualified personnel.

#### 2.1.1 Explosive atmospheres



**EX**

It is recommended that the persons responsible for the application of motors in hazardous areas be properly trained on their correct application.

### 2.2 SAFETY INSTRUCTIONS



**DANGER**

During normal operation of this equipment, a hazard associated with energized or rotating components with high voltage or elevated temperatures exists.

Thus, the operation with open terminal boxes, unprotected couplings, improper handling, or failure to comply with the operating standards, may cause severe personal injuries and material damages.



**ATTENTION**

When devices and equipment are used outside the industrial environment, the user must ensure the safety of the equipment by adopting proper protection and safety measures during installation (for example, keep people away, avoid contact of children, etc.).

Those responsible for the safety of the installation must ensure that:

- Only qualified personnel install and operate the equipment;
- They have this manual and all other documents supplied with the motor at hand, as well as that they perform the tasks in strict compliance with the service instructions, relevant standards and specific product documentation;



**ATTENTION**

Failure to comply with installation and safety standards may void the product warranty.

Firefighting equipment and first aid notices must be available in visible and easily accessible locations at the work site.

**Qualified personnel must also observe:**

- All the technical data regarding the allowed applications (operating conditions, connections and installation environment), included in the catalog, in the purchase order documents, in the operating instructions, in manuals and all other documentation;
- The specific regulations and conditions for the local installation;
- The use of suitable tools and equipment for handling and transportation;
- That the protective devices of the individual components are removed shortly before installation.

Individual parts must be stored in vibration-free environments, avoiding falls and ensuring their protection against aggressive agents and/or that they do not jeopardize people.

### 2.3 MOTORS APPLIED IN EXPLOSIVE ATMOSPHERES



**EX**

Motors specified to operate in hazardous areas have additional safety features, which are defined in specific standards for each kind of hazardous area, according to their classification.

The general requirements for equipment that operate in hazardous areas are described in the following Brazilian and international standards:

- **IEC 60079-0** - Electrical Apparatus for Explosive Gas Atmospheres - Part 0: General Requirements;
- **ABNT NBR IEC 60079-0** - Atmosferas Explosivas - Parte 0: Equipamentos - Requisitos Gerais;
- **IEC 60034-1** - Rotating Electrical Machines - Part 1: Rating and Performance;
- **IEC 60079-2** - Electrical Apparatus for Explosive Gas Atmospheres. Part 2: Pressurized Enclosures 'p';
- **ABNT NBR IEC 60079-2** - Atmosferas Explosivas - Parte 2: Proteção de Equipamento por Invólucro Pressurizado 'p';
- **IEC 60079-7** - Electrical Apparatus for Explosive Gas Atmospheres - Part 7: Increased Safety 'e';
- **ABNT NBR IEC 60079-7** - Atmosferas Explosivas - Parte 7: Proteção de Equipamentos por segurança Aumentada "e";
- **NBR IEC 60079-11** - Atmosferas Explosivas - Parte 11 - Proteção de equipamento por segurança intrínseca "i";

- **IEC 60079-11** - Explosive atmospheres - Part 11: Equipment protection by intrinsic safety “I”;
- **NBR IEC 60079-14** – Atmosferas Explosivas – Parte 14 - Seleção e montagem de instalações elétricas;
- **IEC 60079-14** – Electrical apparatus for gas explosive atmospheres – Part 14 – Electrical installation in hazardous areas (others than mines);
- **ABNT NBR IEC 60079-14** – Equipamentos elétricos para atmosferas explosivas – Parte 14 – Instalação elétrica em áreas classificadas (exceto minas);
- **IEC 60079-15** - Explosive Atmospheres - Part 15 - Protection by Type of Protection ‘n’;
- **ABNT NBR IEC 60079-15** - Equipamentos Elétricos para Atmosferas Explosivas - Parte 15: Construção, Ensaio e Marcação de Equipamentos Elétricos com Tipo de Proteção ‘n’;
- **IEC 60079-17** - Explosive Atmospheres - Part 17: Electrical Installations Inspection and Maintenance
- **ABNT NBR IEC 60079-17** - Atmosferas Explosivas - Parte 17: Inspeção e Manutenção de Instalações Elétricas;
- **IEC 60079-19** - Explosive atmospheres - Part 19: Equipment repair, overhaul and reclamation.
- **NBR IEC 60079-19** – Atmosferas Explosivas – Parte 19 - Revisão e recuperação de equipamentos.

### 2.3.1 General Precautions

Before performing the installation, operation or maintenance of electric motors in hazardous areas, the following precautions must be taken:

- Study and understand the standards listed in section 2.3, according to the equipment degree of protection;
- Comply with all the requirements established by the applicable standards.

### 2.3.2 Additional Precautions

- Shut down the motor and wait until it comes to a complete stop before performing any maintenance, inspection or repair.
- All the existing protections must be installed and properly adjusted before starting the motor.
- Make sure the motor is properly grounded;
- The terminals must be properly connected in order to prevent any kind of poor contact that may cause heating or sparking.



#### NOTE

Observe all other instructions regarding storage, handling, installation and maintenance contained in this manual and applicable to the relevant motor type.

## 2.4 STANDARDS

The motors are specified, designed, manufactured and tested according to the standards described in Table 2.1. The applicable standards are specified in the commercial contract, which may indicate other national or international standards, depending on the application or installation location.

Table 2.1: Applicable standards

	IEC / NBR	NEMA
<b>Specification</b>	IEC60034-1 / NBR 17094	MG1-1,10,20
<b>Dimensions</b>	IEC60072 / NBR 15623	MG1-4,11
<b>Tests</b>	IEC60034-2 / NBR 5383	MG1-12
<b>Levels of protection</b>	IEC60034-5 / NBR IEC 60034-5	MG1-5
<b>Cooling</b>	IEC60034-6 / NBR IEC 60034-6	MG1-6
<b>Mounting</b>	IEC60034-7 / NBR IEC 60034-7	MG1-4
<b>Noise</b>	IEC60034-9 / NBR IEC 60034-9	MG1-9
<b>Mechanical Vibration</b>	IEC60034-14 / NBR IEC 60034-14	MG1-7
<b>Terminal marking</b>	IEC60034-8 / NBR 15367	MG1-2
<b>Mechanical Tolerances</b>	ISO286 / NBR6158	MG1-4
<b>Balancing</b>	ISO1940	MG1-7

## 2.5 ENVIRONMENTAL CONDITIONS

The motor was designed according to the specific environmental conditions (temperature and altitude) of your application, and are described on the nameplate and in the datasheet of the motor.



#### ATTENTION

For the use of water-cooled motors in ambient temperatures below +5°C, antifreeze additives must be added to the water.

### 2.5.1 Application in explosive atmosphere



#### EX

The application of motors in explosive atmospheres is only allowed when they were designed, built and certified for such application.

## 2.6 OPERATING CONDITIONS

In order for the product warranty to be valid, the motor must be operated according to nominal data indicated on its nameplate, observing all applicable standards and information contained in this manual.

### 2.6.1 Special application conditions



**EX**

The "X" symbol next to the certificate number, informed on the motor nameplate, indicates that it requires special installation, application and/or maintenance conditions, which are described in the Conformity Certificate.

For reference, the conformance certificate is provided with this manual.

Failure to comply with these requirements jeopardizes the safety of the product and of the installation.

## 2.7 VOLTAGE AND FREQUENCY

It is very important to ensure a proper power supply for the motor. The conductors and the entire protection system must ensure the quality of the power supply at the motor terminals within the limits, in accordance with the IEC60034-1 standard.



**EX**

Ex "e" motors are designed to allow maximum variations of the rated voltage of 5% and of the frequency of  $\pm 2\%$  (Zone "A"), according to Figure 2.1.

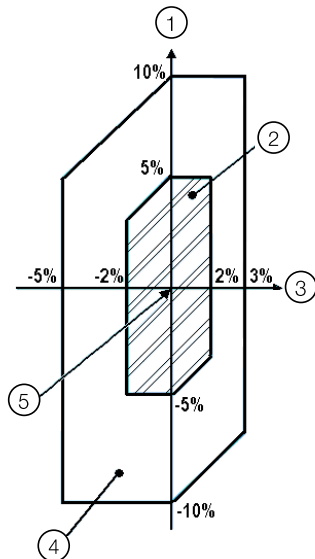


Figure 2.1: Voltage and frequency variation limits

**Figure 2.1 legend:**

1. Voltage
2. Zone A
3. Frequency
4. Zone B (outside zone A)
5. Voltage with rated characteristics

The curves in Figure 2.2 and Figure 2.3 show the effect of voltage and frequency variations on the characteristics of the motor performance.

### Percentage of variation in motor characteristics

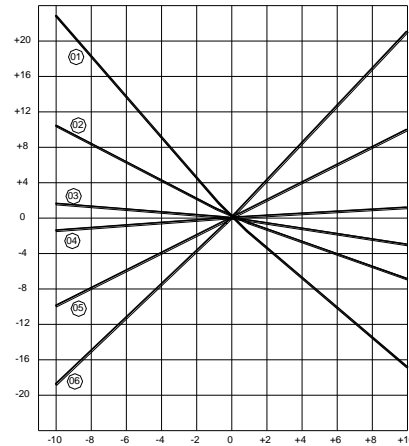


Figure 2.2: Voltage Variation percentage

**Figure 2.2 legend:**

1. Slip
2. Rated Current
3. Power Factor
4. Efficiency
5. Starting Current
6. Starting and Maximum Torque

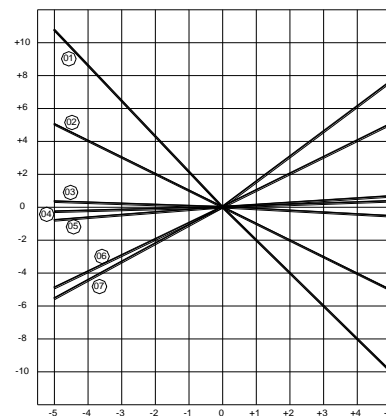


Figure 2.3: Frequency Variation Percentage

**Figure 2.3 legend:**

1. Rated Starting Torque
2. Starting Current
3. Rated Current
4. Efficiency
5. Power Factor
6. Speed
7. Cooling and Friction Losses



### ATTENTION

The effects shown in Figure 2.2 and Figure 2.3 are estimated and may vary depending on the motor type.



## 3 RECEIVING, HANDLING AND STORAGE

### 3.1 RECEIVING

All motors were tested and are in perfect operating conditions. The machined surfaces are protected against corrosion. The package must be inspected upon receipt for occasional damages during transportation.



#### ATTENTION

Any damage must be photographed, documented and reported immediately to the carrier, the insurer and WEG. The non-communication of this damage will void the warranty.



#### ATTENTION

Parts supplied in additional packages must be checked upon receipt.

- When lifting the package (or container), the proper hoisting points, the weight indicated on the package or on the nameplate and the operating capacity and conditions of the hoisting equipment must be observed;
- Motors packed in wooden crates must always be lifted by their own lifting lugs or by a proper forklift; they must never be lifted by the package;
- The package can never be overturned. Place it on the floor carefully (without impact) in order to avoid damage to the bearing;
- Do not remove the grease for protection against corrosion from the shaft end, or the closing plugs present in the terminal box holes. These protections must remain in place until the moment of the final assembly.
- A complete visual inspection of the motor must be carried out after removing the package;
- The shaft locking system must be removed just before the installation and stored to be used in future transportation of the motor.

#### 3.1.1 Additional Precautions



#### EX

In order to ensure the protection degree, the terminal box must be kept closed. Before putting the motor into operation, check the cleanliness and moisture conditions inside the terminal box.

### 3.2 HANDLING

- The motor must be handled as indicated in positions 2 and 3 of Figure 3.1;
- If necessary, remove the heat exchanger to lift the motor;
- If the center of gravity is not perfectly in the center of the lifting lugs, use one of the methods shown in item 3 of Figure 3.1;

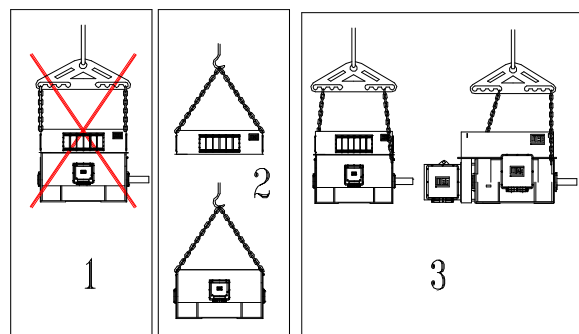


Figure 3.1: Motor handling



#### NOTES

- Observe the indicated weight. Do not lift the motor causing jolts or put it down abruptly on the floor, because this can cause damage to the bearings;
- In order to lift the motor, use only the lifting lugs provided for that purpose. If necessary, use a crossbeam to protect parts of the motor.
- The lifting lugs on the heat exchanger, end shields, bearings, radiator, terminal box, etc. are designed to handle these components only separately;
- Never use the shaft to lift the motor;
- The frame lifting lugs are intended to lift only the motor. Never use them to lift the motor-driven machine set.



#### ATTENTION

- In order to move or transport the motor, the shaft must be locked with the locking device supplied with the motor.
- Lifting equipment and devices must be able to withstand the motor weight.

### 3.3 STORAGE

If the Motor is not installed immediately after reception, it must remain inside the package and stored in a location protected against moisture, vapors, sudden changes in temperature, rodents and insects.

The motor must be stored in vibration-free locations in order to avoid bearing damage.



#### ATTENTION

Space heaters must remain powered during storage in order to avoid moisture condensation inside the motor. Any damage to the paint or corrosion protection of the machined parts must be repaired.

#### 3.3.1 Outdoor storage

The motor must be stored in a dry location, free of flooding and vibrations.

Repair any damages on the package before storing the motor, which is needed to ensure proper storage conditions.

Place the motor on platforms or foundations that ensure protection against humidity from the ground and prevent

it from sinking into the soil. Free air circulation underneath the motor must be assured. The cover used to protect the motor against the bad weather must not be in contact with its surfaces. In order to ensure free air circulation between the motor and such covers, place wooden blocks as spacers.

### 3.3.2 Extended storage

When the motor is stored for a long period of time (two months or more) before start-up, it is exposed to external agents, such as temperature variations, moisture, aggressive agents, etc.

The empty spaces inside the motor – such as rolling bearings, terminal boxes, and windings – are exposed to humidity, which can cause condensation, and, depending on the degree of air contamination, aggressive substances may also penetrate these empty spaces.

Consequently, after long periods of storage, the winding insulation resistance may drop below the acceptable values, internal components, such as rolling bearings, may oxidize, and the lubricant power of the lubricant agent in the bearings may be adversely affected.

All of these influences increase the risk of damages before starting the motor.



#### ATTENTION

To assure that the motor warranty be valid, it is necessary to make sure that all preventive measures described in this manual, such as constructive aspects, maintenance, packaging, storage, and periodical inspections, are followed and recorded.

The extended storage instructions are valid for motors that remain stored for long periods (two months or more) before start-up or motors already installed that are in a prolonged stoppage, considering the same period.

#### 3.3.2.1 Storage location

In order to ensure the best storage conditions for the motor during long periods, the chosen location must strictly meet the criteria described in sections 3.3.2.1.1 and 3.3.2.1.2.

##### 3.3.2.1.1 Indoor storage

In order to ensure better storage conditions for the motor, the storage site must comply strictly with the criteria described below:

- The storage site must be closed, covered, dry, free of air contaminants (moisture, vapor, dust, particles and aggressive fumes) and free of flooding;
- The site should be protected against sudden temperature variations, humidity, rodents and insects;
- Vibration-free location, to avoid damaging to the motor bearings;
- The floor must be of leveled concrete with resistant structure to support the motor weight;
- Must have system to fire detection and extinguishing;
- Be provided with electricity for supplying the space heaters with power failure detection system;
- Exclusive site to store electrical machines (do not mix with other equipment and/or products that could prejudice the correct motor storage);

- Site with facilities of cargo handling services, suitable to allow the motor handling and removal;
- There must be no gas present, such as chlorine, sulfur dioxide or acids;
- The site must have ventilation system with air filter;
- Ambient temperature between 5°C and 50°C, and should not present sudden temperature variation;
- Relative air humidity <50%;
- Must have prevention against dirt and dust deposition;
- The motor should be stored on a suitable metal base that prevents the absorption of moisture from the floor.

If any of these requirements is not met in the storage site, WEG suggests that additional protections be added to the motor package during the storage period, as follows:

- A closed wooden crate or the like with an electrical installation that allows the energization of the space heaters;
- If there is a risk of infestation and fungus formation, the package must be protected in the storage place by spraying it or painting it with appropriate chemicals;
- The package preparation must be prepared carefully by an experienced person.

##### 3.3.2.1.2 Outdoor storage



#### ATTENTION

Outdoor storage of the motor is not recommended.

In case outdoor storage is unavoidable, the motor must be packed in specific packaging for such conditions, as follows:

- For outdoor storage (exposed to the weather), besides the packaging recommended for indoor storage, the package must be covered with protection against dust, moisture and other odd materials, using resistant canvas or plastic.
- The package must be placed on platforms or foundations that ensure protection against dirt and moisture and prevent it from sinking into the soil;
- After the package is covered, a shelter must be erected to protect it against direct rain, snow and excessive sun heat.



#### ATTENTION

In case the motor remains stored for long periods (two months or more), it is recommended to inspect it regularly as specified in the section Maintenance plan during storage of this manual.



### 3.3.2.2 Separate parts

- If parts are supplied separately (terminal boxes, heat exchanger, end shields, etc.), these parts must be mounted on motor to store it;
- Spare parts must be stored in an adequate place, as specified in sections 3.3.2.1.1 and 3.3.2.1.2 of this manual.
- The relative humidity inside the package must not exceed 50%.
- Rolling bearings must not be subject to shocks, falls or storage with vibration or humidity, which can cause marks on the internal tracks or on the balls, reducing their useful life.

### 3.3.3 Preservation during the storage

#### 3.3.3.1 Cooling system

After the motor operation, to preserve the cooling system during long-term storage, the following criteria must be strictly observed:

- Blow hot air in one of the holes for 15 to 20 minutes, to eliminate the moisture from inside the frame inner channels;
- After drying, the water inlet and outlet should be closed.


#### 3.3.3.2 Space heater

Space heaters must remain powered during storage to avoid moisture condensation inside the motor and ensure that the winding insulation resistance remains within acceptable levels.

The space heaters drive circuit must be unique and the voltage and current of this circuit must be measured and recorded monthly. It is recommended that a signal be installed near the motor to indicate that the space heaters are energized.

##### 3.3.3.2.1 Drain

**EX**



If the motor remains stored for long periods (two months or more) with the space heater off, there is the risk of water condensing inside the motor.

The condensed water must be drained by removing the threaded plugs installed in the drain holes. However, after the drainage, those plugs must be put back in place and fixed with anaerobic adhesive.

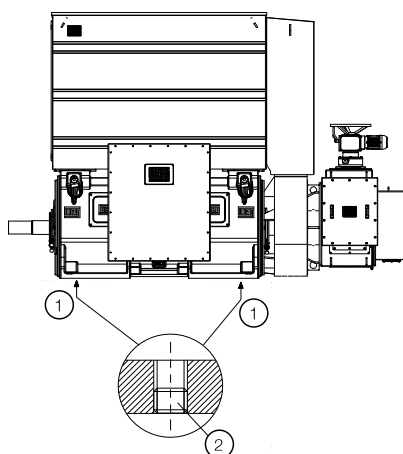


Figure 3.2: Motor drain

Figure 3.2 legend:

1. Drain position
2. Threaded drain M10x1.

### 3.3.3.3 Insulation resistance

During the storage period, the insulation resistance of the motor windings must be measured and recorded every two months, and before the motor installation or eventually if there is any change in the preservation process (E.g. prolonged lack of electricity).

The measurement procedures and the criteria for acceptance of the results shall be according to IEEE-43 Standard.

Any insulation resistance reduction must be investigated.

### 3.3.3.4 Exposed machined surfaces

All exposed machined surfaces (e.g., shaft end and flanges) are protected at the factory with a temporary protective agent (rust inhibitor).

This protection coating must be reapplied at least every six months or when removed and/or damaged.

**Recommended Product:** Protective agent Anticorit BW  
**Supplier:** Fuchs

### 3.3.3.5 Sealing

The rubber seals, gaskets, plugs and cable glands of the motor shall be inspected annually and replaced, if necessary.

### 3.3.3.6 Bearings

#### 3.3.3.6.1 Grease-lubricated rolling bearing

- The rolling bearings are lubricated at the factory for the motor tests.



#### ATTENTION

In order to keep the bearings in good condition during the storage period, **the shaft locking device must be removed every two months, and the motor rotor must be rotated at least 10 complete turns at 30 rpm** to circulate the grease and preserve the internal parts of the bearings.

- Before putting the motor into operation, the rolling bearings must be lubricated;
- If the motor remains stored for a period exceeding two years, the rolling bearings must be disassembled, washed, inspected and relubricated.

#### 3.3.3.6.2 Oil-lubricated rolling bearing

- Depending on the motor mounting position and on the lubrication type, the motor can be transported with or without oil in the bearings;
- The motor storage must be done in its original operating position and with oil in the bearings, when specified;
- The oil level must be respected, remaining in the middle of the sight glass.



#### ATTENTION

In order to keep the bearings in good condition during the storage period, **the shaft-locking device must be removed every two months, and the motor rotor must be rotated at least 10 complete turns at 30 rpm** to circulate the oil and preserve the internal parts of the bearings.

- Before putting the motor into operation, the rolling bearings must be relubricated.
- If the motor remains stored for a period exceeding 2 years, the rolling bearings must be disassembled, washed, inspected and relubricated.

### 3.3.3.6.3 Sleeve bearing

Depending on the machine mounting position and the lubrication type, the machine can be transported with or without oil in the bearings.

The machine storage must be done in its original operating position and with oil in the bearings, when so specified.

The oil level must be respected, remaining in the middle of the sight glass.

In order to keep the bearings in good conditions during the storage period, the following preservation procedures must be performed:

- Close all the threaded holes with plugs;
- Check if all the flanges (e.g., oil inlet and outlet) are closed. If not, they must be closed with blind covers;
- The oil level must be respected, remaining in the middle of the oil sight glass;
- Every two months the shaft locking device should be removed the shaft, add between 100 and 200ml of lubricating oil through the sight glass at the top of the bearing and rotate the shaft which can be done manually with the help of a lever, two or three complete turns are sufficient.



#### NOTES

For bearings that have a high-pressure oil injection system (jacking), this system must be activated before rotating the machine rotor.

For bearings without an internal oil reservoir (dry sump) and for thrust and counter-bearings, the oil circulation system must be activated to turn the machine shaft.

The shaft rotation must always be done in the machine rotation direction. The shaft rotation must always be done in the machine rotation direction.

After six months of storage, the following procedure must be used for protecting both the bearing internally and the contact surfaces against corrosion:

- Close all the threaded holes with plugs;
- Seal the gaps between the shaft and the bearing seal on the shaft by applying water-proof adhesive tape;
- Check if all the flanges (e.g., oil inlet and outlet) are closed. If not, they must be closed with blind covers;
- Remove the upper sight glass from the bearing and apply the corrosion inhibitor spray (TECTYL 511 or equivalent) inside the bearing;
- Close the bearing with the upper sight glass.



#### NOTES

If the bearing has no upper sight glass, the top cover of the bearing must be disassembled to apply the corrosion inhibitor spray.

Each six months of storage, repeat the procedure described above.

If the storage period exceeds two years, the bearing oil must be replaced.

### 3.3.3.7 Brushes

When the motor is stored for more than two months, the brushes must be lifted and removed from their holder in order to prevent oxidation caused by the contact with the slip rings.



#### ATTENTION

Before putting the motor into operation, the brushes must be put back into their holders and their settlement must be checked.

### 3.3.3.8 Terminal boxes

When the insulation resistance of the motor windings is measured, the main terminal box and the other terminal boxes must also be inspected, observing the following aspects:

- The inside must be dry, clean and free of any dust accumulation;
- The contact elements cannot present corrosion;
- The seals must be in proper condition;
- The cable inlets must be correctly sealed.



#### ATTENTION

If any of these items are not in proper condition, proceed the adequate maintenance and, if necessary, replace damaged parts.

### 3.3.3.9 Air-water heat exchanger

To ensure better conditions or the radiator storage for long-term storage, the following criteria must be strictly met:

- Remove the flanged connections from the radiator to gain access to it;
- Drain the water inside the radiator tubes and heads completely;
- Blow hot air in one of the nozzles from 15 to 20 minutes in order to eliminate humidity inside of radiator. For this procedure, the radiator tubes shall be horizontally placed, and the inlet and outlet water flanges placed in such a way that the water are eliminated;
- After dried, the nozzles shall be covered with blind flanges with new sealing gaskets in order to assure a perfect sealing;
- Install a pressure gauge on one of the blind flanges and a globe valve on the other;
- Pressurize the cooler with inert gas (Nitrogen or other) at a pressure of 1.2 bar abs;
- This pressure shall be checked monthly during the radiator term storage, which shall not be exposed to temperatures exceeding 50°C;
- Considering that the storage procedure is followed, the radiator seals must be replaced every 3 years, as recommended by the radiator supplier.



#### ATTENTION

The pressurized radiator must be handled with care. Use a warning plate informing that the equipment is pressurized and should not be exposed to temperatures exceeding 50°C.

**NOTE**

During short operation stoppages, instead of draining the water, it is preferable to keep its circulation at low speeds through the heat exchanger, thus ensuring that harmful products, such as ammonia compounds and hydrogen sulfide, are taken out of the radiator and not deposited inside.

**3.3.3.13 Predictive / preventive maintenance**

WEG recommends that, every 3 years of storage, the stored motor be sent to a WEG Authorized Repair Shop or to WEG own factory, in order to perform a complete predictive maintenance.

The complete predictive maintenance procedure comprises disassembling the complete motor for inspection and, after assembly, performing a routine test in the laboratory.

**3.3.3.10 Pressurization system**

Recommended maintenance for the pressurization system during the motor storage consists of the following items:

**Annually:**

- Check the relief valve and any other spark arrestor. Remove any debris or corrosion, or replace with a spare;
- Check the condition of the air supply filter element. Clean or replace as needed;

**Every least two years, check the following additional items:**

- The apparatus is suitable for the hazardous location;
- There are no authorized modifications;
- The interlocks and alarms function properly;
- Approval labels are legible and undamaged;
- Adequate spare parts are carried;
- The action on pressure failure is correct.

**3.3.3.11 Cleanliness and conservation of the motor during storage**

- The motor should be free of oil, water, dust and dirt.
- The motor outside must be cleaned with compressed air under reduced pressure;
- Remove the removable rust signs with a clean cloth soaked in petroleum solvent.
- Check that the bearings and lubrication hollows are free of dust and dirt and if the bearing plugs are properly tightened.

Risks, marks or rust on the shaft-end should be carefully removed.

**3.3.3.12 Inspections and records during storage**

The stored motor must be inspected periodically and inspection records must be filed.

The following items must be inspected:

1. Check the motor for physical damages and repair it, if necessary;
2. Inspection of the cleanliness conditions;
3. Check for signs of water condensation inside the motor;
4. Check of the protective coating conditions of the exposed machined parts;
5. Check the paint conditions, and repair if necessary;
6. Check for aggressive agents signs;
7. Check the operation of the space heaters;
8. Measure and record the ambient temperature and relative humidity around the motor;
9. Measure and record the temperature, insulation resistance and polarization index of the stator winding;
10. Make sure that the storage location complies with the criteria described in section 3.3.2.1.

### 3.3.3.14 Maintenance plan during storage

During the storage period, the motor maintenance must be performed and recorded according to the plan described in Table 3.1.

Table 3.1: Storage plan

	Monthly	2 months	6 months	2 years	Before start-up	Notes
<b>STORAGE LOCATION</b>						
Inspect the cleanliness conditions		X			X	
Inspect the humidity and temperature conditions		X				
Inspect for insect infestation signs		X				
<b>PACKAGE</b>						
Inspect for damages			X			
Check the internal relative humidity		X				
Replace the desiccant in the package (if any)			X			Whenever necessary.
<b>SPACE HEATER</b>						
Check the operating conditions	X					
Measure the circuit voltage and frequency	X					
Check the function of the signal system (if any)			X			
<b>WHOLE MOTOR</b>						
Perform external cleaning			X		X	
Check the painting conditions			X			
Check the rust inhibitor on the exposed machined parts			X			
Reapply the rust inhibitor			X			
Inspect the rubber seals and gaskets			X			
Complete predictive maintenance						According to section 3.3.3.13
<b>WINDINGS</b>						
Measure the winding temperature		X			X	
Measure the insulation resistance		X			X	
Measure the polarization index		X			X	
<b>TERMINAL BOX AND GROUNDING TERMINALS</b>						
Clean the interior of the terminal boxes				X	X	
Inspect the seals and gaskets				X	X	
<b>GREASE OR OIL-LUBRICATED ROLLING BEARING</b>						
Rotate the shaft		X				
Relubricate the bearing					X	
Disassemble and clean the bearing						If the storage period exceeds 2 years.
<b>SLEEVE BEARINGS</b>						
Rotate the shaft		X				10 complete turns at 30 rpm
Apply corrosion inhibitor spray			X			
Clean the bearings					X	
Change the oil						If the storage period exceeds 2 years.
<b>BRUSHES</b>						
Lift the brushes						During storage.
Lower the brushes and check the contact with the slip rings					X	

### 3.3.4 Preparation for commissioning

#### 3.3.4.1 Cleaning

- The internal and external parts of the motor must be free of oil, water, dust and dirt.
- Remove the rust inhibitor from the exposed surfaces with a cloth damped in a petroleum-based solvent;
- Make sure that the bearings and cavities used for lubrication are free of dirt and that the cavity plugs are correctly sealed and tightened. Oxidation and marks on the bearing seats and on the shaft must be carefully removed.

#### 3.3.4.2 Bearing inspection



##### ATTENTION

If the motor storage period exceeds six months, the sleeve bearings must be disassembled, inspected and cleaned, before starting the motor operation. The sleeve bearings without oil tank (dry crankcase), regardless of the motor storage period, should necessarily be disassembled, inspected and cleaned before starting the motor operation. Reassemble the sleeve bearings and carry out lubrication. Contact WEG to perform this procedure.

#### 3.3.4.3 Bearing lubrication

Use the lubricant specified for bearing lubrication. Information on the bearings and lubricants are indicated on the bearing nameplates, and the lubrication must be done as described in section 0 of this manual, always considering the type of bearing.

#### 3.3.4.4 Brushes, brush holders and slip rings

- Check the conservation conditions of the brush holder and the slip rings;
- Check the connection of the brushes and that they are not stuck into the brush holder. They must be in their original position and establish perfect contact with the slip rings.

#### 3.3.4.5 Insulation resistance verification

Before putting the motor into operation, the insulation resistance must be measured according to section 3.3.3.3 of this manual.

#### 3.3.4.6 Air-water heat exchanger

- When starting the motor, ensure that the water circulates freely through the radiator;
- The radiator bolts should be tightened with torques of 40 to 50Nm;
- Make sure that there is no water leakage. Check the radiator gaskets, and replace if necessary;
- Check the heat exchanger sealing rubbers, and replace them if necessary.

#### 3.3.4.7 Others

Follow the other procedures described in section 6 of this manual before putting the motor into operation.

## 4 INSTALLATION

### 4.1 INSTALLATION SITE

Electric motors must be installed in easily accessible places, allowing periodic inspections, on-site maintenance and, if necessary, removal for external services.

The following environmental conditions must be ensured:

- Clean and well-ventilated location;
- The installation of other equipment or walls must not block or hinder the motor ventilation;
- The area around and above the motor must be sufficient for maintenance or handling;
- The environment must be in accordance with the motor protection degree.

### 4.2 SHAFT LOCK

The motor leaves the factory with a lock on the shaft to prevent damages to the bearings during transportation. This lock must be removed prior to motor installation.



#### ATTENTION

The shaft-locking device must be installed whenever the motor is removed from its base (uncoupled) in order to prevent damages to the bearings during transportation.

The shaft end is protected at the factory with a temporary protective agent (rust inhibitor). During the motor installation, it is necessary to remove this product from the grounding brush (if any) contact track on the shaft.

### 4.3 ROTATION DIRECTION

The motor rotation direction is indicated by a plate affixed to the frame on the drive end and in the motor specific documentation.



#### ATTENTION

Motors supplied with a single rotation direction must not operate in the opposite direction.

In order to operate the motor in the direction opposite to the specified, consult WEG.

### 4.4 INSULATION RESISTANCE

#### 4.4.1 Safety Instructions



#### DANGER

In order to measure the insulation resistance, the motor must be turned off and stopped.

The winding being tested must be connected to the frame and grounded until all residual electrostatic charges are removed. Capacitors (if any) must also be grounded before disconnecting and separating the terminals to measure the insulation resistance.

Failure to comply with these procedures may result in personal injury.

#### 4.4.2 General considerations

When the motor is not put into operation, it must be protected against moisture, high temperatures, and dirt, thus avoiding impacts on the insulation resistance. The winding insulation resistance must be measured before putting the motor into operation.

If the environment is too humid, the insulation resistance must be measured periodically during storage. It is difficult to establish fixed rules for the actual value of winding insulation resistance, as it varies according to the environmental conditions (temperature, humidity), machine cleanliness conditions (dust, oil, grease, dirt) and quality and condition of the insulating material used.

The evaluation of the periodical follow-up records is useful to conclude whether the motor is able to operate.

#### 4.4.3 Measurement on the stator windings

The insulation resistance must be measured with a megohmmeter. The testing voltage for the motor windings must be in accordance with Table 4.1 and IEEE43 standard.

Table 4.1: Voltage for the winding Insulation resistance test

Winding rated voltage (V)	Insulation resistance test - continuous voltage (V)
< 1000	500
1000 - 2500	500 - 1000
2501 - 5000	1000 - 2500
5001 - 12000	2500 - 5000
> 12000	5000 - 10000

Before measuring the stator winding insulation resistance:

- Disconnect all connections to the stator terminals;
- Disconnect and insulate all CTs and PTs (if any);
- Ground the motor frame;
- Measure the winding temperature;
- Ground all temperature sensors;
- Check the humidity.

The insulation resistance measurement of the stator windings must be done in the main terminal box.

The megohmmeter must be connected between the motor frame and the winding.

The frame must be grounded and the three phases of the stator winding must remain connected to the neutral point, according to Figure 4.1.

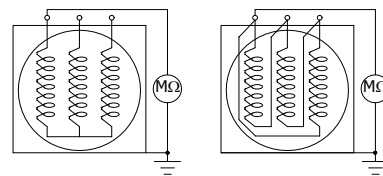


Figure 4.1: Megohmmeter connection

Whenever possible, each phase must be isolated and tested separately. The separate test allows the comparison between the phases. When a phase is tested, the other two phases must be grounded to the same ground of the frame, according to Figure 4.2.

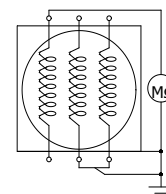


Figure 4.2: Connection of the megohmmeter to separate phases



If the total winding measurement presents a value below the recommended, the neutral connections must be opened and the insulation resistance of each phase must be measured separately.



#### ATTENTION

Much higher values may be frequently obtained from motors in operation for long periods of time. Comparison with values obtained in previous tests on the same motor - under similar load, temperature and humidity conditions - may be an excellent parameter to evaluate the winding insulation conditions, instead of using the value obtained in a single test as the basis. Significant or sudden reductions are considered suspicious.

#### 4.4.4 Measurement on the rotor winding

In order to measure the rotor insulation resistance of wound-rotor motors, proceed in the following manner:

- Lift the brushes from the slip rings or remove them from the brush holders;
- The measurement of the rotor winding insulation resistance must be done in the brush compartment;
- The megohmmeter must be connected between the motor shaft and the slip rings;
- The measuring current must not flow through the bearings;
- Measure and record the winding temperature.

#### 4.4.5 Additional Information



#### ATTENTION

After measuring the insulation resistance, ground the tested winding in order to discharge it. The testing voltage to measure the insulation resistance of the space heater must be 500 Vdc and for the other accessories, 100 Vdc. It is not recommended to measure the insulation resistance of thermal protectors.

#### 4.4.6 Polarization Index

The polarization index is defined by the ratio between the insulation resistance measured in 10 minutes and the insulation resistance measured in 1 minute. This measurement procedure is always carried out at relatively constant temperatures.

The polarization index allows the assessment of the motor insulation conditions.



#### DANGER

In order to avoid accidents, the winding must be grounded immediately after measuring the insulation resistance.

#### 4.4.7 Conversion of the measured values

The insulation resistance measured on the windings shall be converted to 40 ° C using the correction factor provided in Figure 4.3 (IEEE43 standard) and applying the following formula:

$$R_c = K_t \cdot R_t$$

Where:

R40 = referred insulation resistance at 40 ° C

Kt = Insulation resistance correction factor as a function of temperature, as shown in Figure 4.3.

Rt = measured insulation resistance.

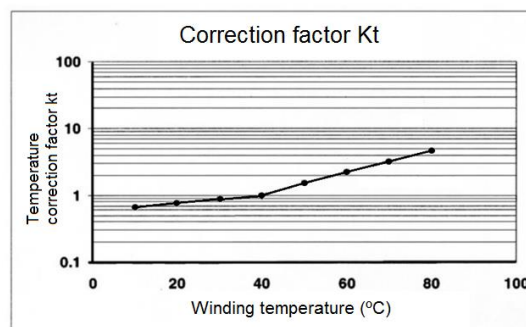


Figure 4.3: Insulation resistance correction factor due to temperature

The values used to generate the curve of Figure 4.3 are shown in Table 4.2.

Table 4.2: Correction factors (Kt) due to temperature

t (°C)	Correction factor (kt)
10	0,7
20	0,8
30	0,9
40	1,0
50	1,5
60	2,3
70	3,3
80	4,6

#### 4.4.8 Recommended Minimum Values

According to IEEE-43 Standard, the recommended minimum values for winding insulation resistance (R.I.) and Polarization Index (I.P.) are shown in Table 4.3:

Table 4.3: Minimum R.I. e I.P. values

Winding voltage	Minimum R.I. (converted to 40°C)	Minimum I.P.
Up to 1000 V	5 MΩ	Not applicable
Greater than 1000 V	100 MΩ	2

## 4.5 PROTECTIONS

Motors used in continuous duty must be protected against overloads by means of a motor integral device, or an independent protection device, which is generally a thermal relay with rated or adjustable current equal to or below the value obtained by multiplying the full load motor supply current by:

- 1.25 for motors with service factor equal to or above 1.15;
  - 1.15 for motors with service factor equal to 1.0.
- Motors also have protection devices against overheating (in cases of overloads, locked rotor, low voltage, lack of motor ventilation).

### 4.5.1 Protections – explosive atmospheres

Protection devices for explosive atmosphere motors must always remain switched on and adjusted according to EN 60079-14, DIN VDE0165 and NBR5410 standards. If not indicated otherwise, the motors are designed for S1 duty (continuous). All protections, including those for overcurrent, must be set based on the motor rated conditions. This protection must also protect the motor in case of short-circuit (i.e., in case of locked rotor). Windings in delta ( $\Delta$ ) connection must be protected against phase loss. To do so, connect the relay in series with the winding phases and set it for 0.58 times the rated current. All the winding and bearing protections must always be on and adjusted correctly. Heavy starts: motors that will be submitted to conditions with acceleration time  $> 1.7 \times t_E$  time must be protected with an overcurrent protection device as the indications in the certificate of conformity.



**EX**  
For explosive atmosphere motors, the maximum tripping time of the protection device must not, in case of overload or locked rotor, exceed the time indicated in the certificate of conformity and the  $t_E$  time indicated on the motor nameplate.

### 4.5.2 Thermal protections

The over-temperature protections devices are installed on the main stator, bearings and other parts that require temperature monitoring and thermal protection. These sensors must be connected to an external temperature monitoring and protection system. The type of temperature sensor, the connection terminals and the setting temperatures for alarm and shutdown are given in the motor CONNECTION DIAGRAM.

#### 4.5.2.1 Temperature sensors for explosive atmospheres



**EX**  
Motors for explosive atmospheres are supplied with Pt100 sensors in order to accurately measure and monitor the temperature of the windings, bearings and other parts of the motor, as needed. The references from the respective certificates of conformity must be taken into account. When used in the motor protection circuit, the thermal protections must be connected as simple apparatus in intrinsically safe circuits.

### 4.5.2.2 Temperature limits for the windings

The temperature of the hottest spot of the winding must be kept below the limit of the insulation thermal class. The total temperature is obtained by the sum of the ambient temperature and the temperature rise (T), plus the difference between the average temperature of the winding and the hottest spot of the winding. The ambient temperature must not exceed 40 °C, in accordance with NBR IEC60034-1 standard. Above this temperature, the working conditions are considered special and the motor specific documentation must be consulted.

Table 4.4 shows the numerical values and the composition of the acceptable temperature at the hottest spot on the winding.

Table 4.4: Insulation class

Insulation class		B	F	H
Ambient temperature	°C	40	40	40
T = temperature rise (temperature measurement method by resistance variation)	°C	80	105	125
Difference between the hottest spot and the average temperature	°C	10	10	15
Total: temperature of the hottest point	°C	130	155	180



#### ATTENTION

If the motor operates with winding temperatures above the limits of the insulation thermal class, the lifespan of the insulation, and hence that of the motor, will be significantly reduced, or it may even result in the motor burnout.

### 4.5.2.3 Alarm and trip temperatures

The motor alarm and trip temperatures must be set at the lowest possible value. These temperatures can be determined based on the factory tests or through the motor operating temperature. The alarm temperature can be set 10 °C above the machine operating temperature at full load, always considering the highest ambient temperature on site.



#### ATTENTION

The alarm and trip values may be determined as a result of experience, but they must not exceed the values indicated in the motor wiring diagram.



#### ATTENTION

The motor protection devices are listed in the WEG drawing – Wiring diagram. Not using these devices is the sole responsibility of the user and, in case of damage to the motor, it will void the warranty.



#### 4.5.2.4 Temperature and ohmic resistance of the PT100 thermoresistance

Table 4.5 shows the temperature as a function of the ohmic resistance measured across PT100 RTDs.

$$\text{Formula: } \frac{\Omega - 100}{0.386} = ^\circ\text{C}$$

Table 4.5: Temperature X Resistance (Pt100)

° C	0	1	2	3	4	5	6	7	8	9
0	100.00	100.39	100.78	101.17	101.56	101.95	102.34	102.73	103.12	103.51
10	103.90	104.29	104.68	105.07	105.46	105.95	106.24	106.63	107.02	107.40
20	107.79	108.18	108.57	108.96	109.35	109.73	110.12	110.51	110.90	111.28
30	111.67	112.06	112.45	112.83	113.22	113.61	113.99	114.38	114.77	115.15
40	115.54	115.93	116.31	116.70	117.08	117.47	117.85	118.24	118.62	119.01
50	119.40	119.78	120.16	120.55	120.93	121.32	121.70	122.09	122.47	122.86
60	123.24	123.62	124.01	124.39	124.77	125.16	125.54	125.92	126.31	126.69
70	127.07	127.45	127.84	128.22	128.60	128.98	129.37	129.75	130.13	130.51
80	130.89	131.27	131.66	132.04	132.42	132.80	133.18	133.56	133.94	134.32
90	134.70	135.08	135.46	135.84	136.22	136.60	136.98	137.36	137.74	138.12
100	138.50	138.88	139.26	139.64	140.02	140.39	140.77	141.15	141.53	141.91
110	142.29	142.66	143.04	143.42	143.80	144.17	144.55	144.93	145.31	145.68
120	146.06	146.44	146.81	147.19	147.57	147.94	148.32	148.70	149.07	149.45
130	149.82	150.20	150.57	150.95	151.33	151.70	152.08	152.45	152.83	153.20
140	153.58	153.95	154.32	154.70	155.07	155.45	155.82	156.19	156.57	156.94
150	157.31	157.69	158.06	158.43	158.81	159.18	159.55	159.93	160.30	160.67

#### 4.5.2.5 Space heater

When the motor is equipped with a space heater to prevent internal water condensation during long periods out of operation, it must be assured that the space heater is energized shortly after turning the motor off, and that it is de-energized before the motor is put into operation.

The values of the space heater supply voltage and power are informed in the connection diagram and in the specific plate affixed to the motor.

#### 4.5.3 Water leak sensor

Motors with air-water heat exchangers are supplied with a water leak sensor intended to detect accidental water leaks from the radiator into the motor. This sensor must be connected to the control panel, according to the motor connection diagram. The signal of this sensor must be used to activate the alarm.

When this protection actuates, the heat exchanger must be inspected and, if any water leak is detected, the motor must be shut down and the problem corrected.

## 4.6 COOLING

The motor cooling system type may vary according to its application.

Only the correct installation of the motor and of the cooling system can ensure its continuous operation without overheating.











#### ATTENTION



The protection devices of the cooling system (if any) must be monitored periodically.

The air and/or water inlets and outlets (if any) must not be obstructed, because this could cause overheating and even lead to the motor burnout. For further details, refer to the motor dimensional drawing.

#### 4.6.1 Enclosed motors

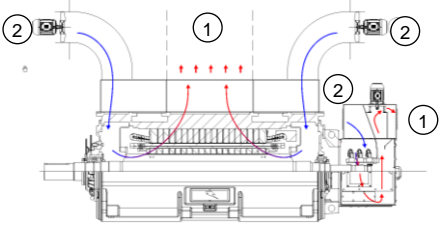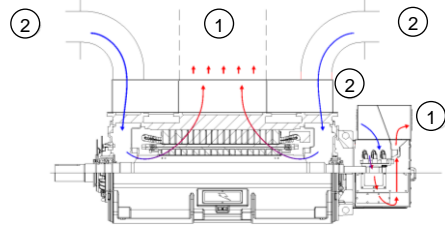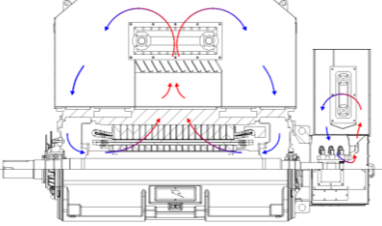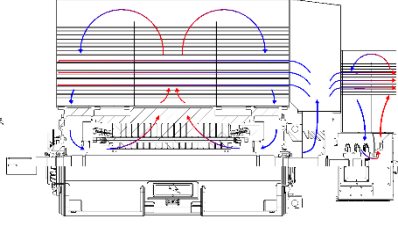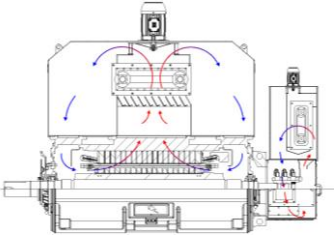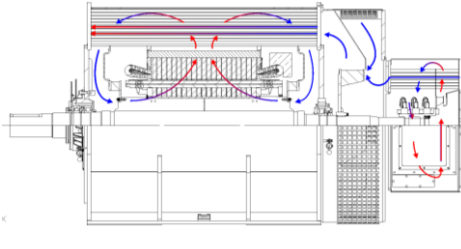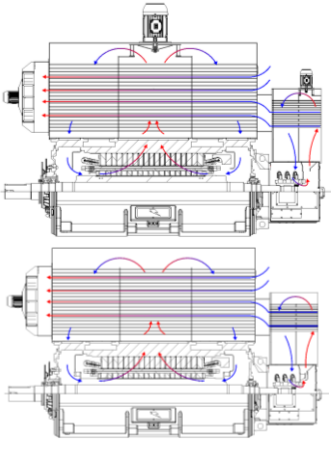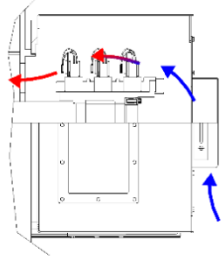 <p><b>MAT</b> Independent ventilation, air inlet and outlet through ducts</p> <p>1. Contaminated room 2. Non-contaminated room</p>	 <p><b>MAD</b> Self-ventilated, air inlet and outlet through ducts</p> <p>1. Contaminated room 2. Non-contaminated room</p>
 <p><b>MAW</b> Air-water heat exchanger, self-ventilated</p>	 <p><b>MAF</b> Air-air heat exchanger, self-ventilated</p>
 <p><b>MAL</b> Air-water heat exchanger with independent ventilation</p>	 <p><b>MAR</b> Self-ventilated with air-air heat exchanger around the motor.</p>
 <p><b>MAI</b> Air-air heat exchanger with independent ventilation</p>	<p><b>OPTIONAL SYSTEM OF BRUSHES COMPARTMENT COOLING (IP44)</b></p> 

#### 4.6.2 Open motors

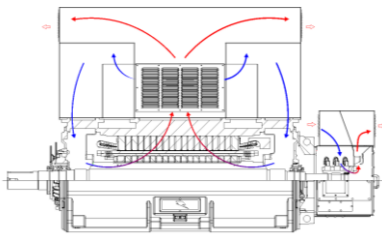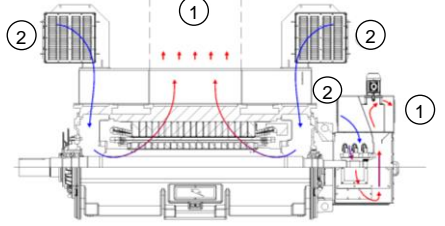 <p><b>MAA or MAP</b> Self-ventilated</p>	 <p><b>MAV</b> Independent ventilation</p> <p>1. Hot air 2. Cold air</p>
--	--

### 4.6.3 Air-water heat exchange cooling

In motors with air-water heat exchanger, the internal air, in a closed circuit, is cooled by the radiator, which is a surface heat transmitter designed to dissipate heat. Clean water with the following characteristics must be used as coolant:

- pH: 6 to 9;
- Chlorides: maximum 25.0 mg/l;
- Sulphates: maximum 3.0 mg/l;
- Manganese: maximum 0.5 mg/l;
- Suspended solids: maximum 30.0 mg/l;
- Ammonia: no ammonia present.



#### ATTENTION

Data of the radiators that compose the air-water heat exchanger are informed on their nameplate and on the motor dimensional drawing. This data must be observed for the proper operation of the motor cooling system, thus preventing overheating.

#### 4.6.3.1 Radiators for application with seawater



#### ATTENTION

In the case of radiators for applications with seawater, the materials in contact with the water (pipes and plates) must be corrosion resistant. Furthermore, the radiators may be fitted with sacrificial anodes (e.g., zinc or magnesium), as shown in Figure 4.4, which are corroded during the heat exchanger operation, protecting the radiator heads. In order to maintain the integrity of the radiator heads, these anodes must be replaced periodically according to their corrosion level.

 


Figure 4.4: Radiator with sacrificial anodes



#### NOTE

The type, quantity and position of the sacrificial anodes may vary according to the application.

### 4.6.4 Independent ventilation cooling

The **independent fans** are driven by three-phase asynchronous motors with integral terminal boxes. The characteristic data (frequency, voltage, etc.) are on the nameplate of these motors, and the rotation direction is indicated by a plate affixed to the fan housing or close to it.



#### NOTE

It is necessary to check the rotation direction of the independent ventilation motors before putting them into operation. If the rotation direction is opposite to the specified, invert the connection of two of their power supply phases.

The **air filters** (if any), which prevent the ingress of dirt into the motor, must be regularly inspected according to the section "Maintenance Plan" of this manual. The filters must be in perfect condition to ensure the correct operation of the cooling system and the continuous protection of the motor sensitive internal parts.

### 4.6.5 Air/Air heat exchanger cleaning

Some fouling of the cooling surface and the tube wall will eventually occur. This fouling reduces the cooling capacity. The heat exchanger should therefore be cleaned at regular intervals, to be determined from case to case, depending of the properties of the cooling air. During the initial period of operation, the heat exchanger should be inspected frequently. Blow the heat exchanger clean with compressed air or clean it with a suitable brush. Do not use a steel brush in aluminum tubes as it can damage the tubes; a soft round brass wire brush can be used instead.

## 4.7 ELECTRICAL ASPECTS

### 4.7.1 Electrical connections



#### ATTENTION

Analyze the electrical connection diagram supplied with the motor carefully before beginning the connection of the main cables and those of the accessories. For the electrical connection of auxiliary equipment, refer to their specific manuals.

#### 4.7.1.1 Main electrical connections

The location of stator terminal box is identified in the specific motor DIMENSIONAL DRAWING. The location of stator terminal box is identified in the specific motor DIMENSIONAL DRAWING. Make sure the cross section and insulation of the main connection cables are suitable for the motor current and voltage. The motor must rotate in the rotation direction specified on the nameplate and on the sign arrow affixed to the motor drive end.



#### NOTE

The rotation direction is, by convention, determined looking to the shaft end at the motor drive end. Motors with a single rotation direction must only rotate in the indicated direction. In order to operate the motor in the rotation direction opposite to the specified, consult WEG.



#### ATTENTION

Before making the connections between the motor and the power supply, it is necessary to perform a careful measurement of the winding insulation resistance.

In order to connect the motor main power supply cables, unscrew the cover of the stator terminal box, cut the sealing rings (standard motors without cable gland) according to the diameter of the cables to be used and insert the cables in the sealing rings. Cut the power supply cables to the necessary length, strip the ends and mount the cable lugs that will be used.

#### 4.7.1.2 Additional information



**EX**

Motors for explosive atmospheres must be fitted with proper cable lugs and spring washers. Observe the minimum isolation distance between the cables during the connection.

Before closing the terminal box, make sure that all nuts on the terminals and the ground connections are well tightened and that all the seals, including the certified ones, of the cable outlets are in perfect conditions and correctly installed.

The wire gauge of the connection cables must be in accordance with the motor documentation. Cable inlets not used in the terminal box must be properly closed with certified plugs, according to the protection type for the hazardous area, the EPL (equipment protection level, according to IEC 60079-0 and 60079-14 standards) and the degree of protection indicated on the motor nameplate. Main connection cable inlets, as well as those for control, must use components (cable glands, conduits, etc.) that comply with the standards and regulations in force in each country.



**EX**

Check the rated characteristics on the motor nameplate.

Dimension the power cables according to the motor rated current, considering the environmental factors (such as ambient temperature, type of installation, etc.).

In order to dimension the motor connection cables and make the installation in a correct and safe way, the local installation standards must be consulted.

Table 4.6: Low voltage, three-phase cables insulated with PVC  $\leq 1\text{ kV}$

Current	Number of Cables	Cable Cross Section
$> 600 \dots \leq 800 \text{ A}$	2	$300 \text{ mm}^2$
$> 400 \dots \leq 600 \text{ A}$	2	$185 \text{ mm}^2$
$> 300 \dots \leq 400 \text{ A}$	1	$300 \text{ mm}^2$
$> 200 \dots \leq 300 \text{ A}$	1	$185 \text{ mm}^2$
$\leq 200 \text{ A}$	1	$95 \text{ mm}^2$

In order to connect the motor main power supply cables, unscrew the cover of the stator terminal box, cut the sealing rings (standard motors without cable gland) according to the diameter of the cables to be used and pass them through the sealing rings. Cut the power supply cables to the necessary length, strip the ends and mount the cable lugs that will be used.

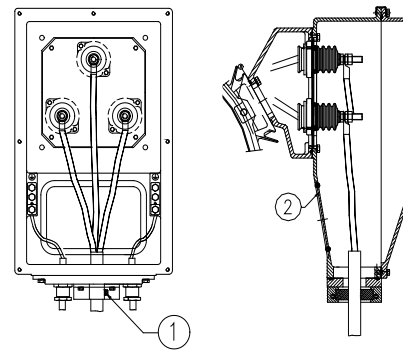


Figure 4.5: Terminal box

**Figure 4.5 legend:**

1. The screws must be tightened with a torque of 35Nm;
2. The pressure relief opening must not be damaged during mounting and maintenance.

After finishing these jobs, make a visual inspection and, if necessary, repair these points with genuine seals.



**EX**

The cable inlets in the terminal box and the kind of thread of the threaded inlets are identified in the specific dimensional drawing of the motor.

The tightening torque for the electrical connection of the power cables to the terminal studs must be done with values according to Table 4.7.

For electrical connections to bus bars and steel bolts, apply tightening torques according to Table 8.1 and Table 8.2.

Table 4.7: Tightening torques for terminal studs

Terminal stud Thread	Tightening torque Nm
M12	15.5
M16	30



**NOTE**

If two parallel cables are connected, the lugs must be arranged as shown in Figure 4.6.

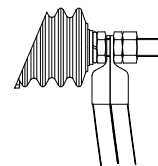


Figure 4.6: Connection of parallel cables

#### 4.7.1.3 Grounding

The motor frame and the main terminal box must be grounded before connecting the motor to the supply system.

Connect the metallic sheath of the cables (if any) to the common grounding conductor. Cut the grounding conductor to the proper length and connect it to the terminal in the terminal box and/or on the frame.

Fasten all connections firmly.



**ATTENTION**


Do not use washers made of steel or other materials with low electrical conductivity to fasten the cable lugs.

## 4.7.2 Connection diagrams

### 4.7.2.1 Connection diagrams according to IEC60034-8

The following connection diagrams show the terminal identification in the terminal box and the possible connections for the motors.

#### 4.7.2.1.1 Stator connection diagrams

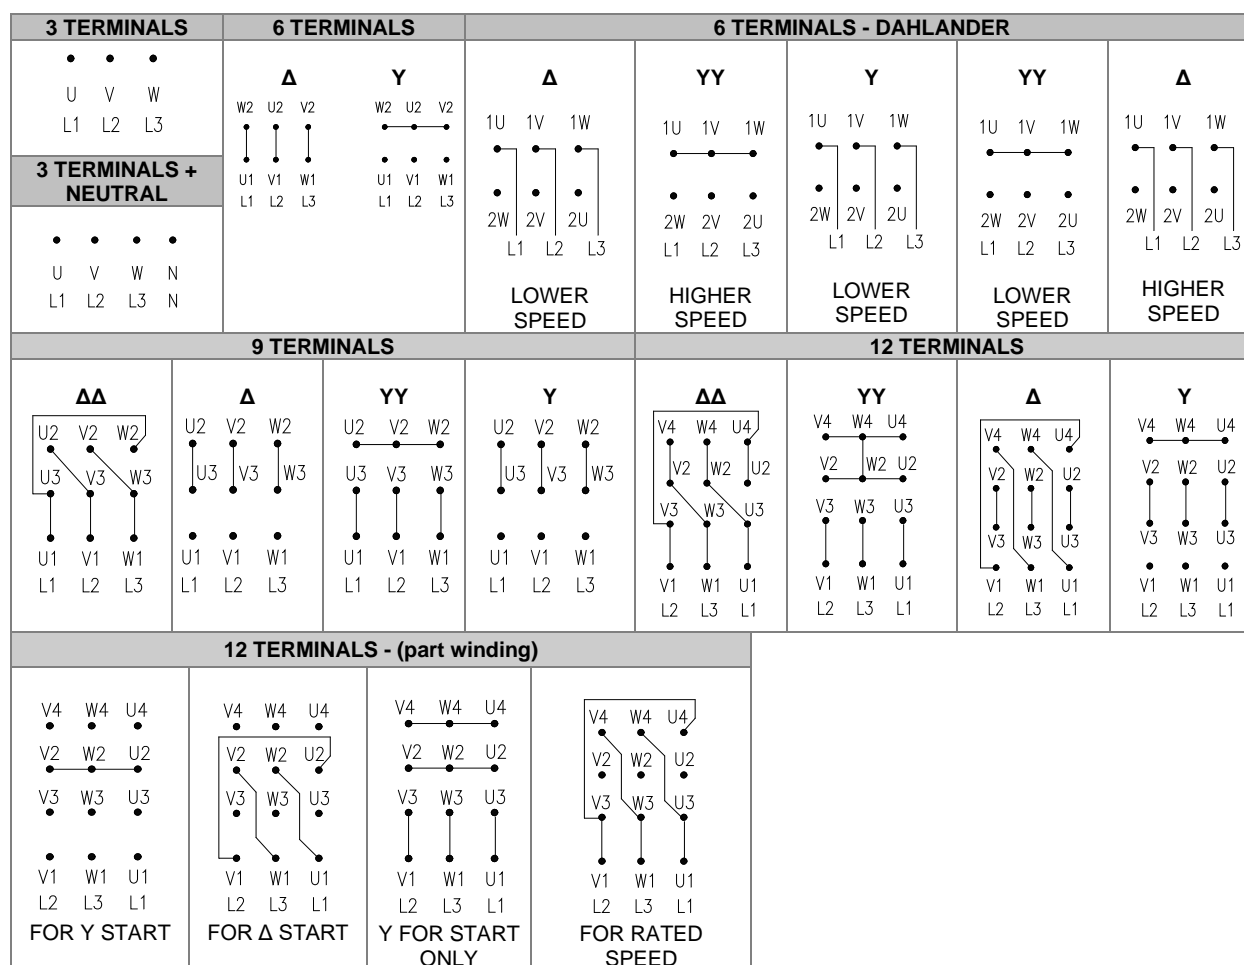

#### NOTE

When two or more motor connecting cables are used in parallel in order to divide the electric current, the identification of these cables is made with an additional suffix separated by a hyphen, according to Figure 4.7.


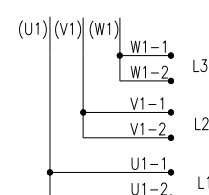



Figure 4.7: Parallel connections

#### 4.7.2.1.2 Rotor connection diagrams

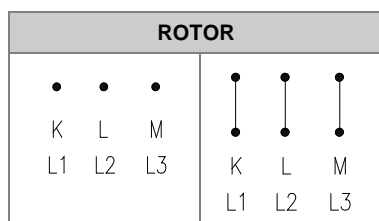

#### 4.7.2.2 Connection diagrams according to NEMA MG1

##### 4.7.2.2.1 Stator connection diagrams

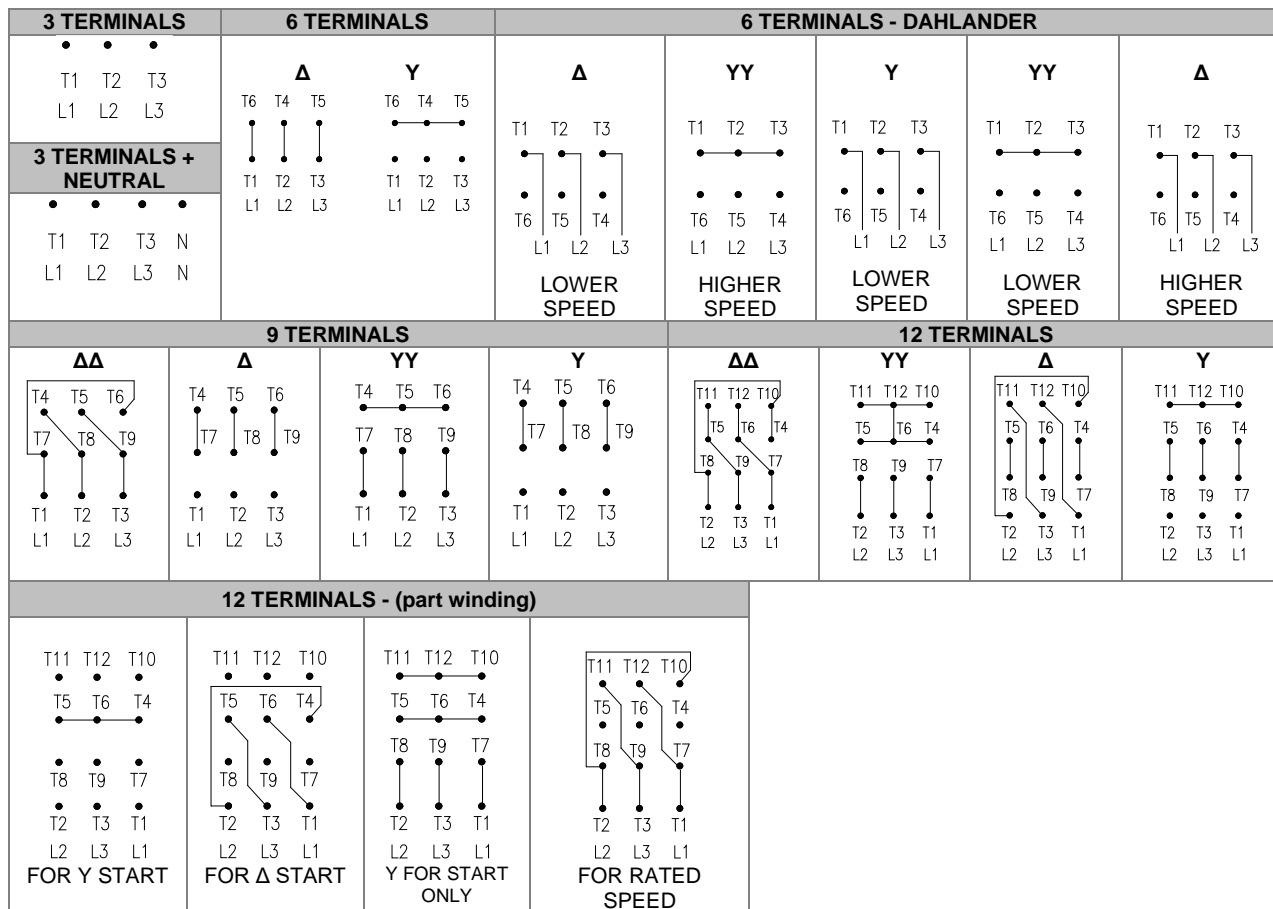

#### NOTE

When two or more motor connecting cables are used in parallel in order to divide the electric current, the identification of these cables is made with an additional suffix separated by a hyphen, according to Figure 4.8.


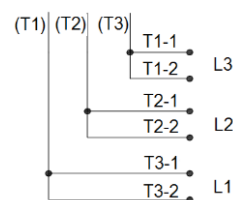


Figure 4.8: Parallel connections

##### 4.7.2.2.2 Rotor connection diagrams

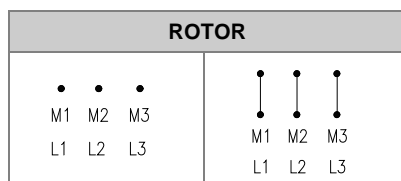

##### 4.7.2.3 Rotation direction

- The rotation direction is indicated on the nameplate and must be observed looking to the shaft end at the motor drive end. The rotation direction must be checked before coupling the motor to the driven machine;
- Motors with terminal identification and connections as described in this manual have clockwise rotation direction, according to IEC60034-8 standard;
- In order to invert the rotation direction, it is necessary to swap any two phases;
- Motors with a single rotation direction, as indicated on the nameplate and on sign plate affixed to the frame, have unidirectional fan and must be operated only in the specified rotation direction. In order to invert the rotation direction of unidirectional motors, consult WEG.

##### 4.7.2.4 Accessory connection diagrams


For the correct installation of the accessories, refer to the drawing in the specific CONNECTION DIAGRAM of the motor.



#### 4.7.2.5 Motorized brush holder connection diagram

The following connection diagrams show the terminals in the terminal box and the connections of the motorized brush lifting system for wound-rotor motors equipped with this device.


##### 4.7.2.5.1 Condition for starting with lowered brushes and non-short-circuited slip rings

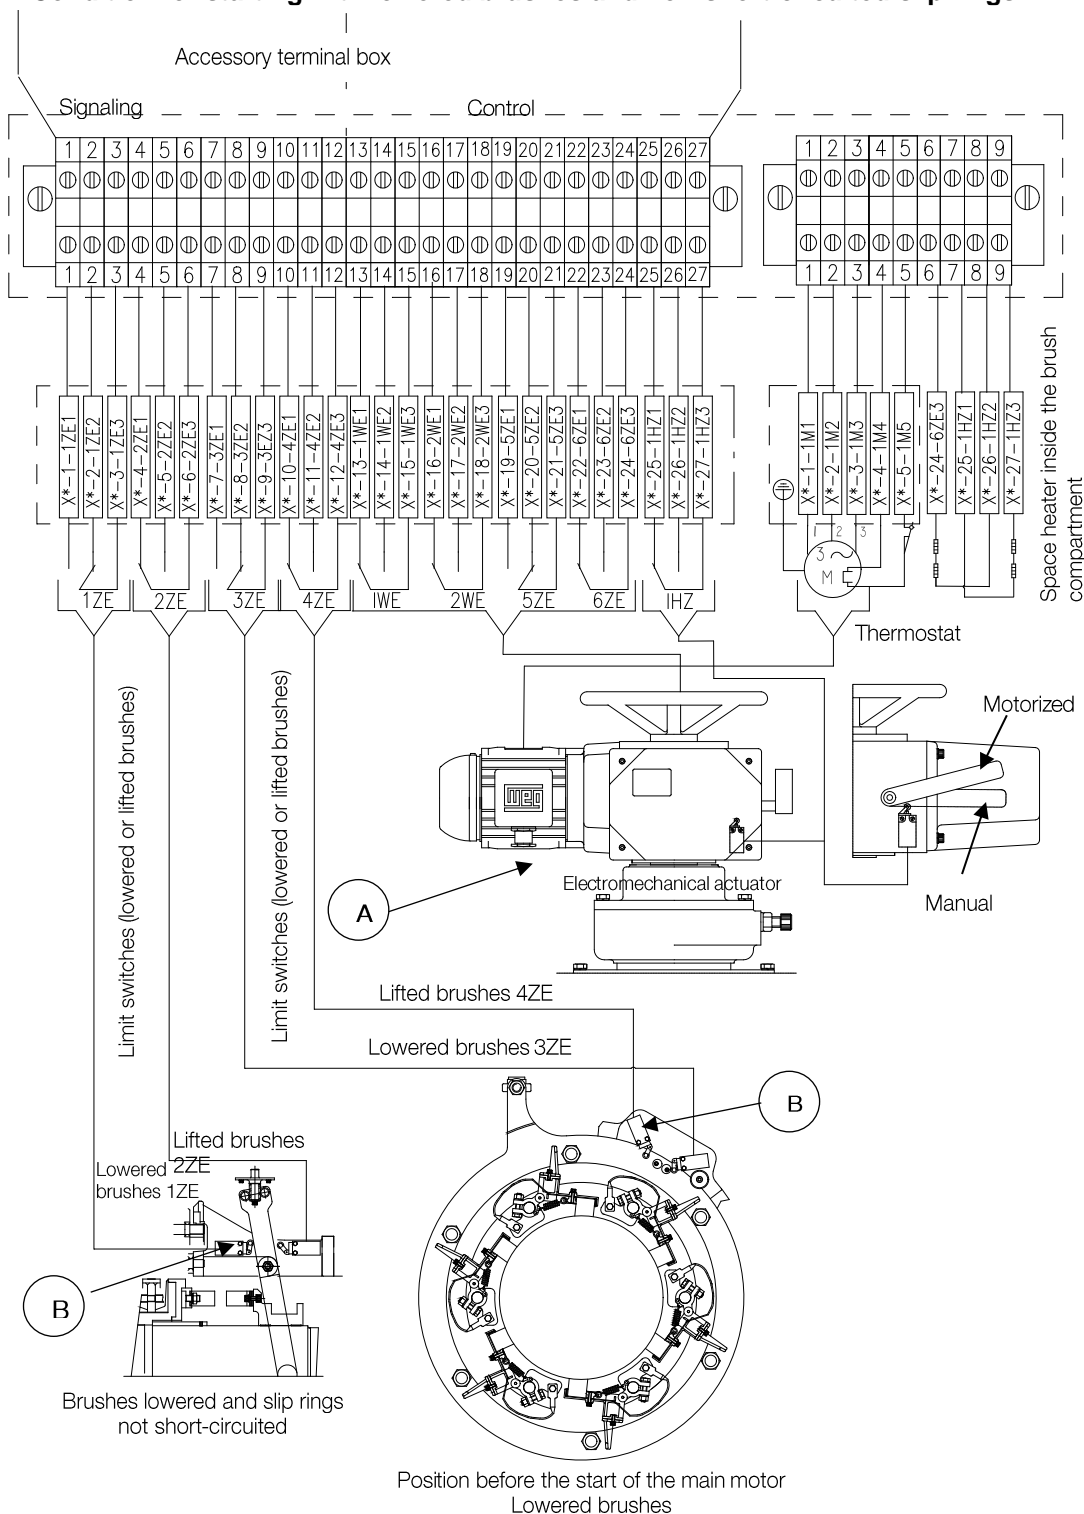

#### Component description:

- A. Three-phase motor – IEC frame 71 – 6 poles, 0.25 kW – F.C. B3E - IPW55 - flange C105 - DIN 42948. Voltage and frequency according to the customer's request.
- B. Limit switch with double insulation.

#### 4.7.2.5.2 Condition for operation with lifted brushes and short-circuited slip rings

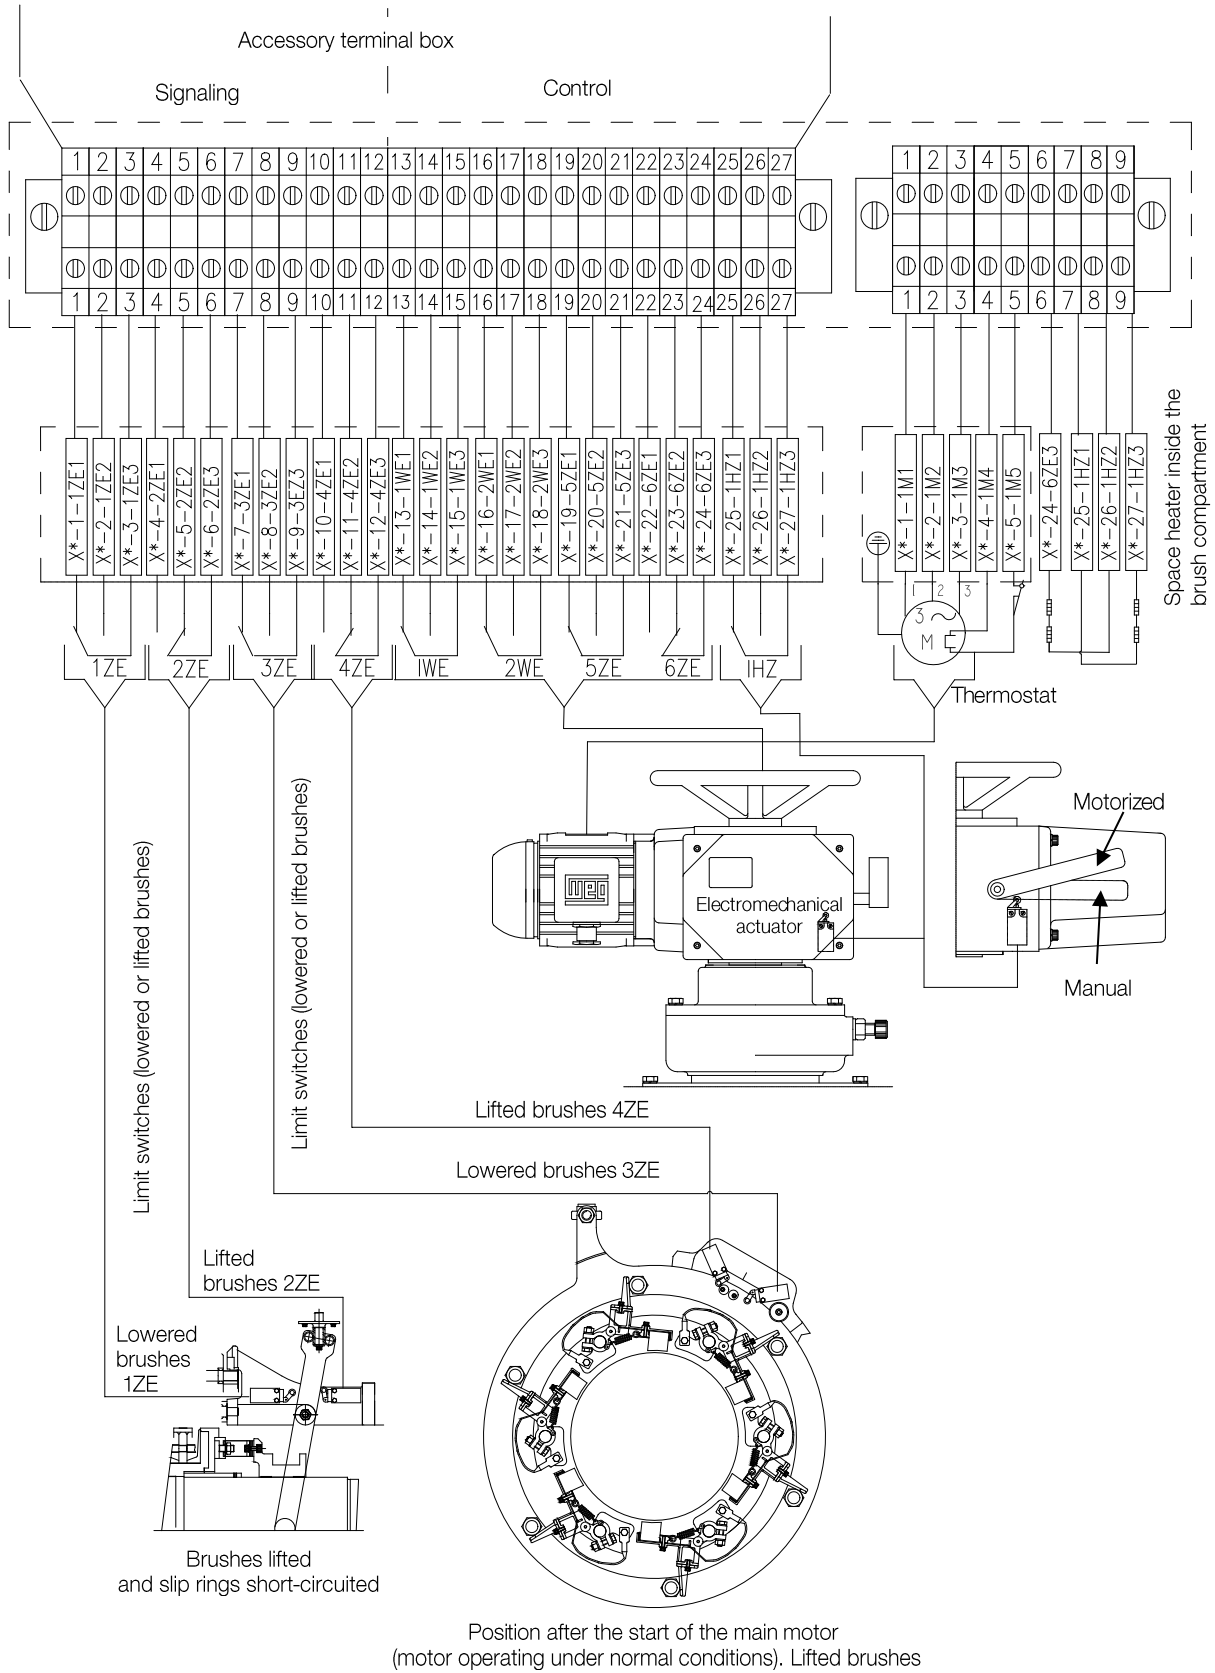



#### 4.7.2.5.3 Motorized brush holder operation logic

##### MOTORIZED OPERATION:

##### 1. Condition for starting with lowered brushes and non-short-circuited slip rings

In order to ensure the brushes are lowered, and the slip rings are not short-circuited, the switches:

- **1ZE** - contacts 3 and 2;
- **3ZE** - contacts 8 and 9;
- **5ZE** - contacts 20 and 21

must be closed.

When the electromechanical actuator is activated, the limit switch **5ZE**, located in the electromechanical actuator itself, positions the brushes correctly at the starting position (lowered brushes), whereas the **1ZE** and **3ZE** signaling switches, installed inside the brush compartment, confirm this condition.

With this logic, the motor is able to start.

##### 2. Condition for operation with the brushes lifted and short-circuited slip rings

In order to ensure that the brushes are lifted and the slip rings are short-circuited, the switches:

- **2ZE** - contacts 6 and 5;
- **4ZE** - contacts 12 and 11;
- **6ZE** - contacts 24 and 23

must be closed.

 
When the electromechanical actuator is activated for lifting the brushes, the limit switch **6ZE**, located in the electromechanical actuator itself, correctly positions the brushes at the lifted position, whereas the **2ZE** and **4ZE** signaling switches, installed inside the brush compartment, confirm this condition.

With this logic, the motor is able to operate in continuous duty.


##### SYMBOLOLOGY:

**1WE** = Torque switch for shutdown in case of overload while lowering the brushes (or phase inversion).

If there is fault in **5ZE**.



 **2WE** = Torque switch for shutdown in case of overload while lifting the brushes (or phase inversion).




If there is fault in **6ZE**.


**5ZE** = Limit switch of the electromechanical actuator to indicate when the brushes are fully lowered.

**6ZE** = Limit switch of the electromechanical actuator to indicate when brushes are fully lifted.

 **1HZ** = Selector switch indicating manual or motorized position.



Manual drive

 

Motorized drive

#### LIMIT SWITCHES FOR SIGNALING

**2ZE** and **4ZE** = Limit switch to indicate when the brushes are fully lifted.

**1ZE** and **3ZE** = Limit switch to indicate when brushes are fully lowered.



##### ATTENTION

**2ZE**, **4ZE**, **1ZE** and **3ZE** are signaling switches indicating if the brushes are lowered or lifted, and, therefore, must not be used to command (turn on/off) the electromechanical actuator.

#### 4.7.2.5.4 Manual operation

When it is not possible to operate the motorized brush lifting system, the user can operate it manually. Refer to the section 5.2.3 for details on the manual operation.

### 4.8 MECHANICAL ASPECTS

#### 4.8.1 Base

- The base or structure where the motor will be installed must be sufficiently rigid, flat, free of external vibration and capable to withstand the mechanical loads to which it will be submitted;
- If the dimensioning of the base is not carefully executed, this may cause vibration in the base, on the motor and the driven machine;
- The base structural design must be done based on the dimensional drawing, on the information about foundation mechanical loads, and on the motor anchoring method.
- The customer is responsible for the design and construction of the foundation according to the requirements described in Natural frequency of the base.



##### ATTENTION

Place shims of different thicknesses between the motor supporting surfaces and the base in order to allow a precise alignment.



##### NOTE

The user is responsible for dimensioning and building the foundation where the motor will be installed.

## 4.8.2 Base loads

Based on Figure 4.9, base loads can be calculated by the equations:

$$F_1 = +0.5.m.g. + \frac{(4C_{\max})}{(A)}$$

$$F_2 = +0.5.m.g. - \frac{(4C_{\max})}{(A)}$$

**Where:** F1 and F2 - Reaction of the feet on the base (N)

**g** - Acceleration of gravity (9.81m/s<sup>2</sup>)

**m** - Motor mass (kg)

**C<sub>max</sub>** - Maximum torque (Nm)

**A** - Obtained from the motor dimensional drawing

(m)

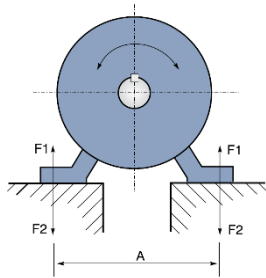


Figure 4.9: Foundation loads

## 4.8.3 Base types

### 4.8.3.1 Concrete base

The type and size of the foundation, bolts and anchoring plates depend on the motor size and type.

#### Example of base preparation:

- Remove all the dirt from the foundation to ensure a proper binding between the foundation blocks and the mortar.
- Fasten the foundation blocks to the motor feet using bolts.
- Use shims of different thicknesses (total thickness of approximately 2 mm) between the motor feet and the foundation surfaces in order to obtain a precise vertical alignment.
- In order to ensure the centralization of the bolts regarding the foot holes, use a metallic or a cardboard (prespan) sheet as bushing, making possible a precise horizontal alignment later.
- Place shims or leveling bolts under the foundation** blocks to ensure proper leveling and perfect alignment of the motor with the driven machine. After the mortar is applied, the alignment must be precisely controlled. Occasional small corrections may be done with washers or metal sheets or by readjusting the clearance of the fastening bolts.
- Tighten all the fastening bolts firmly. Make sure the motor feet surfaces are supported evenly without distorting the motor frame.

For precise fixation, introduce two tapered pins after finishing the test.

### 4.8.3.2 Sliding base

In case of pulley drive, the motor must always be mounted on a sliding base (rails), and the lower part of the belt must be tightened.

The rail closer to the driving pulley must be mounted so that the positioning bolt is placed between the motor and the driven machine. The other rail must be mounted with the bolt in the opposite position, as shown in Figure 4.10.

The motor is bolted on rails and positioned on the foundation.

The driving pulley is then aligned so that its center and the center of the driven pulley are in the same plane, and the motor and machine shafts are perfectly parallel. The belt must not be stretched too much. After the alignment, the rails are fixed.

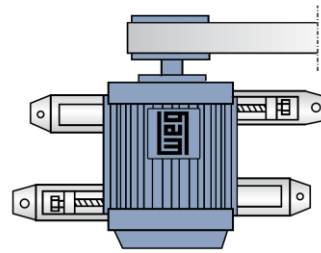


Figure 4.10: Sliding base

### 4.8.3.3 Metal base

The motor must rest evenly on the metal base in order to prevent deformations of the frame. Occasional errors in the height of the surface that supports the motor feet can be corrected with shims (a maximum height of 2 mm is recommended).

Do not remove the machines from the common base to align them. The base must be leveled on the foundation by using spirit levels or other leveling devices.

When a metal base is used to align the height of the motor shaft end with the machine shaft end, it must be leveled on the concrete base.

After the base has been leveled, the anchor bolts tightened and the couplings checked, then the metal base and the anchor bolts are cemented.

### 4.8.3.4 Anchor bolts

Anchor bolts are devices to fasten the motors directly on the foundation when the motors are applied with elastic coupling. This coupling type is characterized by the absence of loads on the bearings.

The anchor bolts must neither be painted, nor present rust, since that impairs the adhesion to the concrete, loosening them.

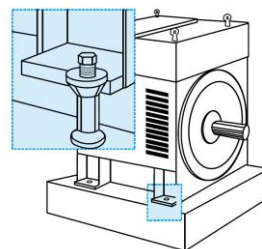


Figure 4.11: Anchor bolts

#### 4.8.4 Anchor plate set

The anchor plate set, when used, is composed of the anchor plate, leveling bolts, leveling shims, alignment bolts and anchor bolts.



##### NOTES

When WEG supplies the anchor plate for fastening and aligning the motor, the dimensional and installation details of the anchor plate are supplied in the specific dimensional drawing of the motor. The user is responsible for mounting, leveling and grouting the anchor plates (except when otherwise specified by commercial agreement).

The anchor bolts must be fastened according to Table 4.8.

Table 4.8: Tightening torque of the anchor bolts

Type Ø	Dry tightening torque [Nm]	Tightening torque with Molycote [Nm]
M30	710	470
M36	1230	820
M42	1970	1300
M48	2960	1950
M56	3500	2300

After positioning the motor, perform the final leveling using the vertical leveling bolts and the leveling shims.



##### ATTENTION

Protect all the threaded holes to prevent grout from penetrating the threads during the grouting of the anchor plate and anchor bolts.

#### 4.8.5 Natural frequency of the base

In order to ensure a safe operation, the motor must be precisely aligned with the coupled equipment and both must be properly balanced.

As a requirement, the motor installation base must be flat and meet the requirements of DIN 4024-1 standard. In order to verify if the criteria of the standard are being met, the following potential vibration excitation frequencies generated by the motor and coupled machine must be checked:

- The motor rotation frequency;
- The double of the rotation frequency;
- The double of the motor electric frequency.

According to DIN 4024-1 standard, the natural frequencies of the base or foundation must be away from these potential excitation frequencies, as specified next:

- The first natural frequency of the base or foundation (first order natural frequency of the base) must be out of the range from 0.8 to 1.25 times any of the potential excitation frequencies above;
- The other natural frequencies of the base or foundation must be out of the range from 0.9 to 1.1 times any of the potential excitation frequencies above.

#### 4.8.6 Leveling

The motor must rest on a surface with flatness of up to 0.08 mm/m.

Verify whether the motor is perfectly leveled, both in the vertical and horizontal planes. Make the proper adjustments by placing shims under the motor. The motor leveling must be checked with proper equipment.



##### NOTE

At least 75% of the motor foot support surfaces must rest on the motor base.

#### 4.8.7 Alignment

The motor must be correctly aligned with the driven machine.



##### ATTENTION

Incorrect alignment can damage the bearings, generate excessive vibration and even break the shaft.

The alignment must be done according to the coupling manufacturer recommendations.

The motor and driven machine shafts must be aligned in the axial and radial directions, as shown in Figure 4.12 and Figure 4.13.

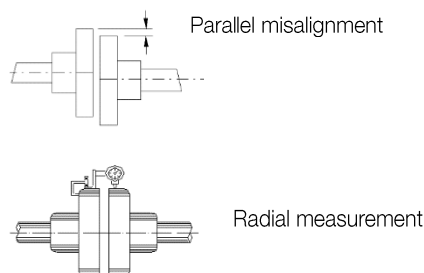


Figure 4.12: Parallel alignment

Figure 4.12 shows the parallel misalignment of the two shaft ends and the practical way to measure it by using suitable dial gauges.

The measurement is performed in four points 90° away from each other with the two half-couplings rotating together in order to eliminate effects of support surface irregularities on the dial gauge tip. Choosing the upper vertical point as 0°, half of the difference between the dial gauge measurements at the 0° and 180° points represents the vertical coaxial error. In case of deviation, it must be corrected by adding or removing leveling shims. Half of the difference between the dial gauge measurements at the 90° and 270° points represents the horizontal coaxial error.

These measurements indicate when it is necessary to lift or lower the motor, or move it to the right or to the left on the drive end in order to eliminate the coaxial error. Half of the maximum difference among the dial gauge measurements in a complete rotation represents the maximum eccentricity found.

The misalignment in a complete shaft rotation, with rigid or semiflexible coupling, cannot exceed 0.03 mm. When flexible couplings are used, greater values than those indicated above are acceptable, provided that they do not exceed the value allowed by the coupling manufacturer.

It is recommended to keep a safety margin for these values.

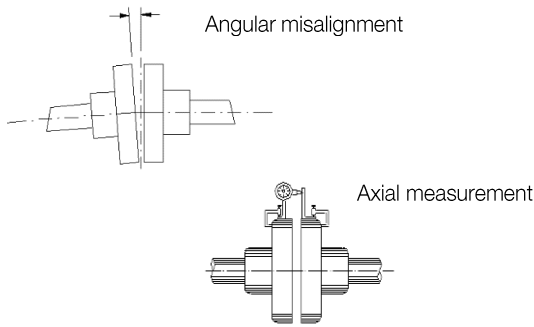


Figure 4.13: Angular alignment

Figure 4.13 shows the angular misalignment and a practical form to measure it.

The measurement is done in four points 90° away from each other, with the two half-couplings rotating together in order to eliminate effects of support surface irregularities on the dial gauge tip. Choosing the upper vertical point as 0°, half of the difference between the dial gauge measurements at the 0° and 180° points represents the vertical misalignment. In case of deviation, it must be corrected by adding or removing alignment shims.

Half the difference between the dial gauge measurements at the 90° and 270° points represents the horizontal misalignment, which must be properly corrected by displacing the motor in the lateral/angular direction.

Half of the maximum difference among the dial gauge measurements in a complete rotation represents the maximum angular misalignment found.

The misalignment in a complete shaft rotation, with rigid or semi flexible coupling, cannot exceed 0.03 mm.

When flexible couplings are used, greater values than those indicated above are acceptable, provided that they do not exceed the value allowed by the coupling manufacturer. It is recommended to keep a safety margin for these values.

**In the alignment/leveling, the influence of the temperature on the motor and the driven machine must be taken into account.** Different expansions of the parts may change the alignment/leveling conditions during operation.

#### 4.8.8 Doweling

After aligning the set and having assured a perfect alignment (both, hot and cold), the motor must be doweled to the anchor plate or to the base, as shown in Figure 4.14.

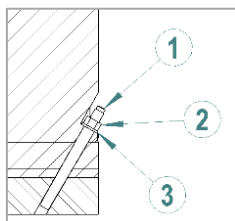


Figure 4.14: Dowel pin set

##### Figure 4.14 legend:

1. Dowel pin (optional supply)
2. Nut (optional supply)
3. Washer (optional supply)



#### NOTE

For the doweling, the motor has a pre-hole with Ø9 mm, which must be first expanded to Ø11.5 mm, and then reamed to Ø12 mm with a taper of 1:50.

#### 4.8.9 Couplings

Only proper couplings, which convey only torque without generating transversal forces, must be used.

For both flexible and rigid couplings, the shaft centers of the coupled machines must be in a single line.

Flexible couplings mitigate the effects of residual misalignments and prevent transmission of vibration between the coupled machines, which does not occur when rigid couplings are used.

The coupling must be mounted or removed with the aid of proper devices and never by means of rudimentary tools, such as hammers, sledgehammers, etc.

Follow the manufacturer's instructions when mounting or removing couplings or other drive elements and cover them with a touch guard. For trial run in uncoupled state, lock or remove the shaft end key. Avoid excessive radial and axial bearing loads (note manufacturer's documentation). The balance of the machine is indicated as H= half and F= full key. In half key cases coupling must be half key balanced without a key. In case of protruding, visible part of the shaft end key, establish mechanical balance.



#### ATTENTION

Dowel pins, nuts, washers and leveling shims may be supplied with the motor, when requested in the purchase order.



#### NOTES

The user is responsible for the motor installation (unless otherwise specified by commercial agreement). WEG is not liable for damages to the motor, associated equipment and installation occurred because of:

- Transmission of excessive vibration;
- Poor installations;
- Faulty alignment;
- Improper storage conditions;
- Noncompliance with the instructions before start-up;
- Incorrect electrical connections.

#### 4.8.9.1 Direct coupling

Because of issues about cost, space economy, problems with belt sliding and more safety against accidents, direct coupling must be used whenever possible. Also, direct coupling is preferable in case of transmission with reduction gearing.



##### ATTENTION

Align the shaft ends carefully, and, whenever possible, use flexible coupling, leaving a minimum clearance (E) of 3 mm between the couplings, as shown in Figure 4.15.

 


Figure 4.15: Axial clearance of the coupling (E)

#### 4.8.9.2 Gear coupling

Gear couplings badly aligned generate vibration in the transmission itself and in the motor. Therefore, caution must be taken so that the shafts be perfectly aligned, rigorously parallel in case of spur gear transmissions and in a correct angle in case of transmissions by bevel or helical gears.

The gear teeth meshing can be controlled with the insertion of a paper strip, on which the trace of all teeth shows up after a gear turn.

#### 4.8.9.3 Belt drive

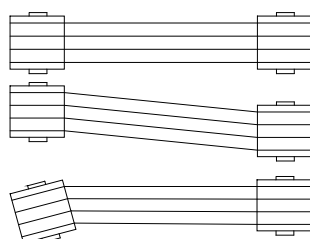


Figure 4.16: Belt drive

When a reduction or increase in speed is required, the belt transmission is the most indicated. In order to avoid unnecessary stress on the bearings, the shafts and the pulleys must be perfectly aligned. Belts that operate obliquely transmit alternating jolts to the rotor and will be able to damage the bearings. Belt slippage can be prevented by applying a resin like material, such as pitch for instance. The belt tension must be just enough to prevent slippage during operation.



##### NOTE

Belts too tensioned increase the load on the shaft end, causing vibration and fatigue, or even the break of the shaft.

Avoid using too small pulleys, since they cause flexion of the motor shaft because of the belt traction force that, which increases as the diameter of the pulley decreases.



##### ATTENTION

Consult WEG for the correct sizing of the pulley.



##### NOTE

Always use properly balanced pulleys. Avoid extra key lengths, because they increase the unbalancing mass and increase the motor vibration.

#### 4.8.9.3.1 Electrostatic charge



##### EX

When belt drive is used, the belts must not be electrostatically charged.

#### 4.8.9.4 Coupling of motors equipped with sleeve bearings

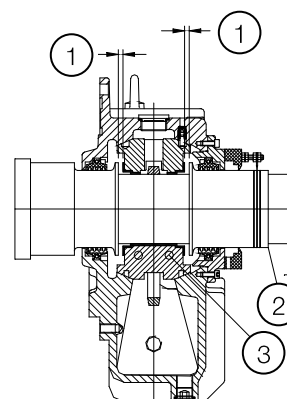


Figure 4.17: Sleeve bearing

##### Figure 4.17 legend:

1. Axial clearance
2. Shaft
3. Bearing shell



##### ATTENTION

Motors equipped with sleeve bearings must operate with direct coupling to the driven machine or by means of a gear box. This type of bearing does not allow belt drive.

Motors equipped with sleeve bearings have three marks on the shaft end, so that the central mark (painted red) is the indication of the magnetic center, and the two outer marks indicate the allowed limits for axial rotor movement.

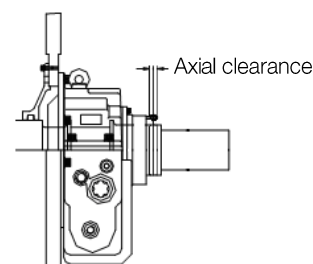


Figure 4.18: Magnetic center mark



For the motor coupling, the following factors must be taken into account:

- Bearing axial clearance;
- Axial displacement of the driven machine (if any);
- Maximum axial clearance allowed by the coupling.



#### ATTENTION

- Move the shaft completely forward and then perform the correct measurement of the axial clearance;
- Align the shaft ends carefully and, whenever possible, use a flexible coupling, leaving a minimum axial clearance of **3 to 4 mm** between the couplings.



#### NOTE

If it is not possible to move the shaft, then the shaft position, the shaft forward displacement (according to the marks on the shaft), and the axial clearance recommended for the coupling must be considered.

- Before putting it into operation, it is necessary to check whether the motor shaft allows free axial movement within the aforementioned clearance conditions;
- In operation, the arrow must be positioned on the central mark (red), which indicates that the rotor is in its magnetic center;
- During the start, or even in operation, the motor will be able to move freely between the two outer limit marks.



#### ATTENTION

The sleeve bearings used on this motor were not designed to withstand constant axial loads; therefore, under no circumstances can the motor operate continuously under axial load on the bearings.

The motor can only operate continuously under axial/radial loads on the bearing if the criteria informed in the motor documentation are observed.

## 4.9 HYDRAULIC UNIT

For further information on installation, operation and maintenance of the hydraulic unit (if any), refer to the motor dimensional drawing and the specific manual of this equipment.

The oil return pipe from the motor bearing to the hydraulic unit must have a minimum inclination from the outlet flange of 15° over the entire length of the pipe.



#### ATTENTION

For more information on the installation, operation and maintenance of the hydraulic unit (if any), please refer to the dimensional drawing of the engine and the specific manual for this equipment.

## 4.10 PURGE AND PRESSURIZATION SYSTEM

In motors with Ex “p” protection, the purge and pressurization system is integral part of the motor. For the proper installation and operation of the system, refer to the specific manual of this equipment, supplied with the motor.

The pressurization/purge data is also informed on the equipment specific nameplate and certificate of conformity.

## 4.11 ADDITIONAL COMPONENTS



#### EX

Any component added to the motor by the user, such as cable glands, plugs, encoders, etc., must comply with the type of enclosure protection, the “equipment protection level” (EPL) and the protection degree of the motor, according to the standards indicated on the product certificate.

## 5 STARTING

### 5.1 STARTING WITH RHEOSTAT

The starting of wound-rotor motor must be performed with an external rheostat connected to the rotor circuit through the set of brushes and slip rings.

The function of the starting rheostat is to reduce the starting current and increase the motor starting torque. As the motor speed increases, the rheostat must gradually decrease its resistance until reaching the lowest possible value, and then it must be short-circuited when the motor begins to operate at its rated duty. It is also possible to set the rheostat to obtain the starting torque equal or close to the value of the motor maximum torque. An exception is made when special rheostats are used to vary the motor speed. In this case, the rheostats are designed to remain permanently connected to the motor and vary their resistance within predetermined values.

### 5.2 STARTING OF MOTORS WITH MOTORIZED BRUSH HOLDER

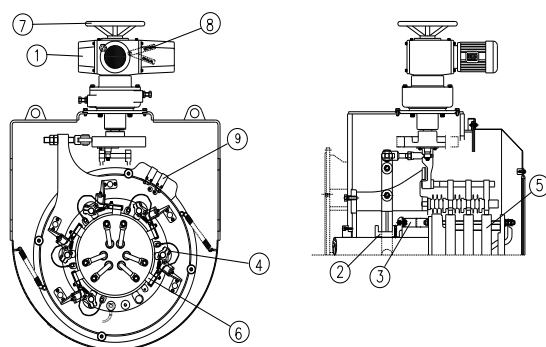


Figure 5.1: Device for lifting the brushes

#### 5.2.1 Conditions for motor starting

In addition to the regular motor starting procedures, the brush lifting system must obey the following activation sequence:

1. The external rheostat must be set to the maximum resistance value;
2. The rheostat short-circuiting circuit breaker must be opened;
3. The rotor short-circuit contacts must be opened, confirmed by the closing of the limit switch **1ZE**;
4. The brushes must be lowered, confirmed by the closing of the limit switch **3ZE** (9);
5. The electromechanical actuator (1) must be in the motor starting position, confirmed by the limit switch **5ZE**;
6. Neither of the torque limit switches, **1WE** or **2WE**, must be actuated;
7. The correct system positioning before starting the motor can be performed by the motorized command by the activation of the electromechanical actuator (1).

#### 5.2.2 After starting

When the motor reaches its rated speed, the slip rings must be short-circuited and the brushes lifted through the drive of the electromechanical actuator (1), which must observe the following sequence:

1. The external starting rheostat must be at its minimum resistance value;
2. Close the short-circuit breaker of the rheostat;
3. Close the rotor short-circuit contacts and lift the motor brushes using the electromechanical actuator;
4. The short-circuit of the slip rings is done by means of the sliding bushing (2) that supports the short-circuit contacts (3). Then, the brush lifting mechanism is activated (4);
5. When the brushes are totally lifted, the electromechanical actuator is turned off by means of the limit switch **6ZE**;
6. Confirm the procedure conclusion through the switches **2ZE**, **4ZE** and **6ZE** according to the operating logic of the motorized brush holder described in section 4.7.2.5.3 of this manual;
7. Neither of the torque limit switches, **1WE** or **2WE**, must be actuated;
8. The motor must continue its operation on duty with the brushes lifted and slip rings short-circuited.



#### ATTENTION

Even if the rheostat is at its minimum resistance value, it must be short-circuited before short-circuiting the slip rings of the motor in order to prevent sparking during the closing of the contacts, which can damage them. After the motor starting, the brushes must not remain in contact with the slip rings, because that can cause excessive wear of the brushes and slip rings, as well as damage the brush lifting system.



#### ATTENTION

If one of the torque switches **2WE** or **1WE** actuates during motor starting procedure, the system must not be used again before investigating the cause and fixing the problem;

The control panel of the motorized brush lifting system must have signaling devices that indicate the operation of the system logic.

The command and signaling system of the brushes-lifting device, the external rheostat and the short-circuit breaker of the rheostat are not integral parts of the motor.

### 5.2.3 Manual operation

The operation type change (motorized/manual) is done through the lever (8). The **1HZ** switch indicates the lever (8) position to perform either motorized or manual operation.

If the motorized system cannot be activated, the brush set can be operated manually by using the handwheel (7).

In order to operate the system manually by means of the handwheel (7), the lever (8) must be moved downwards, as shown in Figure 5.2.

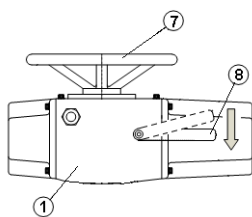
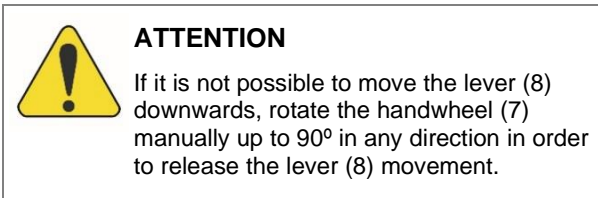


Figure 5.2: Manual operation

**Figure 5.2 legend:**

- 1 – Electromechanical actuator
- 7 – Handwheel
- 8 – Lever

With the lever (8) in "Manual" position, rotate the handwheel (7) to lift the brushes and short-circuit the slip rings or lower the brushes and open the short-circuit of the slip rings, as shown in Figure 5.3.


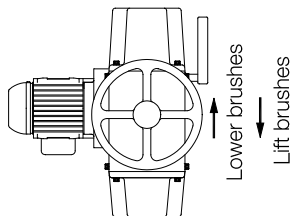


Figure 5.3: Handwheel for manual operation



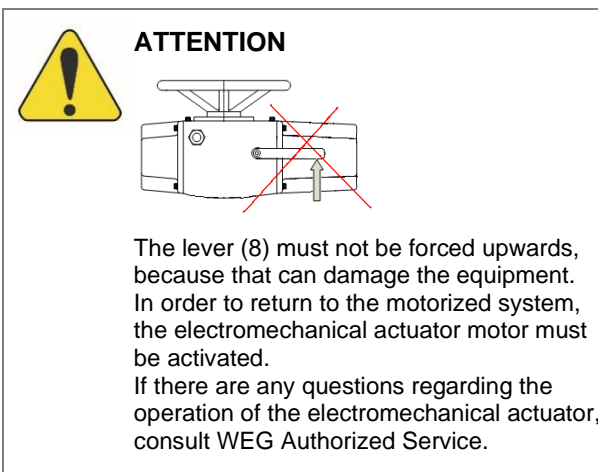

## 6 COMMISSIONING

When the motor is started for the first time or after a prolonged standstill, several aspects must be considered besides the regular operation procedures.



### ATTENTION

- Avoid any contact with electric circuits;
- Even low-voltage circuits may be life threatening;
- In any electromagnetic circuit, overvoltage may occur under certain operating conditions;
- Do not open an electromagnetic circuit suddenly, because the presence of an inductive discharge voltage may break the insulation or injure the operator;
- In order to open those circuits, disconnect switches or circuit breakers must be used.

### 6.1 PRELIMINARY INSPECTION

Before the first motor start or after long periods out of operation, the following items must be inspected:

1. Check if all the motor fastening bolts are tightened;
2. Measure the winding insulation resistances, making sure they are within the specified values;
3. Check if the motor is clean and if the packages, measuring instruments and alignment devices were removed from the motor operating area;
4. Check if coupling connecting components are in perfect operating conditions, duly tightened and greased, where necessary;
5. Check if the motor is correctly aligned;
6. Check if the bearings are properly lubricated. The lubricant must be of the type specified on the nameplate;
7. Check the oil level of oil-lubricated bearings. Bearings with forced lubrication must have the oil pressure and flow as specified on their nameplate;
8. Inspect the cable connections of accessories (thermal protectors, grounding, space heaters, etc.);
9. Check if all electrical connections comply with the motor connection diagram;
10. Check if the motor is properly grounded;
11. The cables connected to the stator and rotor main terminals must be properly tightened in order to prevent their short-circuit or loosening;
12. Inspect the cooling system. In water-cooled motors, inspect the operation of the radiator water supply system. In motors with independent ventilation, check the rotation direction of the fans;
13. Motor air inlets and outlets (if any) must be unobstructed;
14. The moving parts of the motor must be protected to prevent accidents;
15. The terminal box covers must be correctly fastened;
16. Check if the power supply voltage and frequency comply with the data on the motor nameplate;
17. Check the conditions of the brush holders and slip rings;
18. Check if the brushes are well settled, if they are aligned with the slip rings and if they slide easily inside the brush holders;
19. Inspect the operation of the brush lifting system (if any);
20. Inspect the starting rheostat and its connection to the motor.
21. Inspect the operation of the anti-reversion devices (if any).
22. Inspect if the purge and pressurization device (if any) is correctly installed and adjusted according to its nameplate.

### 6.2 FIRST STARTING

#### 6.2.1 Ex “p” Motors



#### EX

In motors with Ex “p” protection, before starting the motor, the purge and pressurization device must be turned on according to the instructions contained in its operation manual. The motor enclosure must be purged, thus expelling any flammable gas which may have entered the motor when it was not pressurized. The purge time is defined during the motor certification process by means of the so-called purge test and informed on the nameplate attached to the motor. The motor must be pressurized before starting and during its operation.



#### DANGER

The operation of the Ex “p” motor without pressurization is potentially dangerous. It must only be permitted when the motor interior and exterior are admittedly free of flammable gases. Such operating condition is the sole responsibility of the user.

#### 6.2.2 Starting procedure

After all preliminary inspections have been carried out, proceed according to the directions presented next in order to perform the first start of the uncoupled motor:

1. Turn off the space heater;
2. Set the protections in the control panel;
3. In oil-lubricated bearings, check the oil level;
4. In bearings with forced-lubrication, start the oil circulation system and check the level, flow and pressure of the oil, making sure that they comply with the data on the nameplate.
5. If the system has oil flow detection equipment, it must be waited until the flow return signal from the oil circulation system of both bearings is received, which makes sure that the oil has reached the bearings;
6. Start the industrial water-cooling system checking the required flow and pressure (motors with air-water heat exchanger);
7. Turn on the fans (motors with forced ventilation);
8. Switch on the high-pressure oil injection system (if any), keeping it on as informed in the motor technical documentation until the bearings get the lubrication by self-pumping;

9. Rotate the motor shaft slowly in order to check that no part is being dragged or any abnormal noises are occurring;
10. After the previous steps have been adequately completed, it is possible to proceed with the motor starting sequence;
11. Start the motor with no load, making sure it rotates smoothly without strange noises;
12. Check the rotation direction with the motor uncoupled;
13. In order to invert the rotation direction, just invert the connections of any two phases;



#### ATTENTION

In order to invert the rotation direction of motors with single direction, it is necessary to consult WEG.

14. Keep the motor rotating at rated speed and write down the bearing temperatures at 1-minute intervals until they become constant. Any sudden increase in bearing temperature indicates lubrication or friction surface abnormality;
15. Monitor the temperature, the oil level of the bearings, and the vibration levels. If there is a significant variation of any value, interrupt the motor starting, identify possible causes and make the necessary corrections;
16. When the bearing temperatures stabilize, it is possible to proceed to the other motor operation steps.



#### ATTENTION

The noncompliance with the procedures described in section 6.2 may impair the motor performance, cause damages and even lead to its burnout, voiding the warranty.

## 6.3 OPERATION

The operating procedures vary considerably depending on the motor application and the type of control equipment used.

The general procedures are described in this manual. For the control system operating procedures, refer to the specific manual of this equipment.

### 6.3.1 General

After a first successful starting test, couple the motor to the driven load, and then the starting procedure can be reinitiated, as follows:

- Start the motor coupled to the load until its temperature stabilizes and check for unusual noises, abnormal vibrations or excessive heating. If significant vibration variations occur regarding the initial operation condition until the condition after reaching thermal stability, then it is necessary to check the alignment and the leveling.
- Measure the current consumption and compare it to the value given on the nameplate.
- In continuous duty, without load variation, the measured current must not exceed the value indicated on the nameplate multiplied by the service factor;
- All the instruments and devices for measurement and control must be permanently monitored to detect occasional alterations, determine their causes and make the proper corrections.

### 6.3.2 Load Condition



#### ATTENTION

Check the real load condition to which the motor will be submitted under operating conditions and, if necessary, resize the set of brushes. In case of questions, consult WEG.

### 6.3.3 Temperatures

- The temperatures of the bearings, stator winding and cooling system must be monitored while the motor is operating.
- These temperatures must stabilize within 4 to 8 hours of operation.
- The stator winding temperature depends on the machine load; therefore, the driven load must also be monitored during the motor.

### 6.3.4 Bearings

The system start, as well as the first hours of operation, must be monitored carefully.

**Before putting the motor into operation, verify:**

- If the high-pressure oil injection system (if any) is ON;
- If the external lubrication system (if any) is ON;
- If the used lubricant complies with the specifications;
- The lubricant characteristics;
- The oil level (oil-lubricated bearings);
- If the bearing alarm and trip temperatures are set;
- During the first start, it is important to pay attention to unusual vibrations or noises;
- If the bearing is not working silently and smoothly, the motor must be shut down immediately;
- In case of overheating, the motor must be shut down immediately for the inspection of bearings and temperature sensors, and the correction of possible causes;
- The motor must operate for several hours until bearing temperatures stabilize within the specified limits;
- After the bearing temperatures stabilize, check if there are no leaks through the plugs, gaskets or shaft end.

#### 6.3.4.1 High-pressure oil injection system

In bearings which have the option for shaft lifting when starting or stopping by means of oil pressure, the activation of this system is done by means of an external oil pump, and the following procedure must be observed:



#### ATTENTION

The high-pressure oil injection system must be switched on before putting the motor into operation and during the shutdown procedure, as informed in the motor technical documentation.

### 6.3.5 Radiators

During the operation of motors with air-water heat exchanger, it is necessary:

- Controlling the temperature at the radiator inlet and outlet and, if necessary, correcting the water flow;
- Adjusting the water pressure just to overcome the resistance in the pipes and in the radiator;
- In order to control the motor operation, it is recommended to install thermometers at the radiator air and water inlets and outlets and record these temperatures at certain time intervals;

- When installing the thermometers, recording or signaling instruments (siren, lights) can also be installed in certain places.

#### Verification of the radiator performance

- For operation control purposes, it is recommended that water and air temperatures at the radiator inlets and outlets be measured and recorded periodically;
- The radiator performance is expressed by the temperature difference between cold water and cold air during normal operation. This difference must be checked periodically. If an increase in this difference is observed after a long period of normal operation, verify the need for radiator cleaning.
- The accumulation of air inside the radiator can lead to a performance reduction or to its damage. In this case, a deaeration of the radiator and the pipes may solve the problem;
- The water pressure differential can be considered an indicator of the need for cleaning the radiator.
- It is also recommended to measure and record the difference between the water pressure before and after the radiator. Periodically, the values measured must be compared to the original value, and an increase of the pressure differential indicates the need for cleaning the radiator.

### 6.3.6 Vibration

The motors are balanced at the factory in compliance with the vibration limits established by IEC60034-14, NEMA MG1 – Part 7 and NBR 11390 standards (except when the purchase contract specifies different values).

The vibration measurements are carried out on the NDE and DE bearings, in the vertical, horizontal and axial directions. When the customer sends the half coupling to WEG, the motor is balanced with the half coupling mounted on the shaft. Otherwise, according to the standards above, the motor is balanced with half-key (i.e., the key slot is filled with a bar of the same width, thickness and height of the key slot during the balancing operation).

The maximum vibration levels attended by WEG for motors in operation are informed in Table 6.1. These values are generic and for guidance, and the specific application conditions must always be taken into account:

Table 6.1: Vibration (RMS)

Rated speed (rpm)	Vibration Levels (mm/s RMS)			
	Frame	< 355	355 to 560	> 630
$600 \leq n \leq 1800$	Alarm	4.5	4.5	5.5
	Tripping	7.0	7.0	8.0
$1800 < n \leq 3600$	Alarm	3.5	4.5	5.5
	Tripping	5.5	6.5	7.5

The main vibration causes are:

- Misalignment between the motor and the driven equipment;
- Improper fastening of the motor to the base, with "loose shims" under one or more motor feet, and loose fastening bolts;
- Improper or insufficiently rigid base;
- External vibrations proceeding from other equipment.



#### ATTENTION

Operating the motor with vibration levels above the values contained in Table 6.1 may impair its useful life and/or performance.

### 6.3.7 Shaft vibration limits

In motors equipped with or prepared for the installation of proximity sensors (normally used on sleeve bearings), the surfaces of the shaft are prepared with special finishing in the areas adjacent to the bearings, in order to assure the correct measurement of the shaft vibration.

The shaft vibration measured in these motors must comply with the IEC 60034-14 or NEMA MG 1 standard.

The alarm and trip values of Table 6.2 represent the acceptable shaft vibration values for coupled electrical machines according to the ISO7919-3 standard.

These values are generic and for guidance, and the specific application conditions must always be taken into account, especially the diametrical clearance between the shaft and the bearing.

Table 6.2: Shaft vibration

Rated Speed (rpm)	Shaft Vibration ( $\mu\text{m}$ peak-to-peak)			
	Frame	280 and 315	355 to 450	> 450
1800	Alarm	110	130	150
	Tripping	140	160	190
3600	Alarm	85	100	120
	Tripping	100	120	150



#### ATTENTION

Operating the motor with shaft vibration values within the alarm or tripping range may cause damages to the bearing shell.

The main causes for increase in shaft vibration are:

- Coupling unbalance issues or other problems that may also generate machine vibration;
- Shaft shape problems in the measurement region, minimized during manufacturing;
- Residual magnetism or voltage on the shaft surface where the measurement is done;
- Scratches, dents or variations on the shaft finishing in the measurement region.

### 6.3.8 Shutdown

In order to shut down the motor, proceed as follows:

- Reduce the load of the driven equipment, if possible;
- Open the main circuit breaker;
- Switch on the high-pressure oil injection system (if any);

After the motor stops completely:

- Switch off the high-pressure oil injection system (if any);
- Switch off the oil circulation system of the bearings (if any);
- Switch off the hydraulic unit (if any);
- Shut down the industrial water system (if any);
- Switch off the forced ventilation system (if any);
- Switch on the space heaters. They must be kept ON until the next motor operation.



#### DANGER

Even after switching the motor off, while the rotor is rotating, there is danger to life by touching any of the motor active parts.



#### ATTENTION

The terminal boxes of motors equipped with capacitors must not be opened before their full discharge.  
Discharge time of the capacitors: five minutes after shutting down the motor.

## 7 MAINTENANCE

### 7.1 GENERAL

A proper maintenance program for electric motors includes the following recommendations:

- Keep the motor and the associated equipment clean;
- Measure the winding insulation resistance periodically;
- Measure the temperature of windings, bearings and cooling system periodically;
- Check the wear, operation of the lubrication system and useful life of the bearings;
- Measure the motor vibration levels;
- Inspect the cooling system;
- Inspect associated equipment;
- Inspect all the motor accessories, protections and connections, ensuring that they are operating properly;



#### ATTENTION

The resistors must be de-energized before opening the connection box cover, whenever maintenance is carried out.




#### ATTENTION

Noncompliance with the recommendations of section 7.1 may cause undesired stoppages of the equipment.  
The frequency of such inspections depends on the local application conditions.  
Every time that it becomes necessary to transport the motor, the shaft must be properly locked to prevent damages to the bearings. Use the device supplied with the motor to lock the shaft.  
If the motor requires reconditioning or replacement of any damaged part, consult WEG.

#### 7.1.1 Brushes and slip rings

Check the wear of the brushes and its surface condition.

Table 7.1: Brushes S1, S2, S3

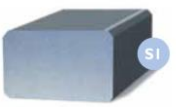	S1 - Appearance: Impeccable, uniform, shiny surface	Good working condition
	S2 - Appearance: Impeccable surface, slightly porous, shiny	Good working condition
	S3 - Appearance: Extremely fine striations.	Normal operation, slight incidence of dust

The brush should not be used beyond its usage limit.



Figure 7.1: Usage limit

The average service life of the brush is around 3,600 hours, provided that the appropriate number of brushes is used according to the load, that the recommendations for cleaning and changing the filter set out in this manual are followed, that the brushes are properly seated in the slip ring when they are replaced, and that the springs are replaced when they no longer exert adequate pressure on the brushes. Check the condition of the brush holder and ensure that the brush moves freely within the holder. Check the condition of the surface of the slip ring. Measure the Ra value.  
Check for patina formation on the slip ring.  
The patina is a semiconductor film resulting from the electroplating process. Normal patina is uniform in color (brown, light grey or dark grey) and has an ideal thickness of approximately 0.03 mm.  
A thin, light film can be considered to indicate - moderate friction - good contact - adequate temperature in the slip ring. This is an "ideal" film.

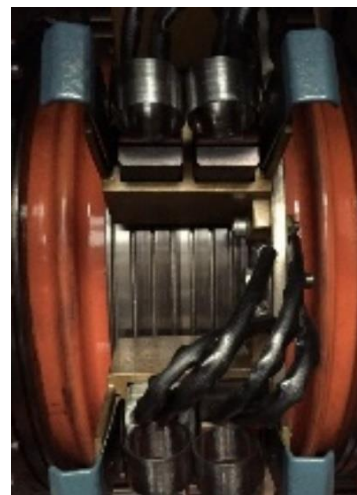


Figure 7.2: Good patina condition

For slip rings with helical grooves, it is essential that the wedges are properly chamfered to avoid excessive wear on the brushes.

Prolonged operation of a motor without adequate patina can lead to slip ring wear. This condition is preventable through regular inspections of the patina. However, if the slip ring is worn, it must be restored to its original condition by machining.



## 7.2 GENERAL CLEANING

- Keep the frame clean, without external accumulation of oil or dust, in order to facilitate the heat exchange with the environment;
- The inside of the motor must also be kept clean, free of dust, debris and oils;
- For cleaning, use brushes or clean cotton cloths. If the dust is not abrasive, the cleaning must be done with an industrial vacuum cleaner, "aspiring" the dirt from the fan cover and the dust accumulated on the fan blades and on the frame;
- Debris impregnated with oil or moisture can be removed with a cloth soaked in appropriate solvents;
- Clean the terminal boxes when necessary. Terminals and connectors must be kept clean, free of rust and in perfect operating conditions. Avoid the presence of grease or verdigris in the connection parts.

### 7.2.1 Electrostatic charge



#### DANGER

Motors that have potential risk of electrostatic charge accumulation, supplied properly identified, must be cleaned carefully, with a damp cloth, for instance, in order to prevent the generation of electrostatic discharges.

## 7.3 BRUSHES COMPARTMENT CLEANING

- At the beginning of the motor operation (First commissioning & during every brush replacement cycle) inspect the brush compartment after a week of operation or 100hrs and perform internal cleaning of the compartment and change the filters.
- Change the filters on monthly basis during regular operation or every 600hrs. cleaning and reusing of same filters are not recommended.
- The brush compartment must be kept clean, without dust accumulation from the wear of the electric brushes;
- Use industrial vacuum cleaner to remove the accumulated carbon dust in areas like Slipring studs, cables, Brush riding surface of slipring, brush holders, insulators etc.,
- Do not use solvents to clean the slip rings, because the vapors of such products impair the operation of the brushes and the slip rings;
- Grooves in the Slipring brush track region should be cleaned using soft tools (not metallic) only. Take care, that no sharp tools should be used. In case of any damage the brush wear will increase.
- Air filters (if any) must be removed and cleaned every two months.

## 7.4 WINDING MAINTENANCE

To obtain more satisfactory operation and a longer life of the motor, the windings should be inspected and cleaned annually.

### 7.4.1 Winding inspection

Yearly, the windings must be submitted to a complete visual inspection, recording and repairing all and every damage or defect observed. The winding insulation resistance measurements must be done at regular intervals, especially during humid weather and after prolonged motor stoppages.

Low values or sudden variations in the insulation resistance must be investigated.

The windings must be submitted to complete visual inspections at frequent intervals, recording and repairing all and every damage or defect observed.

The winding insulation resistance can be increased up to an adequate value in the points where it is low (as a result of excessive dust and moisture) by means of the dust removal and by drying the winding moisture.

### 7.4.2 Winding cleaning

In order to obtain a more satisfactory operation and a longer useful life of the insulated windings, it is recommended to keep them free of dirt, oil, metal dust, contaminants, etc.

Therefore, it is necessary to inspect and clean the windings periodically, according to the recommendations of the "Maintenance Plan" of this manual. If reimpregnation is necessary, consult WEG.

The windings may be cleaned with an industrial vacuum cleaner with a non-metallic crevice tool or just a dry cloth.

For extreme dirt conditions, it may be necessary to use a proper liquid solvent for cleaning. This cleaning must be quick to prevent prolonged exposure of the windings to the solvent effects.

After being cleaned with solvents, the windings must be completely dried.

Measure the insulation resistance and the polarization index in order to assess the winding insulation conditions.

Winding drying time after cleaning varies depending on the weather conditions such as temperature, humidity, etc.



#### DANGER

Most solvents currently used are highly toxic and/or flammable.

Solvents must not be used in the straight parts of the coils of high-voltage motors, because they may affect the protection against corona effect.

### 7.4.3 Inspections

The following inspections must be carried out after the windings are carefully cleaned:

- Check the insulations of the winding and connections;
- Check if spacers, bindings, slot wedges, bandages and supports are properly fixed;
- Check for breaks, faulty welds, short-circuit between turns and against the frame in the coils and connections. In case any fault is detected, consult WEG.
- Ensure that all cables are properly connected and that terminal fixation components are duly tightened. Retighten, if necessary.

### 7.4.4 Reimpregnation

If any layer of resin on the windings is damaged during cleaning or inspection, such parts must be corrected with adequate material (in this case, consult WEG).

### 7.4.5 Insulation Resistance

The insulation resistance must be measured after the completion of all of the maintenance procedures.



#### ATTENTION

Before putting the motor back into operation, it is essential to measure the winding insulation resistance and ensure that the measured values meet the specifications.

### 7.5 ELECTRICAL CONNECTION INSPECTION

- Periodically, check that all the connections and terminals of the terminal box are tight;
- Check the passage of the cables in the terminal box, the seals of the cable glands and the seals in the terminal boxes;
- Remove all the dust and dirt from the inside of the terminal box, if necessary.



#### DANGER

Service on electrical machines can only be performed when they are stopped and all the phases disconnected from the power supply.

### 7.6 MECHANICAL INSTALLATION INSPECTION

- Check if all of the motor fastening bolts are tightened;
- Evaluate the coupling run out, measure the axial and radial clearance and compare the results to the maximum specified values;
- Periodically, measure the vibration levels of the machine and compare the results to the values indicated in the table of the "Vibration" chapter.

### 7.7 COOLING SYSTEM MAINTENANCE

- In motors with air-air heat exchanger (IC611), the cooling pipes and noise attenuator (if any) must be kept clean and unobstructed to ensure a perfect heat exchange. In order to remove the dirt accumulated in the pipes, a rod with a round brush at the end may be used. Noise attenuators (if any) can be cleaned with dry compressed air.



#### ATTENTION

It is recommended to close the openings of the external air circuit, if the motor is out of operation for long terms.

- In case of air-water heat exchangers (IC81W), periodic cleaning in the radiator pipes is necessary to remove all and any incrustation, according to item 7.8.
- In open motors (IC01), the air filters should be cleaned with dry compressed air. If dust is difficult to remove, wash the filter with cold water and neutral detergent and dry it in horizontal position. Replace the filters, if necessary.

### 7.8 RADIATOR MAINTENANCE

The degree of dirt in the radiator can be detected by the increase of the temperature at the air outlet. When the temperature of the cold air, under the same operating conditions, exceeds the specified value, it can be assumed that the pipes are dirty.

If corrosion is found in the radiator, it is necessary to provide adequate protection against corrosion (i.e., zinc anodes, cover with plastic, epoxy or other similar products), in order to prevent further damage to the parts already affected.

The external surface of all the radiator parts must always be kept in good conditions.

#### Instructions for removal and maintenance of the radiator

In order to remove the radiator for maintenance, use the following procedure:

1. Close all the water inlet and outlet valves after stopping the ventilation;
2. Drain the water through the radiator drain plugs;
3. Remove the heads, keeping the bolts, nuts, washers and seals (gaskets) in a safe place;
4. Brush the inside of the pipes carefully with nylon brushes in order to remove residues. If damages to the radiator tubes are found during the cleaning, they must be repaired;
5. Reassemble the heads, replacing the gaskets, if necessary.

#### Sacrificial anodes

Sacrificial anodes are used in radiators that operate with seawater. The regular inspection must be carried out, according to the maintenance plan. If excessive corrosion is found in the sacrificial anode, the frequency of inspection must be increased in order to determine the corrosion period and establish a plan for proper replacement intervals.

### 7.9 VIBRATION

Any evidence of increase in the unbalance or vibration of the motor must be investigated immediately.



#### ATTENTION

After torquing or disassembling any machine screw, it is necessary to apply Loctite.

### 7.10 SLIP RINGS

The slip rings must be kept clean and smooth. They must be cleaned monthly, removing all the dust accumulated between the rings (see section 0).

In case the slip rings are disassembled, their centering must be ensured in the assembly, in order to prevent ovalization or radial runouts 0.05mm. It must also be assured the proper positioning of the brush on the ring (100% contact). In case those procedures are not observed, the slip rings and brushes will present wearing issues.

## 7.11 BRUSH HOLDER AND BRUSHES

The **brush holders** must stay in the radial direction regarding the slip rings and distant a maximum of 3 mm from the contact surfaces, preventing rupture or damage to the brushes, as shown in Figure 7.3.

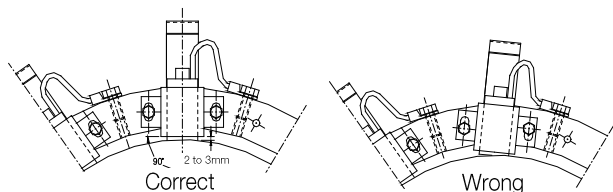


Figure 7.3: Brush holder assembly

### Brushes



#### ATTENTION

The brushes must be inspected weekly in order to ensure their free slide in the brush holder. Worn brushes must be replaced.

Wound-rotor motors are supplied with the quantity and type of brushes specified for their rated power.

The brushes must be replaced by brushes equal to the original ones.

Never mix different kinds of brushes.

Any change in the type or quantity of brushes can only be made with the authorization of WEG.

The brushes must be inspected weekly during operation. If the brushes show individual wear, they should only be replaced individually after WEG has analyzed the cause. It is normal for brushes to have uneven wear. Due to the manufacturing process, the brushes may have slight differences from each other. Wear differences of up to 20% are considered normal. Uneven brush wear is not a critical issue and does not affect the normal operation of the machine.

Another factor that can exacerbate this phenomenon is an uneven current distribution between the brushes. To reduce this, please check the following:

- Connection status (no loose or dirty connections, no damage to the copper plates, etc.)
- Brush holders' position
- Even spring pressure
- Uniform brush seating
- Ease of the brushes to slide on the brush holders
- Cleanliness of the brush holders, contacts (between the brush plate and the brush holder), and absence of dust

Once these corrections are done, evaluate the effectiveness of the fixing.

If the brushes show general and balanced wear, then the entire set can be replaced normally without consulting WEG. Pay attention to the preparation of the carbon brushes regarding their seating on the slip ring.

In motors that always operate in the same rotation direction, the brushes must be seated in this direction only, and not in alternate movements. During the shaft return movement, the brushes must be lifted (Figure 7.4).

To carry out this procedure, use a long strip of sandpaper (100 grit roughing, 240 grit finishing), positioned between the slip ring and the brush, making it necessary for the sandpaper to come into contact with the brush. Install the pressure spring to ensure the position of the brush. Move the sandpaper back and forth to rough up the material until the brush is adjusted to the same radius as the slip ring. This can be done individually for each brush, as it makes the adjustment task easier. Dismantle the spring before removing the

sandpaper. After this process, carefully clean the slip rings, brushes and holders.

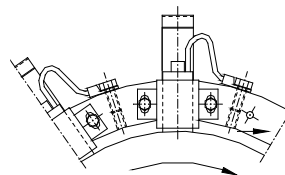


Figure 7.4: Brush seating

The brushes must be seated with even pressure on the contact surface of the ring in order to ensure an even distribution of the current and a low wear of the brushes. It is important that all the assembled brushes have the same contact pressure, with a tolerance of  $\pm 10\%$ . Greater deviations lead to an uneven current distribution, resulting in an uneven wear of the brushes.

The control of the brush pressure is done with a dynamometer.

Checking the spring pressure must be carried out every 8000 hours.

Springs presenting low pressure must be replaced.

### 7.11.1 Adjustment of the brushes to the load conditions

The motor leaves the factory with the brushes adjusted for the rated operating condition. The final adjustment to the real load conditions must be performed on site in the first months of operation.



#### ATTENTION

If the motor operates with a load different from the rated conditions or with intermittent load, the set of brushes (brush type and quantity) must be adapted to the real working conditions, under the risk of impairing the operation or completely damaging the motor. The brush adaptation must be made by consulting WEG.

## 7.12 PURGE AND PRESSURIZATION SYSTEM

For motors with Ex "p" protection type, the maintenance procedure of the purge and pressurization system is described in the specific equipment manual.

Regular inspection of the machine general conditions, of the pressurization system and the internal pressure of the equipment are extremely important.

The frequency of these inspections is indicated in the "MAINTENANCE PLAN" of this manual.



#### ATTENTION

The purge and pressurization equipment setting is done at the factory and must not be changed. The alteration of this setting compromises the equipment operation, besides voiding the motor warranty. Any abnormality must be informed to WEG.



## 7.13 BEARING MAINTENANCE

### 7.13.1 Grease-lubricated rolling bearings



#### NOTE

The rolling bearing data, amount and type of grease, and lubrication intervals are informed on a bearing nameplate affixed to the motor.

**The bearings shall be relubricated annually or according to the lubrication interval stated on the bearings nameplate, whichever occurs first.**

- The informed lubrication intervals, consider a 70 °C working temperature of the rolling bearing;
- Based on the operating temperature ranges listed in Table 7.2, apply the following correction factors for the rolling bearing lubrication intervals:

Table 7.2: Reduction factor for lubrication intervals

Bearing operating temperature	Reduction factor
Below 60 °C	1.59
Between 70 and 80 °C	0.63
Between 80 and 90 °C	0.40
Between 90 and 100 °C	0.25
Between 100 and 110 °C	0.16

#### 7.13.1.1 Instructions for lubrication

The lubrication system was designed in such a way that during the lubrication of the rolling bearings, all the old grease is removed from the rolling bearing races and expelled through a drain which enables the exit of the grease but prevents the ingress of dust or other harmful contaminants.

This drain also prevents damage to the rolling bearings by excessive lubrication.

It is recommended to make the lubrication with the motor in operation in order to ensure the renewal of the grease in the rolling bearing housing.

If that is not possible due to the presence of rotating parts near the grease nipple (pulleys, etc.) which may put the operator at risk, follow the procedures below:

- With the motor stopped, inject approximately half of the total intended amount of grease and operate the motor for approximately one minute at full speed;
- Stop the motor and inject the rest of the grease.



#### ATTENTION

The injection of all the grease with the motor stopped may lead to the penetration of part of the lubricant into the motor through the internal seal of the rolling bearing cap. It is important to clean the grease nipples prior to lubrication in order to prevent foreign materials from being dragged into the rolling bearing. For lubrication, use only manual grease gun.

### 7.13.1.2 Procedures for rolling bearing relubrication

1. Remove the drain plug;
2. Clean with a cotton cloth around the hole of the grease nipple;
3. With the rotor operating, inject the grease with a manual grease gun until grease starts coming out from the drain or until the proper amount of grease, informed in Table 7.4, has been injected.
4. keep the motor running long enough so that the grease excess passes through the drain;
5. Inspect the bearing temperature to make sure there was no significant change;
6. Put the drain plug back in place.

### 7.13.1.3 Rolling bearing relubrication with drawer device for grease removal

In order to relubricate the bearings, the old grease is removed by means of the device with a drawer installed on each bearing.

#### Lubrication procedure:

1. Before starting the lubrication of the bearing, clean the grease nipple with a cotton cloth;
2. Remove the rod with drawer to remove the old grease, clean the drawer and put it back in place;
3. With the motor running, inject the amount of grease specified on the rolling bearing nameplate by means of a manual grease gun;
4. The excess of grease comes out through the bearing lower drain and is deposited in the drawer;
5. Leave the motor running long enough for the grease excess to drain;
6. Remove the excess of grease, by pulling the drawer rod and cleaning the drawer. This procedure must be repeated as many times as necessary until the drawer no longer retains grease;
7. Inspect the bearing temperature to ensure that there was no significant change.

### 7.13.1.4 Type and amount of grease

The relubrication of the bearings must always be done with the **original grease**, specified on the bearing nameplate and in the documentation of the motor.



#### ATTENTION

WEG does not recommend the use of greases different from the motor original grease.

It is important to perform a correct lubrication, i.e., to apply the correct grease and in the proper quantity, because either poor or excessive lubrication will damage the rolling bearings.

Excessive amount of grease cause temperature increase, due to the great resistance it offers to the movement of the bearing rotating parts. Consequently, due to the heating, the grease can completely lose its lubricating characteristics.

### 7.13.1.5 Alternative greases

If it is not possible to use the original grease, the alternative greases listed in Table 7.3 can be used, under the following conditions:

1. The motor speed must not exceed the limit speed of the grease, according to the type of rolling bearing, as informed in Table 7.4;

- The bearing lubrication interval must be corrected by multiplying the interval informed on the bearing nameplate by the multiplication factor informed in Table 7.3;
- Use the correct procedure to change the grease, according to section 7.13.1.6 of this manual.

Table 7.3: Options and characteristics of the alternative greases for regular applications

Manufacturer	Grease	Constant operating temperature (°C)	Multiplication factor
Exxon Mobil	<b>UNIREX N3</b> (Lithium Complex Soap)	(-30 to +150)	0.90
Shell	<b>ALVANIA RL3</b> (Lithium Soap)	(-30 to +120)	0.85
Petrobras	<b>LUBRAX INDUSTRIAL GMA-2</b> (Lithium Soap)	(0 to +130)	0.85
Shell	<b>STAMINA RL2</b> (Diurea Soap)	(-20 to +180)	0.94
SKF	<b>LGHP 2</b> (Polyurea Soap)	(-40 to +150)	0.94

Table 7.4 shows the most common rolling bearings used in horizontal motors, the quantity of grease and the speed limit for using optional greases.

Table 7.4: Application of alternative greases

Rolling bearing	Grease quantity (g)	Limit speed of the grease [rpm] - Horizontal motors				
		Stamina RL2	LGHP 2	Unirex N3	Alvania RL3	Lubrax Industrial GMA-2
6220	30	3000	3000	1800	1800	1800
6232	70	1800	1800	1500	1200	1200
6236	85	1500	1500	1200	1200	1200
6240	105	1200	1200	1200	1000	1000
6248	160	1200	1200	1500	900	900
6252	190	1000	1000	900	900	900
6315	30	3000	3000	3000	1800	1800
6316	35	3000	3000	1800	1800	1800
6317	40	3000	3000	1800	1800	1800
6319	45	1800	1800	1800	1800	1800
6320	50	1800	1800	1800	1800	1800
6322	60	1800	1800	1800	1500	1500
6324	75	1800	1800	1800	1500	1500
6326	85	1800	1800	1500	1500	1500
6328	95	1800	1800	1500	1200	1200
6330	105	1500	1500	1500	1200	1200
NU 232	70	1500	1500	1200	1200	1200
NU 236	85	1500	1500	1200	1000	1000
NU 238	95	1200	1200	1200	1000	1000
NU 240	105	1200	1200	1000	900	900
NU 248	160	1000	1000	900	750	750
NU 252	195	1000	1000	750	750	750
NU 322	60	1800	1800	1800	1500	1500
NU 324	75	1800	1800	1500	1200	1200
NU 326	85	1800	1800	1500	1200	1200
NU 328	95	1500	1500	1200	1200	1200
NU 330	105	1500	1500	1200	1000	1000
NU 336	145	1200	1200	1000	900	900

### 7.13.1.6 Procedure for changing the grease

In order to replace the **POLYREX EM103** grease by one of the alternative greases, the bearings must be opened to remove the old grease and then filled with the new grease.

If it is not possible to open the bearings, the old grease must be purged by applying new grease until it begins to appear in the exit drawer with the motor running.

In order to replace the **PETAMO GHY 133 N** grease by one of the alternative greases, you must first open the bearings, completely remove the old grease, and then fill it with new grease.



### ATTENTION

When the bearing is opened, inject the new grease through the grease nipple to expel the old grease found in the grease inlet tube, and apply the new grease in the rolling bearing, to the inner and outer bearing caps, filling 3/4 of the empty spaces. In case of double bearings (ball bearing + roller bearing), also fill 3/4 of the empty spaces between the intermediate rings. Never clean the rolling bearing with cotton-based cloths, because they may release some lint, working as solid particles.



### NOTE

WEG is not liable for the grease change or for any damages arising from this change.

### 7.13.1.7 Low temperature greases

Table 7.5: Grease for application at low temperatures

Manufacturer	Grease	Constant operating temperature (°C)	Application
Exxon Mobil	<b>MOBILITH SHC 100</b> (Lithium Soap and Synthetic Oil)	(-50 to +150)	Low temperature

### 7.13.1.8 Grease compatibility

You can say that greases are compatible when the properties of the mixture are within the property ranges of the greases individually.

In general, greases with the same type of soap are compatible; however, depending on the proportion of the mixture, there might be incompatibility. Therefore, it is not recommended to mix different types of grease without consulting the grease supplier or WEG. Some thickeners and basic oils cannot be mixed, because they do not form a homogeneous mixture. In this case, one cannot rule the possibility of hardening or softening of the grease, or reduction of the dropping point of the resulting mixture.



### ATTENTION

Greases with different types of base must never be mixed.  
For example: Lithium-based greases must never be mixed with sodium or calcium-based greases.

### 7.13.1.9 Bearing disassembly

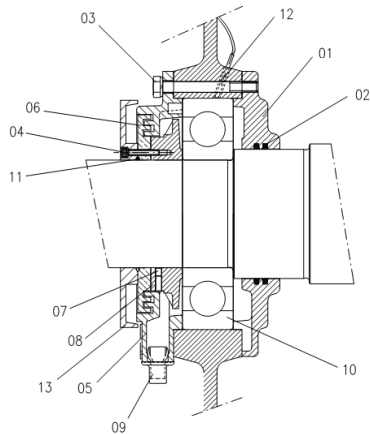


Figure 7.5: Parts of the grease-lubricated rolling bearing

#### Figure 7.5 legend:

1. Inner bearing cap
2. White felt
3. Bearing cap fastening screw
4. Disc fastening screw
5. Outer bearing cap
6. Labyrinth taconite seal
7. Grease flinger fastening screw
8. Grease flinger
9. Grease collecting drawer
10. Rolling bearing
11. Grease nipple
12. Thermal protector
13. External closing disc

#### Before disassembling:

- Remove the extension tubes from the grease inlet and outlet;
- Thoroughly clean the external part of the bearing;
- Remove the grounding brush (if any);
- Remove the temperature sensors from the bearing

#### Disassembly

In order to disassemble the bearing, proceed according to the directions below:

1. Remove the screws (4) that fix the closing disc (13);
2. Remove the labyrinth taconite seal (6);
3. Remove the screws (3) from the bearing caps (1 and 5);
4. Remove the outer bearing cap (5);
5. Remove the screw (7) that fixes the grease flinger (8);
6. Remove the grease flinger (8);
7. Remove the D-end shield;
8. Remove the rolling bearing (10);
9. Remove the inner bearing cap (1), if necessary.



#### ATTENTION

- During the bearing disassembly, it is necessary to be careful not to damage the balls, rollers or shaft surface;
- Keep the disassembled parts in a safe and clean place.

### 7.13.1.10 Bearing assembly

- Clean the bearings completely and inspect the disassembled parts and the inside of the bearing caps;
- Make sure the rolling bearing, shaft and bearing cap surfaces are perfectly smooth;

- Fill up to  $\frac{3}{4}$  of the inner and outer bearing cap deposits with the recommended grease (Figure 7.6) and lubricate the rolling bearing with enough grease before assembling it;
- Before assembling the rolling bearing on the shaft, heat it up to a temperature between 50 °C and 100 °C;
- For the complete assembly of the bearing, follow the disassembly instructions in the reverse order.
- The efficiency of sealing against taconita will be given by the filling of grease between the protrusions of the labyrinth seal and outer ring (if any)



Figure 7.6: Outer bearing cap

### 7.13.2 Oil-lubricated rolling bearing

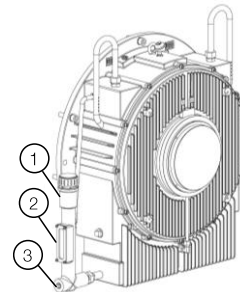


Figure 7.7: Oil-lubricated rolling bearing

#### Figure 7.7 legend:

1. Oil inlet
2. Oil sight glass
3. Oil outlet

### 7.13.2.1 Lubrication instructions

**Oil drainage:** When it is necessary to change the bearing oil, remove the oil outlet plug (3) and drain the oil completely.

#### To fill the bearing with oil:

- Close the oil outlet with the plug (3);
- Remove the plug from the oil inlet or from the filter (1);
- Fill it with the specified oil up to the level indicated in the oil sight glass.



#### NOTES

1. All threaded holes that are not used must be closed with plugs and no fitting may present leaks;
2. The oil level is reached when the lubricant can be seen approximately in the middle of the sight glass;
3. The use of a larger amount of oil will not damage the bearing; but it can cause leaks through the shaft seals;
4. Never use hydraulic oil or mix it with the bearing lubricant oil.

### 7.13.2.2 Oil type

The type and quantity of **lubricant oil** to be used are specified on the nameplate affixed to the motor.

### 7.13.2.3 Oil change

The bearing oil change must be done according to the intervals, which depend on the bearing operating temperature, shown in Table 7.6:

Table 7.6: Oil change intervals

Bearing operating temperature	Bearing oil change intervals
Below 75 °C	20,000 hours
Between 75 and 80 °C	16,000 hours
Between 80 and 85 °C	12,000 hours
Between 85 and 90 °C	8,000 hours
Between 90 and 95 °C	6,000 hours
Between 95 and 100 °C	4,000 hours

The lifespan of the bearings depends on their operating conditions, on the motor operating conditions and on the maintenance procedures.

Proceed according to the following directions:

- The oil selected for the application must have the proper viscosity for the bearing operating temperature. The type of oil recommended by WEG already considers these criteria;
- Insufficient quantity of oil may damage the bearing;
- The minimum recommended oil level is reached when the lubricant can be seen in the lower part of the oil sight glass with the motor stopped.



#### ATTENTION

The oil level must be inspected daily and must remain in the middle of the oil sight glass.

### 7.13.2.4 Bearing operation

**The system starts, as well as the first hours of operation, must be monitored carefully.**

Before starting, check:

- If the used oil complies with the specification on the nameplate;
- The lubricant characteristics;
- The oil level;
- The alarm and trip temperatures set for the bearing.

During the first start, it is necessary to stay alert for unusual vibrations or noises. If the bearing does not operate in a silent and smooth way, the motor must be shut down immediately.

The motor must operate for some hours until the bearing temperatures stabilize. In case of overheating of the bearings, the motor must be shut down for inspection of the bearings and temperature sensors.

Check if there is no oil leak through the plugs, gaskets or shaft end.

### 7.13.2.5 Bearing disassembly

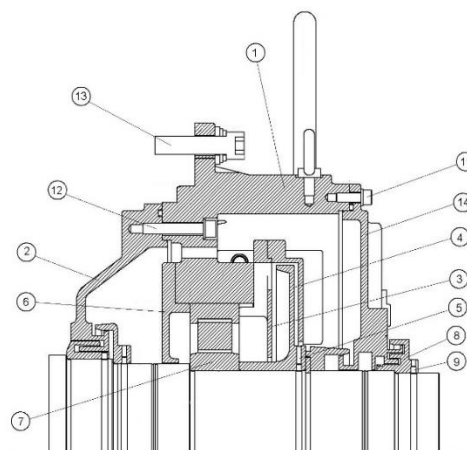


Figure 7.8: Parts of the oil-lubricated bearing

#### Figure 7.8 legend:

1. Outer oil tank
2. Inner oil tank
3. Outer bearing cap
4. Oil flinger
5. Screw
6. Inner bearing cap
7. Rolling bearing
8. Labyrinth taconite seal
9. Screw
10. Breather.
11. Outer tank fastening screw
12. Inner tank fastening screw
13. End shield fastening screw
14. Bearing protection cover

#### Before disassembling:

- Clean the whole bearing externally;
- Remove the oil completely from the bearing;
- Remove the temperature sensor (10) from the bearing;
- Remove the grounding brush (if any);
- Provide a support for the shaft in order to hold the rotor during the disassembly.

#### Bearing disassembly:

In order to disassemble the bearing, proceed according to the following guidelines:

1. Remove the screw (9) that fastens the labyrinth taconite seal (8);
2. Remove the labyrinth taconite seal (8);
3. Remove the screws (11) that fasten the bearing protection cover (14);
4. Remove the protection cover (14);
5. Remove the screws (5) that fasten the oil flinger (4) and remove it;
6. Remove the screws (11) of outer bearing cap(3);
7. Remove the outer bearing cap (3);
8. Loosen the screws (12 and 13);
9. Remove the outer oil tank (1);
10. Remove the rolling bearing (7);
11. If complete disassembly of the bearing is necessary, remove the inner bearing cap (6) and the inner oil tank (2).



#### ATTENTION

- During the bearing disassembly, it is necessary to be careful not to damage the balls, rollers or shaft surface;
- Keep the disassembled parts in a safe and clean place.



### 7.13.2.6 Bearing assembly

- Clean the rolling bearing and the oil tanks thoroughly and inspect all the parts before the bearing assembly.
- Make sure the rolling bearing contact surfaces are smooth and free of signs of scratches or corrosion;
- Before mounting the rolling bearing on the shaft, heat it up to a temperature between 50 to 100 °C;
- For the complete assembly of the bearing, follow the disassembly instructions in the reverse order.



#### ATTENTION

During the bearing assembly, apply sealant (e.g. **Curil T**) in order to seal the surfaces of the oil tank.

### 7.13.3 Rolling bearing replacement

The disassembly of rolling bearings must be done with an appropriate tool (rolling bearing puller). The arms of the puller must be placed on the lateral surface of the bearing inner ring to be disassembled or on an adjacent part.

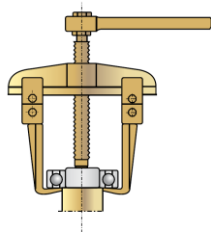


Figure 7.9: Tool for rolling bearing extraction

### 7.13.4 Sleeve bearings

#### 7.13.4.1 Bearing data

Dry sump bearings or those that use two oil outlets per bearing do not have an oil level sight glass. It is therefore not necessary to check the oil level. The characteristic data, such as oil flow, quantity and type, are indicated on the bearing nameplate and must be strictly observed; otherwise, overheating and damages to the bearings may occur. The hydraulic installation (for bearings with forced lubrication) and the oil supply for the motor bearings are responsibilities of the user.

#### 7.13.4.2 Bearing installation and operation

For information on the bill of materials, assembly and disassembly instructions, and maintenance details, refer to the specific installation and operation manual of the bearings.

#### 7.13.4.3 Cooling by water circulation

The sleeve bearings with cooling by water circulation have a serpentine inside the oil tank through which the water circulates. In order to assure an efficient bearing cooling, the circulating water must have at the bearing inlet a temperature lower or equal to the ambient, so that the cooling takes place. The water pressure must be 0.1 bar and the flow equal to 0.7 l/s. The pH must be neutral.



#### NOTE

Under no circumstances can water leak into the oil tank, because this will contaminate the lubricant.

### 7.13.4.4 Oil change

#### Self-lubricated bearings

The bearing oil change must be done according to the intervals, which depend on the bearing operating temperatures, shown in Table 7.7:

Table 7.7: Oil change intervals

Bearing operating temperature	Bearing oil change intervals
Below 75 °C	20,000 hours
Between 75 and 80 °C	16,000 hours
Between 80 and 85 °C	12,000 hours
Between 85 and 90 °C	8,000 hours
Between 90 and 95 °C	6,000 hours
Between 95 and 100 °C	4,000 hours

#### Bearings with external oil circulation

The oil of the bearings must be changed every 20,000 hours of operation or whenever the lubricant presents modifications in its characteristics. The oil viscosity and pH must be checked periodically.



#### NOTE

The oil level must be inspected daily, and it must remain in the middle of the oil sight glass.

The bearings must be lubricated with the specified oil, respecting the flow rate informed on their nameplate; All threaded holes that are not used must be closed with plugs and no fitting may present leaks. The oil level is reached when the lubricant can be seen approximately in the middle of the sight glass. The use of a larger amount of oil will not damage the bearing, but it can cause leaks through the shaft seals. The oil level must be within a specified range, as indicated by the sight glass. The minimum oil level is one-fourth of the distance from the bottom of the sight glass, and the maximum oil level is three-fourths of the distance from the top of the sight glass. If the equipment does not have oil outlet pipes, contact WEG for guidance on how to ensure the proper oil level at the outlet.



#### ATTENTION

The care with the lubrication will determine the useful life of the bearings and the safety in the motor operation. Therefore, the following recommendations must be observed:

- The selected lubricant oil must be the one with proper viscosity for the operating temperature of the bearings; That must be observed at every oil change or during periodical maintenances;
- Never use or mix hydraulic oil with the lubricant oil of the bearings;
- Lack of lubricant, due to incomplete filling or non-monitoring of the level, can damage the bearing shells;
- The minimum oil level is reached when the lubricant can be seen in the lower part of the sight glass with the motor stopped.

#### 7.13.4.5 Sealing

Make visual inspections of the sealing, making sure that the dragging marks of the seal on the shaft do not compromise its integrity, checking for cracks and broken parts. Cracked or broken parts must be replaced.

In case of bearing maintenance, in order to assemble the seal, it is necessary to carefully clean the seal contact surfaces and its enclosure and cover the sealing with a non-hardening component (i.e. **Curil T**). The two halves of the labyrinth taconite seal must be joined by a garter spring.

The drain holes located in the lower half of the seal must be cleaned and unobstructed.

Improper installation can damage the sealing and cause oil leakage.



#### ATTENTION

For further information about the dismounting and mounting of sleeve bearing seals, refer to the specific manual of this equipment.

#### 7.13.4.6 Sleeve bearing operation

**The system start, as well as the first hours of operation, must be monitored carefully.**

Before starting, check:

- If the oil inlet and outlet tubes (if any) are, clean.  
Clean the tubes by pickling, if necessary;
- If the used oil complies with the specification on the nameplate;
- The lubricant characteristics;
- The oil level;
- The alarm and trip temperatures set for the bearing.

During the first start, it is necessary to stay alert for unusual vibrations or noises. If the bearing does not operate in a silent and smooth way, the motor must be shut down immediately.

The motor must operate for several hours until the bearing temperatures stabilize. In case of overheating of the bearings, the motor must be shut down for inspection of the bearings and temperature sensors.

Check if there is no oil leak through the plugs, gaskets or shaft end.

#### 7.13.4.7 Sleeve bearing maintenance

The sleeve bearing maintenance includes:

- Periodic checking of the oil level and its lubricating conditions;
- Checking the bearing noise and vibration levels;
- Monitoring of the operating temperatures and retightening of the fastening and mounting screws;
- In order to facilitate the heat exchange with the environment, the frame must be kept clean, without external dust or oil accumulation;
- The NDE bearing is electrically insulated. The spherical seat surfaces of the bearing shell on the frame are covered with insulating material. Never remove this cover;
- The anti-rotation pin is also insulated, and the seals are made of non-conducting material;
- Temperature control devices that are in contact with the bearing shell must also be properly insulated.

#### 7.13.4.8 Bearing disassembly and assembly

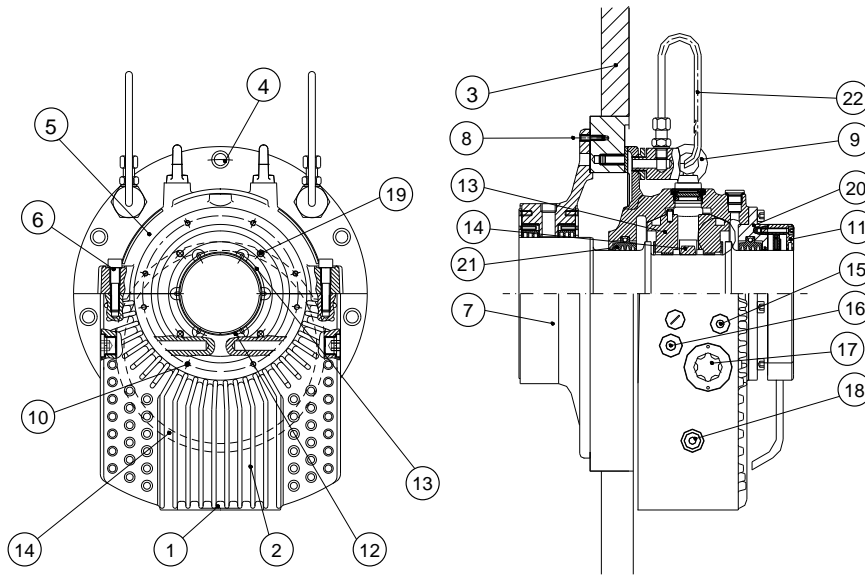


Figure 7.10: Parts of the sleeve bearing

##### Figure 7.10 legend:

1. Drain plug
2. Bearing housing
3. Motor frame
4. Fastening screws
5. Bearing housing cap
6. Split bearing cap screws
7. Machine seal
8. Machine seal screws
9. Eyebolt
10. Outer cover screw
11. Outer cover
12. Lower bearing shell
13. Upper bearing shell
14. Loose oil ring
15. Oil inlet
16. Temperature sensor fitting
17. Oil level sight glass or oil outlet for lubrication
18. Tube plug
19. Outer protection screws
20. Labyrinth taconite seal housing
21. Labyrinth taconite seal
22. Breather pipe

##### Disassembly

In order to disassemble the bearing and get access to the bearing shells, as well as to other components, proceed carefully as the following guidelines.

Keep all parts in a safe place (Figure 7.10).

##### Drive end:

- Clean the outside of the housing thoroughly. Loosen and remove the oil drain plug (1) located in the lower part of the housing, draining all the lubricant;
- Remove the screws (4) that fasten the upper half of the housing (5) to the motor (3);
- Remove the bolts (6) that join the halves of the housing (2 and 5);
- Use the lifting lugs (9) to lift the upper half of the housing (9), totally disassembling it from the lower halves of the outer sealing (11), from the labyrinth taconite seals, from the labyrinth taconite seal housings (20) and from the bearing shell (12);
- Proceed the disassembling of the upper half of the housing on a bench. Loosen the screws (19) and remove the upper half of the outer protection. Remove the screws (10), and undock the upper half of the labyrinth taconite seal housing (20);

- Undock and remove the upper half of the bearing shell (13);
- Remove the screws that join the two halves of the loose oil ring (14), and carefully separate and remove them;
- Remove the garter springs from the labyrinth taconite seals and remove the upper half of each seal. Rotate the lower halves of the seals out of their housing and remove them;
- Disconnect and remove the temperature sensor installed in the lower half of the bearing shell;
- Using a hoist or jack, lift the shaft some millimeters so that the lower half of the bearing shell can be turned out of its seat. To do this, it is necessary to loosen the screws 4 and 6 of the other half of the bearing;
- Carefully rotate the lower half of the bearing shell over the shaft and remove it;
- Remove the screws (19) and remove the lower half of the outer protection (11);
- Remove the screws (10) and the lower half of the housing of the labyrinth taconite seal (20);
- Remove the screws (4) and remove the lower half of the housing (2);
- Remove the screws (8) and remove the machine seal (7). Clean and inspect thoroughly the removed parts and inside of the housing.



##### NOTE

Tightening torque of the bearing fastening bolts to the motor = 10 Kgfm.

##### Non-drive end:

- Clean the outside of the housing thoroughly. Loosen and remove the oil drain plug (1) located in the lower part of the housing, draining all the lubricant;
- Loosen the screws (19) and remove the bearing cap (11);
- Loosen the screws (4) that fasten the upper half of the housing (5) to the motor (3). Remove the screws (6) that join the split faces of the bearing housing (2 and 5);
- Use the lifting lugs (9) to lift the upper half of the housing (5), undocking it thoroughly from the lower halves of the housing (2), labyrinth taconite seal and bearing shell (12);



- Undock and remove the upper half of the bearing shell (13);
- Remove the screws that join the two halves of the loose oil ring (14) and carefully separate and remove them;
- Remove the garter spring from the labyrinth taconite seal and remove the upper half of the seal. Rotate the lower half of the taconite seal out of its housing and remove it;
- Disconnect and remove the temperature sensor installed in the lower half of the bearing shell;
- Using a hoist or jack, lift the shaft some millimeters so that the lower half of the bearing shell can be turned out of its seat;
- Carefully rotate the lower half of the bearing shell (12) over the shaft and remove it;
- Remove the screws (4) and remove the lower half of the housing (2);
- Undock the screws (8) and the machine seal (7);
- Clean and inspect thoroughly the removed parts and the inside of the housing;



#### NOTE

Tightening torque of the bearing fastening bolts to the motor = 10 Kgfm.

#### Assembly

- Check the fitting surfaces of the flange, making sure that they are clean, flat and free of burrs;
- Check if the shaft dimensions are within the tolerances specified by the manufacturer and if the roughness complies with the requirements ( $< 0.4 \mu\text{m}$ );
- Remove the upper half of the housing (2) and the bearing shells (12 and 13), check if there were any damages during transportation and clean the contact surfaces thoroughly;
- Lift the shaft some millimeters, fit the flange of the lower half of the bearing into the machined recess on the machine end shield, and screw it in this position;
- Apply oil to the spherical seat of the frame and to the shaft. Put the lower bearing shell (12) on the shaft and rotate it to its position, taking care not to damage the axial positioning surfaces. After carefully aligning the faces of the lower half of the bearing shell and the housing, slowly lower the shaft down to its operating position. With a hammer, gently hit the housing for the bearing shell to position properly in relation to its seat and the shaft. This procedure generates a high frequency vibration that decreases the static friction between the bearing shell and the housing, and facilitates its correct alignment;
- The bearing self-alignment capacity is intended to compensate only the regular deflection of the shaft during the assembly. Next, install the loose oil ring, which must be done very carefully, since the proper bearing operation depends on the lubrication supplied by the ring. The screws must be slightly tightened and any burr carefully removed in order to provide a smooth and uniform operation of the ring. In an occasional maintenance, be careful not to change the geometry of the ring;
- The lower and upper halves of the bearing shell have identification numbers or marks to guide their positioning. Position the upper half of the bearing shell by aligning its marking with the corresponding marking on the lower half. Incorrect mountings may cause serious damages to the bearing shells;
- Check if the loose oil ring turns freely on the shaft. With the lower half of the bearing shell in place, install the seal on the bearing flanged side (see section 7.13.4.5).

After covering the split faces of the housing with a non-hardening sealing component, mount the upper part of the housing (5), taking care that the gasket seals stay perfectly

adjusted to their fittings. Also make sure that the anti-rotation pin is fitted without any contact with the corresponding hole in the bearing shell.

### 7.13.5 Bearing protection

#### 7.13.5.1 Protection settings



#### ATTENTION

The following temperatures must be set on the bearing protection system:  
Alarm 110 °C – Trip 120 °C  
The alarm temperature must be set 10 °C above the operating temperature, not exceeding the limit of 110 °C.

#### 7.13.5.2 Disassembly/assembly of the sleeve bearing temperature sensors

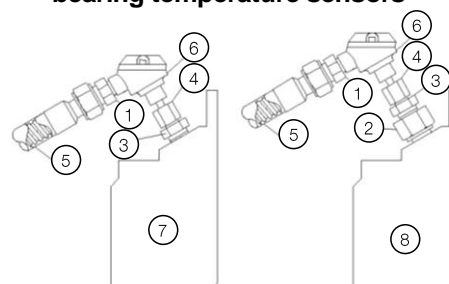


Figure 7.11: Pt100 on the bearings

#### Figure 7.11 legend:

1. Reduction nipple
2. Insulating adapter
3. Locknut
4. Bulb
5. Flexible metal tube
6. Pt-100 temperature sensor
7. Non-insulated bearing
8. Insulated bearing

#### Disassembly instructions:

If it is necessary to remove the Pt100 for bearing maintenance, proceed according to the following instructions:

- Remove the Pt100 carefully, locking the locknut (3), and unscrewing just the Pt100 from the bulb (4);
- Parts (2) and (3) must not be disassembled.

#### Assembly instructions:



#### ATTENTION

Before assembling the Pt100 on the bearing, check if it does not contain marks of knock or any other damage that may compromise its operation.

- Insert the Pt100 into the bearing;
- Restrain the locknut (3) with a wrench;
- Screw it in the bulb (4), adjusting it so that the tip of the Pt100 touches the outer surface of the bearing.



#### NOTES

- The assembly of the Pt100 on non-insulated bearings must be done directly on the bearing, without the insulating adapter (2);
- The tightening torque to assemble the Pt100 and the adapters must not exceed 10Nm.

## 7.14 MAINTENANCE OF THE BRUSH LIFTING SYSTEM

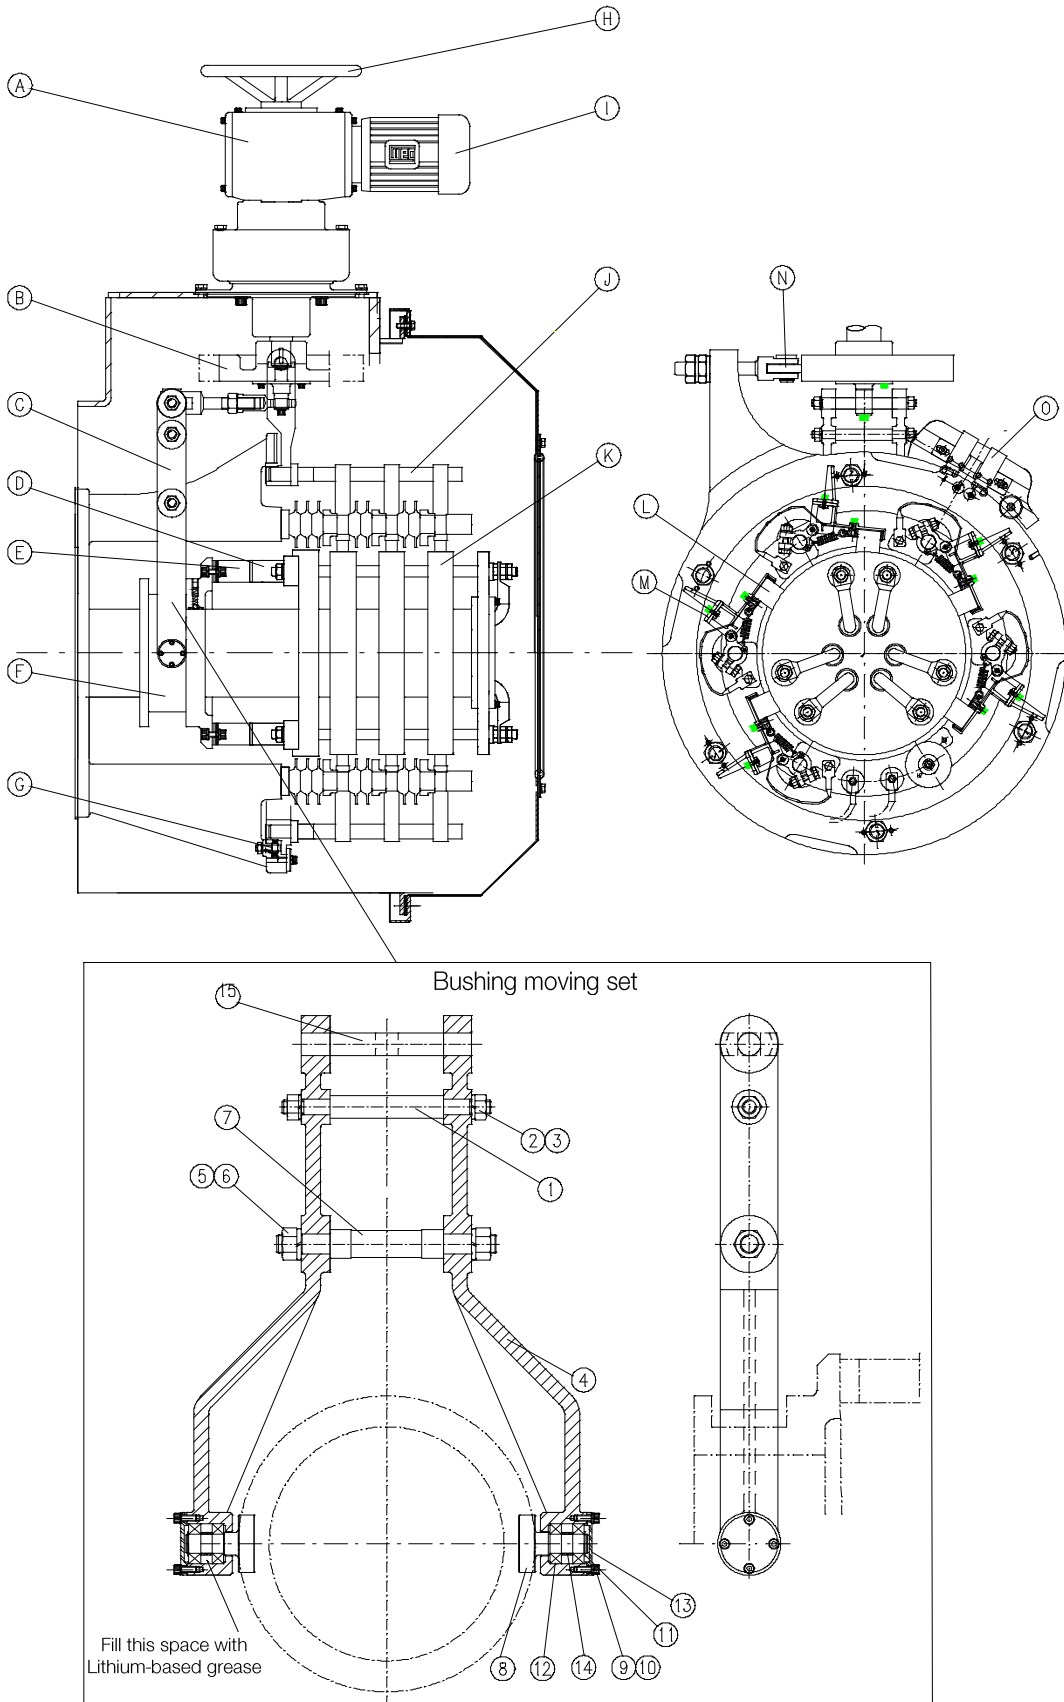


Figure 7.12: Brush lifting system

### 7.14.1 Parts list

- A) Electromechanical actuator
- B) Lifting disc
- C) Motion arm
- D) Female contact
- E) Male contact
- F) Short-circuit bushing
- G) Rolling bearing 6200 2RS1 (3 parts)
- H) Handwheel
- I) Electromechanical actuator driving motor
- J) Lifting pin
- K) Slip rings
- L) Brushes
- M) Brush holder
- N) Rolling bearing 6305 2RS1
- O) Signaling limit switches

- 1. Upper pin of the arm
- 2. M12 nut
- 3. B12 lock washer
- 4. Bushing motion arm
- 5. B16 lock washer
- 6. M16 nut
- 7. Swiveling bracket pin
- 8. Roller
- 9. B5 lock washer
- 10. M5 x15 socket screw
- 11. Retaining ring
- 12. Rolling bearing 6003 Z (4 parts)
- 13. Bearing cover of the roller
- 14. Spacer bushing
- 15. Swiveling bracket pin

### 7.14.2 Preventive maintenance procedures

#### Daily:

- Inspect for noise and vibration.

#### Monthly:

- Inspect the operation of the brush lifting system;
- Test the motorized operation for lifting and lowering the brushes;
- Test the manual operation for lifting and lowering the brushes;
- Make sure that the needle rollers (8) do not remain in contact with the short-circuit bushing (F) after the start;
- Inspect for noise and vibration;
- Check the condition of brushes, brush holder and slip rings.

#### Biannually:

- Clean the set, vacuuming the dirt from inside the compartment;
- Inspect the male and female short-circuit contacts (D and E) for possible wear, sparking marks, dirt or hot spots;
- Clean the contacts with a fine sandpaper and proper solvent;
- Inspect the slip rings (K);
- Inspect the brushes and the brush holder (L and M);
- Measure the insulation resistance of the slip rings and the brush holder;
- Retighten the connections (electrical and mechanical)
- Lubricate the mechanical parts (avoid grease excess).

#### Annually:

- Retighten the connections (electrical and mechanical)
- Check the conditions of the rolling bearings (12) of the roller that moves the short-circuit bushing and, if necessary, replace them;
- Check the condition of the rolling bearings (G) of the support disc for the lifting pins; if necessary, replace them;
- Check the condition of the rolling bearing (N) that is in contact with the lifting disc;
- Inspect and adjust the electromechanical actuator (clean, retighten, check the rolling bearings and mechanical parts).



#### ATTENTION

The rollers (8) must not remain in contact with the short-circuit bushing (F) after the starting operation has been completed.



#### NOTE

- After 6 months of operation, all parts with mechanical contacts must be lubricated;
- The brushes will last longer if the motor is not started frequently; however, they must be inspected periodically;
- Check the contact surface of the brushes with the slip rings, the mounting of the brushes in the brush holder, as well as the pressure of the brush holder springs.

### 7.14.3 Adjustment of the electromechanical actuator

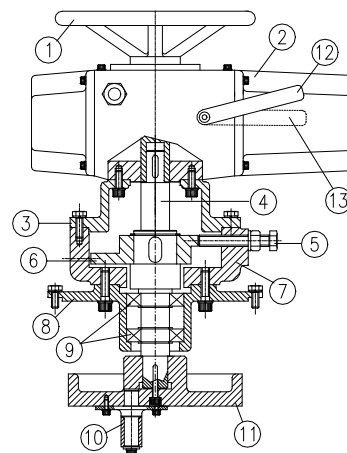


Figure 7.13: Parts of the electromechanical actuator

#### Figure 7.13 legend:

- 1. Handwheel
- 2. Electromechanical actuator
- 3. Locking device cover
- 4. Drive shaft
- 5. Set screw
- 6. Stop disc
- 7. Locking device frame
- 8. Driving set flange
- 9. Rolling bearing
- 10. Bushing
- 11. Lifting disc
- 12. Motor
- 13. Manual

### 7.14.3.1 Mechanical adjustment

The electromechanical actuator of the brush lifting system already comes adjusted from the factory. If it is necessary to make any new adjustment, proceed as follows:

1. Activate the manual system of the actuator using the selection lever;
2. Rotate the set using the handwheel up to the short-circuit position (brushes lifted) until the bushing moving rollers are centralized between the contact surfaces of the bushing, but not touching it;

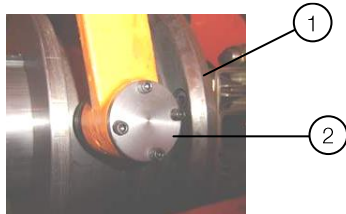


Figure 7.14: Positioning of the bushing and rollers

#### Figure 7.14 legend:

1. Bushing
2. Roller

3. Rotate the set screw until it touches the stop disc and lock it;
4. Rotate the lifting disc in the opposite direction up to the non-short-circuit position (brushes lowered);
5. Rotate the set screw of the opposite side until it touches the stop disc and lock it;

### 7.14.3.2 Electrical adjustment

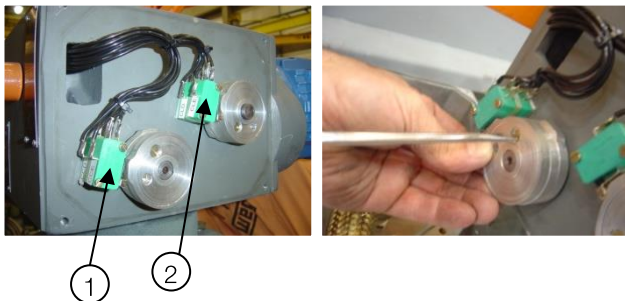


Figure 7.15: Limit switches of the electromechanical actuator

#### Figure 7.15 legend:

1. 6ZE and 5ZE limit switches
2. 2WE and 1WE limit switches

#### Required equipment:

- Screwdriver;
- Multimeter.

1. Adjust the **6ZE and 5ZE drive limit switches** located on the electromechanical actuator to actuate a little before the stop disc touches the set screws, thus shutting down the actuator motor;
2. Adjust the **2WE and 1WE torque limit switches** located on the electromechanical actuator to actuate a little after the actuation point of the positioning switches ( $\pm 2\text{mm}$ ) to shut down the actuator motor only when these fail.



#### ATTENTION

The 2ZE, 4ZE, 1ZE and 3ZE signaling limit switches located inside the brush compartment must be used only for signaling and not for activating the electromechanical actuator.

### 7.14.3.3 Slip rings short-circuit contacts

The short-circuit contacts alignment of the slip rings is essential for good motor performance.

The male and female contacts should be well aligned and respect the distances as shown in Table 7.8, Figure 7.16, Figure 7.17 and Figure 7.18.

The maximum permissible misalignment between the male and female contacts is 0.25mm.

Table 7.8: Distances between short-circuit contacts

A	Minimum: 5 mm/kV + motor axial clearance
B	2 mm – considering the motor in the magnetic center
C	2.5 mm

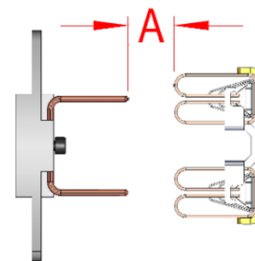


Figure 7.16: Open short-circuit contact

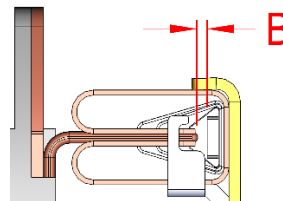


Figure 7.17: Closed short-circuit contact

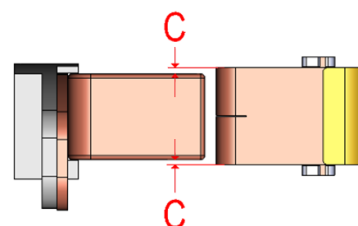


Figure 7.18: Lateral alignment of the male and female short-circuit contacts.



#### ATTENTION

After adjusting the male and female contacts, the bolts for fastening them must be locked with chemical lock. It is recommended that you remove one screw at a time to perform this procedure. Recommended chemical lock: Loctite 272.

## 8 MOTOR DISASSEMBLY AND ASSEMBLY



### ATTENTION

All the repair, disassembly and assembly services must be performed only by properly qualified and trained professionals; otherwise, equipment damage and personal injury may occur. If any further explanations are necessary, consult WEG.

The disassembly and assembly sequences depend on the motor model.

Always use proper tools and devices. Any damaged part (cracks, dents on machined parts, faulty threads) must be replaced, avoiding restorations.

### 8.1 QUALIFIED PROFESSIONAL



### EX

The repair services on motors applied in explosive atmospheres must be carried out only by qualified professionals authorized by WEG to perform such jobs.

### 8.2 DISASSEMBLY

The following precautions must be taken when disassembling the electric motor:

1. Always use proper tools and devices to disassemble the motor;
2. Before disassembling the motor, disconnect the cooling water and lubrication pipes (if any);
3. Disconnect the motor electrical connections and those of the accessories;
4. Remove the heat exchanger and the noise suppressor (if any);
5. Remove the bearing temperature sensors and the grounding brush;
6. In order to prevent damages to the rotor and coil heads, support the shaft on both drive and non-drive ends;
7. In order to disassemble the bearings, follow the procedures described in this manual;
8. The removal of the rotor from the motor must be done with a suitable device and with extreme care so that the rotor does not drag on the stator laminated core or coil heads, thus preventing damages.

### 8.3 ASSEMBLY

In order to assemble the motor, follow the disassembly procedures in the reverse order.

### 8.4 AIR-GAP MEASUREMENT

After disassembling and assembling the motor, it is necessary to measure the air gap in order to check the concentricity between rotor and stator.

Measure the air gap between the metal support of the shaft seal the motors, measure shaft at four shaft equidistant points (45°, 135°, 225° and 315°).

The difference between the air gap measurements at two diametrically opposed points should be less than 10% of the average air gap



### ATTENTION

The bearing can only be closed after completion and projected from the air gap.

For the single bearing:

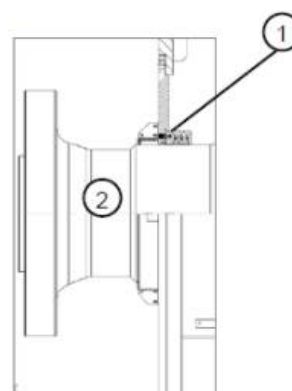


Figure 8.1: DE shaft seal

#### Figure 8.1 Legend:

1. DE shaft seal
2. Motor shaft

## 8.5 TIGHTENING TORQUE

The Table 8.1 and Table 8.2 shows the tightening torques of the screws recommended for assembling the motor.

Table 8.1: Screw tightening torque for metal/metal parts

Material / Resistance class		Carbon Steel / 8.8 or above		Stainless steel / A2 – 70 or above	
% Yield Strength		70%		70%	
Lubricant		Dry	Molycote 1000	Dry	Molycote 1000
Diam	Pitch (mm)	Screws tightening torque (Nm)			
M4	0,7	2,1	1,8	1,8	1,3
M5	0,8	4,2	3,6	3,6	2,7
M6	1	8	6	6,2	4,5
M8	1,25	19,5	15	15	11
M10	1,5	40	29	30	22
M12	1,75	68	51	52	38
M14	2	108	81	84	61
M16	2	168	126	130	94
M18	2,5	240	174	180	130
M20	2,5	340	245	255	184
M22	2,5	470	335	350	251
M24	3	590	424	440	318
M27	3	940	621	700	466
M30	3,5	1170	843	880	632
M33	3,5	1730	1147	1300	860
M36	4	2060	1473	1540	1105
M42	4,5	3300	2359	2470	1770
M48	5	5400	3543	4050	2657

Table 8.2: Screw tightening torque for metal/isolated parts

Material / Resistance class		Carbon Steel / 8.8 or above		Stainless steel / A2 – 70 or above	
% Yield Strength		40%		40%	
Lubricant		Dry	Molycote 1000	Dry	Molycote 1000
Diam	Pitch (mm)	Screws tightening torque (Nm)			
M4	0,7	1	1	1	1,3
M5	0,8	2	2	1,7	2,7
M6	1	4,4	3	3,4	4,5
M8	1,25	10,7	7,5	8,3	11
M10	1,5	21	15	16,5	22
M12	1,75	37	26	28	38
M14	2	60	42	46	61
M16	2	92	65	72	94
M18	2,5	132	90	100	130
M20	2,5	187	126	140	184
M22	2,5	260	172	190	251
M24	3	330	218	240	318
M27	3	510	320	390	466
M30	3,5	640	433	480	632
M33	3,5	950	590	710	860
M36	4	1130	758	840	1105
M42	4,5	1800	1213	1360	1770
M48	5	2970	1822	2230	2657



### NOTE

The resistance class is normally indicated on the head of the hex bolts.



## 8.6 SPARE PARTS

Table 8.3 shows the necessary spare parts, which must be kept in stock for the maintenance procedures recommended in the maintenance plan, and the optional spare parts, which can be requested to meet any replacement needs.

Table 8.3: Necessary and optional spare parts list

Spare parts		Motor model				
		MAA, MAP MAD, MAT	MAF	MAW	MAL, MAI	MAR
Temperature sensor for front and rear bearing		▲	▲	▲	▲	▲
Space heater		▲	▲	▲	▲	▲
Filter felt (if any)		▲	▲		▲	
Grounding Brush		▲	▲	▲	▲	▲
Set of brushes		▲	▲	▲	▲	▲
Brush holder set		▲	▲	▲	▲	▲
Set of springs for brush holder (if applicable)		▲	▲	▲	▲	▲
Front and rear bearing for the fan motor (if applicable)					▲	
Lubricant for bearings		▲	▲	▲	▲	▲
Set of collector rings		•	•	•	•	•
Vibration sensor for front and rear bearing (if applicable)		•	•	•	•	•
Vibration signal converter for front and rear bearing (if applicable)		•	•	•	•	•
Air temperature sensor (if applicable)		•	•	•	•	•
Water temperature sensor (if applicable)				•		
Set of water leakage sensor (if applicable)				•		
Repeater relay for water leak sensor (if applicable)				•		
Water regulating valve (if applicable)				•		
Motor for fan motor					•	
Rolling bearing (One piece for each bearing)	Bearing	▲	▲	▲	▲	▲
	Teflon seal	▲	▲	▲	▲	▲
	Internal bearing cap	•	•	•	•	•
	External bearing cap	•	•	•	•	•
	Grease valve	•	•	•	•	•
	Ring with labyrinth	•	•	•	•	•
	Cylindrical pressure spring	•	•	•	•	•
	Protective ring against water ingress	•	•	•	•	•
Sleeve bearing (One piece for each bearing)	Set of bearing shell	▲	▲	▲	▲	▲
	Floating labyrinth seal	▲	▲	▲	▲	▲
	Mechanical seal	▲	▲	▲	▲	▲
	Loose oil ring	•	•	•	•	•
	Oil regulating valve (if applicable)	•	•	•	•	•
Motorized brush holder	Set of bearings	▲	▲	▲	▲	▲
	Set of male and female contacts	▲	▲	▲	▲	▲
	Set of limit switches	•	•	•	•	•
	Electromechanical actuator with motor	•	•	•	•	•
▲ Required spare parts						
• Optional spare parts						



### NOTES

When placing an order for spare parts, inform the motor type and serial number, as specified on motor nameplate.  
Spare parts should be stored in a clean, dry, well-ventilated environment and, if possible, at a constant temperature.



## 8.7 ADDITIONAL INFORMATION

Necessary spare parts of the pressurization system (Ex"p" motors):

*Table 8.4: Optional spare parts*

Relief valve (RLV)
Filter kit for S0015/275 filter/regulator
Purge flow sensor
Minimum pressure sensor
Intermediate pressure sensor
CLAPS sensor
Pressure megger – air pressure (0-10 barg)
Miniature megger – logical pressure (0-4 barg)
IS battery - for electronic timer module



### EX

For correct and safe motor maintenance, it is recommended the use of new and genuine parts. It is not advisable to repair damaged or worn parts.

In order to install accessories (vibration sensors, thermometers, temperature sensors, pressure switches, etc.) on Ex "p" motors, make sure those devices are properly sealed, thus preventing pressure loss of the enclosure.

## 9 MAINTENANCE PLAN

The maintenance plan described in Table 9.1 is only referential, and the intervals between each maintenance intervention may vary according to the motor location and operating conditions.

For the associated equipment, such as the water supply unit or control and protection system, it is necessary to refer to their specific manuals.

Table 9.1: Maintenance plan

MOTOR PART	Weekly	Monthly	3 months	6 months	Annual	3 years	
<b>STATOR AND ROTOR WINDINGS</b>							
Visual inspection		x					
Measurement of insulation resistance					x		
Cleaning of the dirt built up on the coils (vacuum)		x					
Complete cleaning						x	
Inspection of the stator and slot wedges						x	
<b>BEARINGS</b>							
Verification of noise and temperature level	x						
Vibration control	x						
Verification of the oil level		x					
Verification of the oil characteristics					x		
Lubricant change							According to the period indicated on the bearing nameplate.
Cleaning and replacement if necessary						x	
<b>SLIP RINGS, BRUSHES AND BRUSH HOLDERS</b>							
Cleaning of the brushes compartment		x					
Cleaning of brushes and brush holder		x					
Verification of the brushes wear		x					
Replacement of the brushes set							Whenever necessary.
Cleaning of the air filter		x					
Verification of the contact area of the slip ring		x					
<b>AIR-WATER HEAT EXCHANGER</b>							
Inspection of the radiators.					x		
Cleaning of the radiators.					x		
Inversion of the water flow				x			
Inspection of the radiator sacrificial anodes (if any).			x				Increase the inspection frequency in case of excessive corrosion.
Replacement of the gaskets of the radiator heads.					x		
<b>AIR FILTER OF THE MOTOR</b>							
Inspection, cleaning and replacement, if necessary							Every 2 months.
<b>AIR FILTER OF THE BRUSHES COMPARTMENT</b>							
Inspection	x						
Replacement		x					
<b>AIR-AIR HEAT EXCHANGER</b>							
Cleaning of the ventilation ducts.					x		
Inspection of the ventilation (airflow).	x						
Inspection, cleaning and replacement of the filters							Whenever necessary.
<b>PROTECTION AND CONTROL EQUIPMENT</b>							
Recording of the values.	x						
Operation test.					x		
Disassembly and operation test.						x	
<b>COUPLING</b>							
Inspection of the alignment.			x				Check after the first week of operation.
Inspection of the fastening.			x				
<b>TERMINAL BOXES AND GROUNDING TERMINALS</b>							
Cleaning of the internal part of the terminal box					x		
Retightening of the screws			x				
<b>GROUNDING BRUSH</b>							
Verification of the brush wear		x					Whenever necessary.
Replacement of the brush							
<b>WHOLE MOTOR</b>							
Inspection of noise and vibration	x						
Drainage of condensed water (if any)			x				
Retightening of the screws			x				
Disassembly of the motor and inspection of all parts						x	



#### NOTES

- The replacement of the bearing lubricant must be performed according to the period indicated on the bearing nameplate;
  - If there is excessive corrosion of the sacrificial anodes, the inspection frequency must be increased;
  - Inspection of the brush removal system must be performed according to item 7.14.2 of this manual;
- After the machine first week operation, check the alignment and coupling fixing.

INSPECTIONS EVERY 2 YEARS (ACCORDING TO NBR IEC60079-17 STANDARD)		Ex “e”			Ex “ec”			Ex “t”		
Ex MOTORS		Degree of inspection <sup>1</sup>								
CHECK WHETHER:		D	A	V	D	A	V	D	A	V
A	EQUIPMENT									
1	The equipment is appropriate for the requirements of EPL / Installation location zone	x	x	x	x	x	x	x	x	x
2	The equipment group is correct	x	x		x	x		x	x	
3	The equipment temperature class is correct (only for gas)	x	x		x	x				
4	The maximum surface temperature of the equipment is correct							x	x	
5	The equipment protection degree (IP code) is appropriate for the protection level /group/conductivity	x	x	x	x	x	x	x	x	x
6	The identification of the equipment circuit is correct	x			x			x		
7	The identification of the equipment circuit is available	x	x	x	x	x	x	x	x	x
8	The enclosure, the glass parts and seals, and/or glass/metal sealing compounds are satisfactory	x	x	x	x	x	x	x	x	x
9	There are no damages or unauthorized modifications	x			x			x		
10	There are no evidence of unauthorized modifications		x	x		x	x		x	x
11	The screws, cable inlet devices (direct or indirect) and sealing plugs are of the correct type and completely tightened									
	▪ Physical verification	x	x		x	x		x	x	
	▪ Visual verification			x			x			x
14	The condition of the enclosure gaskets is satisfactory	x			x			x		
15	There is no evidence of water or dust ingress into the enclosure, according to the IP degree of protection	x			x			x		
17	The electrical connections are tightened	x			x			x		
18	Unused terminals are fastened	x			x					
19	The encapsulated switching devices and hermetically sealed devices are not damaged				x					
20	Encapsulated components are not damaged	x			x					
21	Explosion-proof components are not damaged	x			x					
25	Breathers and drains are satisfactory	x	x		x	x				
29	Motor fans have proper clearance from the enclosure and/or covers; the cooling system is not damaged; the motor foundation do not have signs of cracks	x	x	x	x	x	x	x	x	x
30	The cooling air circulation is not obstructed	x	x	x	x	x	x	x	x	x
31	The insulation resistance (RI) of the motor windings is satisfactory	x			x			x		
B	INSTALLATION – GENERAL REQUIREMENTS									
1	The type of cable is appropriate	x			x			x		
2	There are no evident damages to the cables	x	x	x	x	x	x	x	x	x
3	The sealing of the bundles, ducts and/or conduits is satisfactory	x	x	x	x	x	x	x	x	x
5	The integrity of the conduit system and the interfaces with the mixed systems are maintained	x			x			x		
6	The grounding connections, including any supplementary grounding connections are satisfactory (e.g., the connections are tightened and the conductors have a proper gauge)									
	▪ Physical inspection	x			x			x		
	▪ Visual inspection		x	x		x	x		x	x
7	The impedance of the fault circuit (TN system) or the grounding resistance (IT system) is satisfactory	x			x			x		
8	The automatic electrical protection devices operate within the permitted limits	x			x			x		
9	The automatic electrical protection devices are correctly calibrated (no possibility of auto- reset)	x			x			x		
10	The specific conditions of safe use (if any) are meet	x			x			x		
11	The ends of cables that are not used have proper finishing	x			x			x		
13	The installation of converters with variable voltage/frequency is in accordance with the documentation	x	x		x	x		x	x	
B	INSTALLATION – HEATING SYSTEM									
14	The temperature sensors are operating according to the manufacturer documentation	x						x		
15	The safety trip devices operate according to the manufacturer documentation	x						x		
16	The setting of the safety trip device is locked	x	x							
17	The reset of the safety trip device of a heating system is only possible by means of a tool	x	x							
18	The automatic reset is not possible	x	x							
19	The reset of a safety trip device under fault conditions is avoided	x								
20	The safety trip device is independent from the control system	x								
21	The level switch is installed and properly adjusted, if required	x								
22	The flow switch is installed and properly adjusted, if required	x								
	INSTALLATION – MOTORS									
23	The protection devices operate within the permitted limits of t <sub>E</sub> or t <sub>A</sub>	x								
C	ENVIRONMENT									
1	The equipment is properly protected against corrosion, bad weather, vibration and other adverse factors	x	x	x	x	x	x	x	x	x
2	There is no improper accumulation of dust or dirt	x	x	x	x	x	x	x	x	x
3	The electrical insulation is clean and dry	x			x			x		
<sup>1</sup> Degree of inspection D = Detailed, A = Accurate, V = Visual										
<b>Note:</b> For items B7 and B8, the possibility of the flammable mixture presence in the surroundings of the equipment must be taken into account when using electrical testing equipment										

**INSPECTIONS EVERY 2 YEARS (ACCORDING TO NBR IEC60079-17 STANDARD)**  
**Ex "p" Motors**

CHECK WHETHER:		Degree of inspection <sup>1</sup>		
		D	A	V
<b>A</b>	<b>EQUIPMENT</b>			
1	The equipment is appropriate for the requirements of EPL / installation local zone	x	x	x
2	The equipment group is correct	x	x	
3	The equipment temperature class or the surface temperature is correct	x	x	
4	The identification of the equipment circuit is correct	x		
5	The identification of the equipment circuit is available	x	x	x
6	The enclosure, the glass parts and seals, and/or glass/metal sealing compounds are satisfactory	x	x	x
7	There are no unauthorized modifications	x		
8	There are no visible unauthorized modifications		x	x
<b>B</b>	<b>INSTALLATION</b>			
1	The type of cable is adequate	x		
2	There are no evident damages to the cables	x	x	x
3	The grounding connections, including any supplementary grounding connections, are satisfactory (e.g., the connections are tightened and the conductors have proper gauge)	x	x	x
	▪ Physical inspection			
	▪ Visual verification			
4	The impedance of the fault circuit (TN system) or the grounding resistance (IT system) is satisfactory	x		
5	The automatic electrical protection devices operate within the permitted limits	x		
6	The automatic electrical protection devices are correctly set	x		
7	The inlet temperature of the protection gas is below the maximum specification	x		
8	The ducts, pipes and enclosures are in good conditions	x	x	x
9	The protection gas is substantially free from contaminants	x	x	x
10	The pressure or flow of the protection gas is adequate	x	x	x
11	The indicators of pressure and/or flow, alarms and interlocks operate properly	x		
12	The conditions of the particle and spark barriers of the gas exhaust ducts, located in hazardous areas, are satisfactory	x		
13	The specific conditions of use (if any) are meet	x		
<b>C</b>	<b>ENVIRONMENT</b>			
1	The equipment is properly protected against corrosion, bad weather, vibration and other adverse factors	x	x	x
2	There is no improper accumulation of dust or dirt	x	x	x

<sup>1</sup> Degree of inspection D = Detailed, A = Accurate, V = Visual



**NOTE**

- Detailed inspection encompasses the aspects covered by the accurate inspection and, furthermore, it identifies defects (loose terminals, for example) which can only be detected by opening the enclosure, and by using, if necessary, testing equipment and tools;
- Accurate inspection encompasses the aspects covered by the visual inspection and, furthermore, it identifies defects (loose screws, for example) which can only be detected with the aid of access equipment, such as ladders and tools;
- Visual inspection identifies, without using access equipment or tools, defects that are evident, such as the absence of a screw.

**EVERY THREE YEARS (FULL INSPECTION)**

Whole motor	<ul style="list-style-type: none"> <li>▪ Disassembly of the whole motor</li> <li>▪ Verification of the parts</li> </ul>
Stator and rotor windings	<ul style="list-style-type: none"> <li>▪ Cleaning</li> <li>▪ Checking of the fastening of windings and wedges</li> <li>▪ Measurement of insulation resistance</li> </ul>
Rotor	<ul style="list-style-type: none"> <li>▪ Inspection of the shaft (wear, incrustations)</li> </ul>
Bearings	<ul style="list-style-type: none"> <li>▪ Cleaning of the bearings and their replacement, if necessary</li> <li>▪ Inspection of the bearing shell and its replacement, if necessary</li> <li>▪ Inspection of the shaft seat and its restoration, if necessary</li> </ul>
Terminal boxes, grounding	<ul style="list-style-type: none"> <li>▪ Internal cleaning</li> <li>▪ Retightening of the screws</li> </ul>
Coupling	<ul style="list-style-type: none"> <li>▪ Check of the alignment and retightening of the screws</li> </ul>
Monitoring, protection and control devices	<ul style="list-style-type: none"> <li>▪ If possible, disassemble and test their operating capacity</li> </ul>
Filter	<ul style="list-style-type: none"> <li>▪ Cleaning</li> </ul>
Air-water heat exchanger	<ul style="list-style-type: none"> <li>▪ Inspection and cleaning of the radiators</li> </ul>
Air-air heat exchanger	<ul style="list-style-type: none"> <li>▪ Cleaning of the exchanger ducts</li> </ul>

## 10 ABNORMALITIES, CAUSES AND SOLUTIONS



### NOTE

The instructions of Table 10.1 present only a basic list of abnormalities, causes and corrective actions. In case of questions, consult WEG.

Table 10.1: Basic list of abnormalities, causes and corrective actions

ABNORMALITY	POSSIBLE CAUSES	CORRECTION
Neither coupled nor uncoupled does the motor start	▪ At least two power cables are interrupted, without voltage	▪ Check the control panel, power cables, terminals, brush seating
	▪ Rotor is locked	▪ Unlock the rotor
	▪ Problems in the brushes	▪ Brushes may be worn, dirty or seated incorrectly
	▪ Damaged bearing	▪ Replace the bearing
Motor starts with no load, but fails when load is applied. It starts very slowly and does not reach the rated speed	▪ Load torque is too high during the start	▪ Do not apply load to the driven machine during the start
	▪ Power supply voltage is too low	▪ Measure the power supply voltage, and set it to the correct value
	▪ Very high voltage drop in the power cables	▪ Check the sizing of the installation (transformer, cable cross section, relays, circuit breakers, etc.)
	▪ Rotor with faulted or interrupted bars	▪ Check and repair the rotor winding; test the short-circuit device (rings)
	▪ A power cable was interrupted after the start	▪ Check the power cables
The stator current oscillates under load with double the slip frequency; the motor presents a humming noise during starting	▪ Rotor winding is interrupted	▪ Check and repair the rotor winding and the short-circuit device
	▪ Problems in the brushes	▪ Brushes may be worn, dirty or seated incorrectly
Very high no load current	▪ Power supply voltage is too high	▪ Measure the power supply voltage and set it to the correct value
Hot spots in the stator winding	▪ Short-circuit between turns	▪ Rewind
	▪ Interruption of the parallel wires or phases of the stator winding	
	▪ Faulty connection	▪ Redo the connection
Hot spots in the rotor	▪ Interruptions in the rotor winding	▪ Repair the rotor winding or replace it
Abnormal noise during operation with load	▪ Mechanical causes	▪ The noise normally decreases when the speed reduces. See also: <b>"noisy operation when uncoupled"</b>
	▪ Electrical causes	▪ The noise disappears when the motor is switched off. Consult WEG
When coupled, there is noise; when uncoupled, the noise disappears	▪ Defect in the coupling parts or in the driven machine	▪ Check the power transmission, the coupling and the alignment
	▪ Defect in the gear coupling	▪ Align the drive set
	▪ Unaligned/unleveled base	▪ Align/level the motor and the driven machine
	▪ Faulty balance of the components or of the driven machine	▪ Perform new balancing
	▪ Defective coupling	▪ Repair or replace the coupling
	▪ Wrong rotation direction of the motor	▪ Invert the connection of two phases

ABNORMALITY	POSSIBLE CAUSES	CORRECTION
Stator winding becomes very hot under load	▪ Fans with inverted rotation direction	▪ Correct the rotation direction of the fans
	▪ Insufficient cooling due to dirty air channels	▪ Open and clean the air passage channels
	▪ Overload	▪ Measure the stator current ▪ Reduce the load ▪ Analyze the motor application
	▪ High number of starts or moment of inertia too high	▪ Reduce the number of starts
	▪ Voltage too high, therefore, iron losses increase	▪ Do not exceed 110% of the rated voltage, except when otherwise specified on the nameplate
	▪ Voltage too low, therefore, the current is very high	▪ Check the supply voltage and the voltage drop on the motor
	▪ Interruption in a power cable or in a winding phase	▪ Measure the current in all the phases and, if necessary, correct it
	▪ Rotor drags against the stator	▪ Check the air-gap, operating conditions (vibration etc.), bearing conditions
	▪ The operating condition does not correspond to the nameplate data	▪ Keep the operating condition according to the nameplate or reduce the load
	▪ Unbalance in the power supply (blown fuse, wrong command)	▪ Check if there is voltage unbalance or operation with two phases and correct it
	▪ Dirty windings	▪ Clean
	▪ Air ducts clogged	
	▪ Dirty air filter	▪ Clean the filter element
	▪ Rotation direction is not compatible with the fan used	▪ Check the fan regarding to the motor rotation direction
Noisy operation when uncoupled	▪ Unbalance	▪ Noise remains during deceleration after disconnecting the voltage ▪ Perform new balancing
	▪ Interruption in one phase of the stator winding	▪ Measure the current of all connecting cables
	▪ Fastening screws are loose	▪ Retighten and lock the screws
	▪ The rotor balancing conditions become worse after the assembly of the coupling	▪ Balance the coupling
	▪ Resonance in the foundation	▪ Adjust the foundation
	▪ Motor frame is deformed	▪ Check flatness of the base
	▪ Bent shaft	▪ The shaft may be warped ▪ Check the rotor balancing and eccentricity
	▪ Air-gap is not even	▪ Check the shaft warping or rolling bearing wear
Motor operating at low speed with external resistance OFF	▪ Conductors incorrectly sized between the motor and the rheostat	▪ Resize the conductors
	▪ Circuit open in the rotor winding (including connections with rheostat)	▪ Test the continuity
	▪ Dirt between brush and slip ring	▪ Clean the slip rings and the insulating set
	▪ Brush stuck in the compartment	▪ Check the mobility of the brushes in the compartments
	▪ Incorrect pressure on the brushes	▪ Check the pressure on every brush and correct it, if necessary
	▪ Slip rings with rough surfaces or oval rings	▪ Clean, sandpaper and polish or machine when necessary
	▪ High current density in the brushes	▪ Adequate the brushes to the load conditions
	▪ Badly seated brushes	▪ Seat the brushes correctly
Sparkling.	▪ Badly seated brushes	▪ Correct the brush seating and provide the normal pressure
	▪ Low pressure between the brushes and rings.	
	▪ Overload	▪ Adjust the load to the motor characteristics or dimension a new motor for the application
	▪ Slip rings in poor conditions (ovalized, rough surfaces, with grooves, etc.)	▪ Machine the slip rings
	▪ Brushes stuck in their housings	▪ Check the mobility of the brushes in the brush housings
	▪ Excessive vibration	▪ Check the cause of the vibration and correct it
	▪ Low load causing damages to the slip rings	▪ Adjust the brushes to the actual load condition and machine the slip rings



## 11 DECLARATION OF CONFORMITY Ex



# EU Declaration of Conformity



### Manufacturers:

**WEG Equipamentos Elétricos S.A.**  
Av. Prefeito Waldemar Grubba, 3000  
89256-900 - Jaraguá do Sul - SC - Brazil  
[www.weg.net](http://www.weg.net)

**WEG Industrie (India) PVT. LTD.**  
Plot n° E-20 (North), SIPCOT Industrial Complex  
Phase II - Expansion II.  
Mornapalli Village, Hosur 635 109  
Tamil Nadu - India  
[www.weg.net/in](http://www.weg.net/in)

**WEG (Nantong) Electric Motor Manufacturing CO., LTD.**  
The manufacturer declares under sole responsibility that:

No. 128# - Xinkai South Road, Nantong  
Economic & Technical Development  
Zone, Nantong, Jiangsu Province - China  
[www.weg.net/cn](http://www.weg.net/cn)

**WEGeuro - Industria Electrica S.A.**  
Rua Eng Frederico Ulrich,  
4470-605 - Maia - Porto - Portugal  
[www.weg.net/pt](http://www.weg.net/pt)  
Contact person: Luís Filipe Oliveira Silva Castro Araújo  
Authorised Representative in the European Union  
(Single Contact Point)

WEG synchronous and asynchronous motors and their components used for following lines:

**M..., W60, HGF, W50 and S...**

when installed, maintained and used in applications for which they were designed, and in compliance with the relevant installation standards and manufacturer's instructions, comply with the provisions of the following relevant European Union harmonisation legislation, wherever applicable:

**ATEX Directive 2014/34/EU**  
**Machinery Directive 2006/42/EC\***

**EMC Directive 2014/30/EU** (electric motors are considered inherently benign in terms of electromagnetic compatibility)

The fulfilment of the safety objectives of the relevant European Union harmonization legislation has been demonstrated by compliance with the following standards, wherever applicable:

**EN IEC 60079-0:2018/ EN 60079-2:2014/ EN IEC 60079-7:2015/ A1:2018\*\*/ EN 60079-31:2014/  
EN 60204-1:2018 and EN IEC 60204-11:2019**

\* Low voltage electric motors are not considered under the scope and electric motors designed for use with a voltage rating higher than 1000V are considered partly completed machinery and are supplied with a

\*\* A comparison of the current version of the EN IEC 60079-7:2015/ A1:2018 standard with the previous versions used by some Baseefa ATEX certificates shows that there are no changes in the "state of the art" applicable to the product covered by this Declaration of Conformity. The manufacturer hereby declares that the ATEX Certificates issued by Baseefa meet the Essential Health and Safety Requirements of ATEX Directive 2014/34/EU.

### Declaration of Incorporation:

*The products above cannot be put into service until the machinery into which they have been incorporated has been declared in conformity with the Machinery Directive.*

*A Technical Documentation for the products above is compiled in accordance with part B of annex VII of Machinery Directive 2006/42/EC.*

*We undertake to transmit, in response to a reasoned request by the national authorities, relevant information on the partly completed machinery identified above through WEG authorized representative established in the European Union. The method of transmission shall be electronic or physical method and shall be without prejudice to the intellectual property rights of the manufacturer.*

Jaraguá do Sul, April 14<sup>th</sup>, 2022

DEC3122 Rev00 - English

1/2



# EU Declaration of Conformity



The Notified Bodies listed below performed the applicable conformity assessment procedures set out in ATEX Directive and issued the following certificates:

Model/Lines	Marking	Certificate No.	NB/No.
Pressurized Enclosure “p” – Level of Protection “pxb” – EPL Gb (Category 2)			
Frame sizes 280 - 1250 and NEMA equivalent (M)	II 2G Ex pxb IIB/IIC T4/T3 Gb	TÜV 14 ATEX 7514 X	TÜV Rheinland / 0035
Frame sizes 710 -1600 and NEMA equivalent (S)	II 2G Ex pxb IIB/IIC T4/T3 Gb	TÜV 15 ATEX 7755 X	
Frame sizes 315 - 1000 and NEMA equivalent (W60)	II 2G Ex pxb IIB/IIC T4/T3 Gb	TÜV 17 ATEX 8045 X	
Pressurized Enclosure “p” – Level of Protection “pzc” – EPL Gc (Category 3)			
Frame sizes 280 - 1250 and NEMA equivalent (M)	II 3G Ex pzc IIB/IIC T4/T3 Gc	TÜV 14 ATEX 7571 X*	TÜV Rheinland / 0035
Frame sizes 710-1600 and NEMA equivalent (S)	II 3G Ex pzc IIB/IIC T4/T3 Gc	TÜV 15 ATEX 7754 X*	
Frame sizes 315-1000 and NEMA equivalent (W60)	II 3G Ex pzc IIB/IIC T4/T3 Gc	TÜV 17 ATEX 8110 X*	
Frame sizes 280 -1250 and NEMA equivalent (M)	II 3G Ex pzc IIB/IIC T4/T3 Gc	The manufacturer performed the conformity assessment procedure by the Internal Production Control. **	
Frame sizes 710-1600 and NEMA equivalent (S)	II 3G Ex pzc IIB/IIC T4/T3 Gc		
Frame sizes 315-1000 and NEMA equivalent (W60)	II 3G Ex pzc IIB/IIC T4/T3 Gc		
Increased Safety “e” – Level of Protection “ec” – EPL Gc (Category 3) and Dust Ignition Protection by Enclosure “t” – Level of Protection “tc” – EPL Dc (Category 3)			
Frame sizes 315-630 and NEMA equivalent (HGF/W50)	II 3 G Ex ec IIB/IIC T4/T3 Gc II 3 D Ex tc IIIB/IIIC T125°C/ T160°C Dc	Baseefa 06 ATEX 0349X*	SGS Fimko Oy / 0598
Frame sizes 280-1250 and NEMA equivalent (M)	II 3 G Ex ec IIB/IIC T4/T3 Gc II 3 D Ex tc IIIB/IIIC T125°C/ T160°C Dc	Baseefa 06 ATEX 0348X*	
Frame sizes 315-1000 and NEMA equivalent (W60)	II 3 G Ex ec IIB/IIC T4/T3 Gc II 3 D Ex tc IIIB/IIIC T125°C/ T160°C Dc	Baseefa 14 ATEX 0209X*	
Frame sizes 315-630 and NEMA equivalent (HGF/W50)	II 3 G Ex ec IIB/IIC T4/T3 Gc II 3 D Ex tc IIIB/IIIC T125°C/ T160°C Dc	The manufacturer performed the conformity assessment procedure by the Internal Production Control. **	
Frame sizes 280-1250 and NEMA equivalent (M)	II 3 G Ex ec IIB/IIC T4/T3 Gc II 3 D Ex tc IIIB/IIIC T125°C/ T160°C Dc		
Frame sizes 315-1000 and NEMA equivalent (W60)	II 3 G Ex ec IIB/IIC T4/T3 Gc II 3 D Ex tc IIIB/IIIC T125°C/ T160°C Dc		
Dust Ignition Protection by Enclosure “t” – Level of Protection “tb” – EPL Db (Category 2)			
Frame sizes 315-630 and NEMA equivalent (HGF/W50)	II 2 D Ex tb IIIB/IIIC T125°C/ T160°C Db	Baseefa 10 ATEX 0205X	SGS Fimko Oy / 0598
Frame sizes 280-1250 and NEMA equivalent (M)	II 2 D Ex tb IIIB/IIIC T125°C/ T160°C Db	Baseefa 13 ATEX 0227X	
Frame sizes 315-1000 and NEMA equivalent (W60)	II 2 D Ex tb IIIB/IIIC T125°C/ T160°C Db	Baseefa 14 ATEX 0210X	

\*A certificate issued by a Notified Body is not mandatory for Category 3 electrical equipment, even though, a voluntary certificate can be issued.

\*\* The ATEX Directive allows the manufacturer to make self-declaration of conformity for Category 3 electrical equipment, since the applicable conformity assessment procedure is performed by the manufacturer.

The Quality System for the certificates described above is approved by SGS Fimko Oy (NB0598) under the Quality Assurance Notification **SGS ATEX 5886 (Brazil)**, **SGS ATEX 6908 (India)** and **SGS ATEX 3862 (Portugal)**.

CE marking in: **1998**

Signed for and on behalf of the manufacturer:  
**Rodrigo Fumo Fernandes**  
Engineering Director

Jaraguá do Sul, April 14<sup>th</sup>, 2022

DEC3122 - Rev00 - English

2/2



## 12 ENVIRONMENTAL INFORMATION

### 12.1 PACKAGE

Electric motors are supplied in cardboard, polymer, wood or metallic material packages. These materials are recyclable or reusable and must be properly disposed according to the current regulations of each country. All the wood used in the packaging of WEG motors comes from reforestation and receives anti-fungal treatment.

### 12.2 PRODUCT

Electric motors, under the constructive aspect, are manufactured mainly with ferrous metals (steel, cast iron), nonferrous metals (copper, aluminum) and plastic. The electric motor, in general, is a product that has a long useful life; however, when it must be disposed, WEG recommends that the materials of the packaging and of the product be properly separated and sent for recycling.

The non-recyclable materials must be properly disposed according to the environmental regulations, i.e., in industrial landfills, co-processed in cement kilns or incinerated. The service providers for recycling, disposal in industrial landfills, co-processing or incineration of waste must be properly licensed by the environmental agency of each state to carry out these activities.

### 12.3 HAZARDOUS WASTE

Grease and oil waste used to lubricate the bearings should be disposed, according to the instructions of the relevant environmental agencies, because its improper disposal can cause impacts to the environment.

## 13 SERVICE NETWORK

To consult the Service Network, access the website [www.weg.net](http://www.weg.net).

## 14 WARRANTY TERM

These products, when operated under the conditions stipulated by WEG in the operating manual for such product, are warranted against defects in workmanship and materials for twelve (12) months from start-up date or eighteen (18) months from manufacturer shipment date, whichever occurs first.

However, this warranty does not apply to any product which has been subject to misuse, misapplication, neglect (including without limitation, inadequate maintenance, accident, improper installation, modification, adjustment, repair or any other cases originated from inadequate applications).

The company will neither be responsible for any expenses incurred in installation, removal from service, consequential expenses such as financial losses nor transportation costs as well as tickets and accommodation expenses of a technician when this is requested by the customer.

The repair and/or replacement of parts or components, when effected by WEG within the Warranty period do not give Warranty extension, unless otherwise expressed in writing by WEG.

This constitutes WEG's only warranty in connection with this sale and is in lieu of all other warranties, expressed or implied, written or oral.

There are no implied warranties of merchantability or fitness for a particular purpose that apply to this sale.

No employee, agent, dealer, repair shop or other person is authorized to give any warranties on behalf of WEG nor to assume for WEG any other liability in connection with any of its products.

In case this happens without WEG's authorization, Warranty is automatically cancelled.

### LIABILITY

Except as specified in the foregoing paragraph entitled "Warranty Terms for Engineering Products", the company shall have no obligation or liability whatsoever to the purchaser, including, without limitation, any claims for consequential damages or labor costs, by reason of any breach of the express warranty described therein.

The purchaser further hereby agrees to indemnify and hold the company harmless from any causes of action (other than cost of replacing or repairing the defective product as specified in the foregoing paragraph entitled "Warranty Terms for Engineering Products"), arising directly or indirectly from the acts, omissions or negligence of the purchaser in connection with or arising out of the testing, use, operation, replacement or repair of any product described in this quotation and sold or furnished by the company to the purchaser.



WEG Group - Energy Business Unit  
Jaraguá do Sul - SC - Brazil  
Phone: 55 (47) 3276-4000  
energia@weg.net  
[www.weg.net](http://www.weg.net)

## NOTES

This image shows a single sheet of white paper with horizontal ruling lines. The lines are evenly spaced and run across the width of the page. There are no margins, text, or other markings on the paper.

[illegible]





+55 47 3276.4000



[energia@weg.net](mailto:energia@weg.net)



Jaraguá do Sul - SC - Brazil